# ETSI TS 136 321 V11.5.0 (2014-03)



# LTE;

Evolved Universal Terrestrial Radio Access (E-UTRA); Medium Access Control (MAC) protocol specification (3GPP TS 36.321 version 11.5.0 Release 11)



# Reference RTS/TSGR-0236321vb50 Keywords

#### **ETSI**

650 Route des Lucioles F-06921 Sophia Antipolis Cedex - FRANCE

Tel.: +33 4 92 94 42 00 Fax: +33 4 93 65 47 16

Siret N° 348 623 562 00017 - NAF 742 C Association à but non lucratif enregistrée à la Sous-Préfecture de Grasse (06) N° 7803/88

#### Important notice

The present document can be downloaded from: http://www.etsi.org

The present document may be made available in electronic versions and/or in print. The content of any electronic and/or print versions of the present document shall not be modified without the prior written authorization of ETSI. In case of any existing or perceived difference in contents between such versions and/or in print, the only prevailing document is the print of the Portable Document Format (PDF) version kept on a specific network drive within ETSI Secretariat.

Users of the present document should be aware that the document may be subject to revision or change of status.

Information on the current status of this and other ETSI documents is available at

<a href="http://portal.etsi.org/tb/status/status.asp">http://portal.etsi.org/tb/status/status.asp</a></a>

If you find errors in the present document, please send your comment to one of the following services: <u>http://portal.etsi.org/chaircor/ETSI\_support.asp</u>

#### **Copyright Notification**

No part may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm except as authorized by written permission of ETSI.

The content of the PDF version shall not be modified without the written authorization of ETSI.

The copyright and the foregoing restriction extend to reproduction in all media.

© European Telecommunications Standards Institute 2014.
All rights reserved.

**DECT**<sup>TM</sup>, **PLUGTESTS**<sup>TM</sup>, **UMTS**<sup>TM</sup> and the ETSI logo are Trade Marks of ETSI registered for the benefit of its Members. **3GPP**<sup>TM</sup> and **LTE**<sup>TM</sup> are Trade Marks of ETSI registered for the benefit of its Members and of the 3GPP Organizational Partners.

GSM® and the GSM logo are Trade Marks registered and owned by the GSM Association.

# Intellectual Property Rights

IPRs essential or potentially essential to the present document may have been declared to ETSI. The information pertaining to these essential IPRs, if any, is publicly available for **ETSI members and non-members**, and can be found in ETSI SR 000 314: "Intellectual Property Rights (IPRs); Essential, or potentially Essential, IPRs notified to ETSI in respect of ETSI standards", which is available from the ETSI Secretariat. Latest updates are available on the ETSI Web server (http://ipr.etsi.org).

Pursuant to the ETSI IPR Policy, no investigation, including IPR searches, has been carried out by ETSI. No guarantee can be given as to the existence of other IPRs not referenced in ETSI SR 000 314 (or the updates on the ETSI Web server) which are, or may be, or may become, essential to the present document.

## **Foreword**

This Technical Specification (TS) has been produced by ETSI 3rd Generation Partnership Project (3GPP).

The present document may refer to technical specifications or reports using their 3GPP identities, UMTS identities or GSM identities. These should be interpreted as being references to the corresponding ETSI deliverables.

The cross reference between GSM, UMTS, 3GPP and ETSI identities can be found under <a href="http://webapp.etsi.org/key/queryform.asp">http://webapp.etsi.org/key/queryform.asp</a>.

# Contents

Intelle	lectual Property Rights	2
Forev	word	2
Forev	word	5
1	Scope	<i>.</i>
2	References	6
3	Definitions and abbreviations	6
3.1	Definitions	
3.2	Abbreviations	
4	General	8
4.1	Introduction	
4.2	MAC architecture	
4.2.1	MAC Entities	
4.3	Services	10
4.3.1	Services provided to upper layers	10
4.3.2	Services expected from physical layer	10
4.4	Functions	10
4.5	Channel structure	11
4.5.1	Transport Channels	11
4.5.2	Logical Channels	
4.5.3	Mapping of Transport Channels to Logical Channels	
4.5.3.1	1 11 6	
4.5.3.2	2 Downlink mapping	12
5	MAC procedures	13
5.1	Random Access procedure	13
5.1.1	Random Access Procedure initialization	13
5.1.2	Random Access Resource selection	14
5.1.3	Random Access Preamble transmission	
5.1.4	Random Access Response reception	
5.1.5	Contention Resolution	
5.1.6	Completion of the Random Access procedure	
5.2	Maintenance of Uplink Time Alignment	
5.3	DL-SCH data transfer	
5.3.1	DL Assignment reception	
5.3.2	HARQ operation	
5.3.2.1		
5.3.2.2		
5.3.3	Disassembly and demultiplexing	
5.4	UL-SCH data transfer	
5.4.1 5.4.2	UL Grant reception	
5.4.2.1 5.4.2.1	HARQ operation	
5.4.2.2		
5.4.2. <sub>2</sub> 5.4.3	Multiplexing and assembly	
5.4.3.1		
5.4.3.2		
5.4.4	Scheduling Request	
5.4.5	Buffer Status Reporting	
5.4.6	Power Headroom Reporting	
5.5	PCH reception	
5.6	BCH reception	
5.7	Discontinuous Reception (DRX)	
5.8	MAC reconfiguration	
5.9	MAC Reset	

5.10		eduling	
5.10.1			
5.10.2			
5.11	Handling of unknown, unforeseen and erroneous protocol data		
5.12			
5.13	Activation/Deactivat	ion of SCells	34
6 l	Protocol Data Units, f	ormats and parameters	35
6.1	Protocol Data Units.		35
6.1.1	General		35
6.1.2		SCH and UL-SCH except transparent MAC and Random Access Response, MCH)	
6.1.3		ements	
6.1.3.1	Buffer Status	Report MAC Control Elements	36
6.1.3.2		C Control Element	
6.1.3.3		nd MAC Control Element	
6.1.3.4		n Resolution Identity MAC Control Element	
6.1.3.5	Timing Adva	nce Command MAC Control Element	40
6.1.3.6	Power Headro	oom MAC Control Element	40
6.1.3.6a	Extended Pov	ver Headroom MAC Control Element	41
6.1.3.7	MCH Schedu	ling Information MAC Control Element	42
6.1.3.8		eactivation MAC Control Element	
6.1.4		sparent MAC)	
6.1.5	MAC PDU (Rand	dom Access Response)	43
6.2		ters	
6.2.1	MAC header for	DL-SCH, UL-SCH and MCH	44
6.2.2		Random Access Response	
6.2.3	MAC payload for	r Random Access Response	46
7	Variables and constan	ts	46
7.1	RNTI values		46
7.2	Backoff Parameter v	alues	47
7.3	PRACH Mask Index	values	48
7.4	Subframe_Offset val	ues	48
7.5	TTI_BUNDLE_SIZI	E value	48
7.6	DELTA_PREAMBL	.E values	48
7.7			
Annex	A (normative):	Handling of measurement gaps	50
Annex	<b>B</b> (normative):	Contention resolution for RACH access	51
Annex	C (informative):	Intended UE behaviour for DRX Timers	52
Annex	D (informative):	Change history	53
History	<i>/</i>		58

# **Foreword**

This Technical Specification has been produced by the 3<sup>rd</sup> Generation Partnership Project (3GPP).

The contents of the present document are subject to continuing work within the TSG and may change following formal TSG approval. Should the TSG modify the contents of the present document, it will be re-released by the TSG with an identifying change of release date and an increase in version number as follows:

Version x.y.z

#### where:

- x the first digit:
  - 1 presented to TSG for information;
  - 2 presented to TSG for approval;
  - 3 or greater indicates TSG approved document under change control.
- y the second digit is incremented for all changes of substance, i.e. technical enhancements, corrections, updates, etc.
- z the third digit is incremented when editorial only changes have been incorporated in the document.

# 1 Scope

The present document specifies the E-UTRA MAC protocol.

# 2 References

The following documents contain provisions which, through reference in this text, constitute provisions of the present document.

- References are either specific (identified by date of publication, edition number, version number, etc.) or non-specific.
- For a specific reference, subsequent revisions do not apply.
- For a non-specific reference, the latest version applies. In the case of a reference to a 3GPP document (including a GSM document), a non-specific reference implicitly refers to the latest version of that document *in the same Release as the present document*.
- [1] 3GPP TR 21.905: "Vocabulary for 3GPP Specifications". 3GPP TR 36.213: "Evolved Universal Terrestrial Radio Access (E-UTRA); Physical Layer [2] Procedures". 3GPP TS 36.322: "Evolved Universal Terrestrial Radio Access (E-UTRA); Radio Link Control [3] (RLC) protocol specification". [4] 3GPP TS 36.323: "Evolved Universal Terrestrial Radio Access (E-UTRA); Packet Data Convergence Protocol (PDCP) Specification". [5] 3GPP TS 36.212: "Evolved Universal Terrestrial Radio Access (E-UTRA); Multiplexing and channel coding". [6] 3GPP TS 36.214: "Evolved Universal Terrestrial Radio Access (E-UTRA); Physical layer; Measurements". [7] 3GPP TS 36.211: "Evolved Universal Terrestrial Radio Access (E-UTRA); Physical Channels and Modulation". [8] 3GPP TS 36.331: "Evolved Universal Terrestrial Radio Access (E-UTRA); Radio Resource Control (RRC); Protocol specification". [9] 3GPP TS 36.133: "Evolved Universal Terrestrial Radio Access (E-UTRA); Requirements for support of radio resource management".

3GPP TS 36.101: "Evolved Universal Terrestrial Radio Access (E-UTRA); User Equipment (UE)

3GPP TS 36.216: "Evolved Universal Terrestrial Radio Access (E-UTRA); Physical layer for

# 3 Definitions and abbreviations

relaying operation".

radio transmission and reception".

#### 3.1 Definitions

[10]

[11]

For the purposes of the present document, the terms and definitions given in TR 21.905 [1] and the following apply. A term defined in the present document takes precedence over the definition of the same term, if any, in TR 21.905 [1].

**Active Time:** Time related to DRX operation, as defined in subclause 5.7, during which the UE monitors the PDCCH in PDCCH-subframes.

*mac-ContentionResolutionTimer*: Specifies the number of consecutive subframe(s) during which the UE shall monitor the PDCCH after Msg3 is transmitted.

**DRX Cycle:** Specifies the periodic repetition of the On Duration followed by a possible period of inactivity (see figure 3.1-1 below).

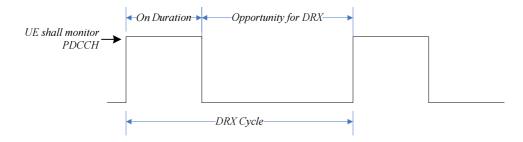


Figure 3.1-1: DRX Cycle

*drx-InactivityTimer*: Specifies the number of consecutive PDCCH-subframe(s) after the subframe in which a PDCCH indicates an initial UL or DL user data transmission for this UE.

*drx-RetransmissionTimer*: Specifies the maximum number of consecutive PDCCH-subframe(s) until a DL retransmission is received.

drxShortCycleTimer: Specifies the number of consecutive subframe(s) the UE shall follow the Short DRX cycle.

drxStartOffset: Specifies the subframe where the DRX Cycle starts.

**HARQ information**: HARQ information consists of New Data Indicator (NDI), Transport Block (TB) size. For DL-SCH transmissions the HARQ information also includes HARQ process ID. For UL-SCH transmission the HARQ info also includes Redundancy Version (RV). In case of spatial multiplexing on DL-SCH the HARQ information comprises a set of NDI and TB size for each transport block.

**HARQ RTT Timer**: This parameter specifies the minimum amount of subframe(s) before a DL HARQ retransmission is expected by the UE.

**Msg3**: Message transmitted on UL-SCH containing a C-RNTI MAC CE or CCCH SDU, submitted from upper layer and associated with the UE Contention Resolution Identity, as part of a random access procedure.

onDurationTimer: Specifies the number of consecutive PDCCH-subframe(s) at the beginning of a DRX Cycle.

**PDCCH:** Refers to the PDCCH [7], EPDCCH (in subframes when configured) or, for an RN with R-PDCCH configured and not suspended, to the R-PDCCH.

**PDCCH-subframe:** Refers to a subframe with PDCCH. For FDD UE operation, this represents any subframe; for TDD UE operation, if UE is capable of simultaneous reception and transmission in the aggregated cells, this represents the union of downlink subframes and subframes including DwPTS of all serving cells, except serving cells that are configured with *schedulingCellId* [8]; otherwise, this represents the subframes where the PCell is configured as a downlink subframe or a subframe including DwPTS.

For RNs with an RN subframe configuration configured and not suspended, in its communication with the E-UTRAN, this represents all downlink subframes configured for RN communication with the E-UTRAN.

**PRACH Resource Index**: The index of a PRACH within a system frame [7]

Primary Timing Advance Group: Timing Advance Group containing the PCell.

*ra-PRACH-MaskIndex*: Defines in which PRACHs within a system frame the UE can transmit a Random Access Preamble (see subclause 7.3).

**RA-RNTI:** The Random Access RNTI is used on the PDCCH when Random Access Response messages are transmitted. It unambiguously identifies which time-frequency resource was utilized by the UE to transmit the Random Access preamble.

**Secondary Timing Advance Group:** Timing Advance Group not containing the PCell. A Secondary Timing Advance Group contains at least one Serving Cell with an UL configured.

**Serving Cell:** A Primary or a Secondary Cell [8].

**Timing Advance Group:** A group of Serving Cells that is configured by RRC and that, for the cells with an UL configured, using the same timing reference cell and the same Timing Advance value.

NOTE: A timer is running once it is started, until it is stopped or until it expires; otherwise it is not running. A timer can be started if it is not running or restarted if it is running. A Timer is always started or restarted from its initial value.

#### 3.2 Abbreviations

For the purposes of the present document, the abbreviations given in TR 21.905 [1] and the following apply. An abbreviation defined in the present document takes precedence over the definition of the same abbreviation, if any, in TR 21.905 [1].

BSR Buffer Status Report

C-RNTI Cell RNTI

CQI Channel Quality Indicator

E-UTRA Evolved UMTS Terrestrial Radio Access

E-UTRAN Evolved UMTS Terrestrial Radio Access Network

MAC Medium Access Control

M-RNTI MBMS RNTI

LCG Logical Channel Group
PCell Primary Cell [8]

PHR Power Headroom Report
PMI Precoding Matrix Index

P-RNTI Paging RNTI

pTAG Primary Timing Advance Group PTI Precoding Type Indicator RA-RNTI Random Access RNTI

RI Rank Indicator RN Relay Node

RNTI Radio Network Temporary Identifier

SCell Secondary Cell [8]
SI-RNTI System Information RNTI

SR Scheduling Request
SRS Sounding Reference Syml

SRS Sounding Reference Symbols sTAG Secondary Timing Advance Group

TAG Timing Advance Group
TB Transport Block

TPC-PUCCH-RNTI Transmit Power Control-Physical Uplink Control Channel-RNTI TPC-PUSCH-RNTI Transmit Power Control-Physical Uplink Shared Channel-RNTI

# 4 General

#### 4.1 Introduction

The objective is to describe the MAC architecture and the MAC entity from a functional point of view. Functionality specified for the UE equally applies to the RN for functionality necessary for the RN. There is also functionality which is only applicable to the RN, in which case the specification denotes the RN instead of the UE. RN-specific behaviour is not applicable to the UE.

## 4.2 MAC architecture

The description in this sub clause is a model and does not specify or restrict implementations.

RRC is in control of configuration of MAC.

#### 4.2.1 MAC Entities

E-UTRA defines two MAC entities; one in the UE and one in the E-UTRAN. These MAC entities handle the following transport channels:

- Broadcast Channel (BCH);
- Downlink Shared Channel(s) (DL-SCH);
- Paging Channel (PCH);
- Uplink Shared Channel(s) (UL-SCH);
- Random Access Channel(s) (RACH);
- Multicast Channel(s) (MCH).

The exact functions performed by the MAC entities are different in the UE from those performed in the E-UTRAN.

The RN includes both MAC entities; one for communication with UEs and one for communication with the E-UTRAN.

If the UE is configured with one or more SCells, there are multiple DL-SCH and there may be multiple UL-SCH and RACH per UE; one DL-SCH and UL-SCH on the PCell, one DL-SCH, zero or one UL-SCH and zero or one RACH for each SCell.

Figure 4.2.1-1 illustrates one possible structure for the UE side MAC entity, and it should not restrict implementation.

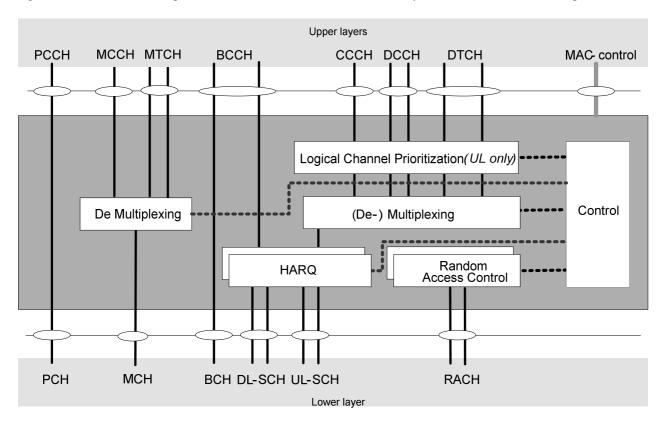


Figure 4.2.1-1: MAC structure overview, UE side

## 4.3 Services

# 4.3.1 Services provided to upper layers

This clause describes the different services provided by MAC sublayer to upper layers.

- data transfer
- radio resource allocation

# 4.3.2 Services expected from physical layer

The physical layer provides the following services to MAC:

- data transfer services;
- signalling of HARQ feedback;
- signalling of Scheduling Request;
- measurements (e.g. Channel Quality Indication (CQI)).

The access to the data transfer services is through the use of transport channels. The characteristics of a transport channel are defined by its transport format (or format set), specifying the physical layer processing to be applied to the transport channel in question, such as channel coding and interleaving, and any service-specific rate matching as needed.

#### 4.4 Functions

The following functions are supported by MAC sublayer:

- mapping between logical channels and transport channels;
- multiplexing of MAC SDUs from one or different logical channels onto transport blocks (TB) to be delivered to the physical layer on transport channels;
- demultiplexing of MAC SDUs from one or different logical channels from transport blocks (TB) delivered from the physical layer on transport channels;
- scheduling information reporting;
- error correction through HARQ;
- priority handling between UEs by means of dynamic scheduling;
- priority handling between logical channels of one UE;
- Logical Channel prioritisation;
- transport format selection.

The location of the different functions and their relevance for uplink and downlink respectively is illustrated in Table 4.4-1.

Table 4.4-1: MAC function location and link direction association.

MAC function	UE	eNB	Downlink	Uplink
Mapping between logical channels and transport channels	Χ		X	Χ
		Χ	X	X
Multiplexing	Χ			X
		Χ	X	
Demultiplexing	Χ		X	
		Χ		X
Error correction through HARQ	Χ		X	X
		Χ	X	X
Transport Format Selection		Χ	Χ	X
Priority handling between UEs		Χ	X	X
Priority handling between logical channels of one UE		Χ	X	X
Logical Channel prioritisation	Χ			X
Scheduling information reporting	Χ			Χ

# 4.5 Channel structure

The MAC sublayer operates on the channels defined below; transport channels are SAPs between MAC and Layer 1, logical channels are SAPs between MAC and RLC.

# 4.5.1 Transport Channels

The transport channels used by MAC are described in Table 4.5.1-1 below.

Table 4.5.1-1: Transport channels used by MAC

Transport channel name	Acronym	Downlink	Uplink
Broadcast Channel	BCH	Χ	
Downlink Shared Channel	DL-SCH	X	
Paging Channel	PCH	Χ	
Multicast Channel	MCH	Χ	
Uplink Shared Channel	UL-SCH		X
Random Access Channel	RACH		Χ

# 4.5.2 Logical Channels

The MAC layer provides data transfer services on logical channels. A set of logical channel types is defined for different kinds of data transfer services as offered by MAC.

Each logical channel type is defined by what type of information is transferred.

MAC provides the control and traffic channels listed in Table 4.5.2-1 below.

Table 4.5.2-1: Logical channels provided by MAC.

Logical channel name	Acronym	Control channel	Traffic channel
Broadcast Control Channel	BCCH	Χ	
Paging Control Channel	PCCH	Χ	
Common Control Channel	CCCH	Χ	
Dedicated Control Channel	DCCH	Χ	
Multicast Control Channel	MCCH	Χ	
Dedicated Traffic Channel	DTCH		Χ
Multicast Traffic Channel	MTCH		Χ

# 4.5.3 Mapping of Transport Channels to Logical Channels

The mapping of logical channels on transport channels depends on the multiplexing that is configured by RRC.

## 4.5.3.1 Uplink mapping

The MAC entity is responsible for mapping logical channels for the uplink onto uplink transport channels. The uplink logical channels can be mapped as described in Figure 4.5.3.1-1 and Table 4.5.3.1-1.

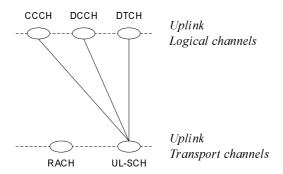


Figure 4.5.3.1-1

Table 4.5.3.1-1: Uplink channel mapping.

Transport channel	UL-SCH	RACH
Logical channel		
CCCH	X	
DCCH	X	
DTCH	X	

# 4.5.3.2 Downlink mapping

The MAC entity is responsible for mapping the downlink logical channels to downlink transport channels. The downlink logical channels can be mapped as described in Figure 4.5.3.2-1 and Table 4.5.3.2-1.

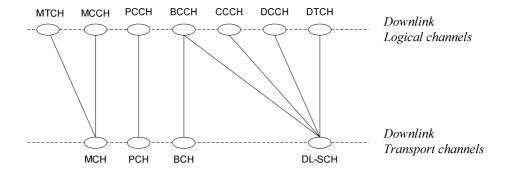


Figure 4.5.3.2-1

Table 4.5.3.2-1: Downlink channel mapping.

Transport channel	всн	PCH	DL-SCH	МСН
Logical channel				
BCCH	X		Χ	
PCCH		Χ		
CCCH			Χ	
DCCH			Χ	
DTCH			Χ	
MCCH				X
MTCH				X

# 5 MAC procedures

# 5.1 Random Access procedure

#### 5.1.1 Random Access Procedure initialization

The Random Access procedure described in this subclause is initiated by a PDCCH order or by the MAC sublayer itself. Random Access procedure on an SCell shall only be initiated by a PDCCH order. If a UE receives a PDCCH transmission consistent with a PDCCH order [5] masked with its C-RNTI, and for a specific Serving Cell, the UE shall initiate a Random Access procedure on this Serving Cell. For Random Access on the PCell a PDCCH order or RRC optionally indicate the *ra-PreambleIndex* and the *ra-PRACH-MaskIndex*; and for Random Access on an SCell, the PDCCH order indicates the *ra-PreambleIndex* with a value different from 000000 and the *ra-PRACH-MaskIndex*. For the pTAG preamble transmission on PRACH and reception of a PDCCH order are only supported for PCell.

Before the procedure can be initiated, the following information for related Serving Cell is assumed to be available [8]:

- the available set of PRACH resources for the transmission of the Random Access Preamble, prach-ConfigIndex.
- the groups of Random Access Preambles and the set of available Random Access Preambles in each group (PCell only):

The preambles that are contained in Random Access Preambles group A and Random Access Preambles group B are calculated from the parameters *numberOfRA-Preambles* and *sizeOfRA-PreamblesGroupA*:

If *sizeOfRA-PreamblesGroupA* is equal to *numberOfRA-Preambles* then there is no Random Access Preambles group B. The preambles in Random Access Preamble group A are the preambles 0 to *sizeOfRA-PreamblesGroupA* – 1 and, if it exists, the preambles in Random Access Preamble group B are the preambles *sizeOfRA-PreamblesGroupA* to *numberOfRA-Preambles* – 1 from the set of 64 preambles as defined in [7].

- if Random Access Preambles group B exists, the thresholds, *messagePowerOffsetGroupB* and *messageSizeGroupA*, the configured UE transmitted power of the Serving Cell performing the Random Access Procedure, P<sub>CMAX, c</sub> [10], and the offset between the preamble and Msg3, *deltaPreambleMsg3*, that are required for selecting one of the two groups of Random Access Preambles (PCell only).
- the RA response window size ra-ResponseWindowSize.
- the power-ramping factor *powerRampingStep*.
- the maximum number of preamble transmission *preambleTransMax*.
- the initial preamble power *preambleInitialReceivedTargetPower*.
- the preamble format based offset DELTA\_PREAMBLE (see subclause 7.6).
- the maximum number of Msg3 HARQ transmissions maxHARQ-Msg3Tx (PCell only).
- the Contention Resolution Timer *mac-ContentionResolutionTimer* (PCell only).

NOTE: The above parameters may be updated from upper layers before each Random Access procedure is initiated.

The Random Access procedure shall be performed as follows:

- Flush the Msg3 buffer;
- set the PREAMBLE TRANSMISSION COUNTER to 1;
- set the backoff parameter value in the UE to 0 ms;
- for the RN, suspend any RN subframe configuration;
- proceed to the selection of the Random Access Resource (see subclause 5.1.2).

NOTE: There is only one Random Access procedure ongoing at any point in time. If the UE receives a request for a new Random Access procedure while another is already ongoing, it is up to UE implementation whether to continue with the ongoing procedure or start with the new procedure.

#### 5.1.2 Random Access Resource selection

The Random Access Resource selection procedure shall be performed as follows:

- If *ra-PreambleIndex* (Random Access Preamble) and *ra-PRACH-MaskIndex* (PRACH Mask Index) have been explicitly signalled and *ra-PreambleIndex* is not 000000:
  - the Random Access Preamble and the PRACH Mask Index are those explicitly signalled.
- else the Random Access Preamble shall be selected by the UE as follows:
  - If Msg3 has not yet been transmitted, the UE shall:
    - if Random Access Preambles group B exists and if the potential message size (data available for transmission plus MAC header and, where required, MAC control elements) is greater than messageSizeGroupA and if the pathloss is less than P<sub>CMAX,c</sub> (of the Serving Cell performing the Random Access Procedure) preambleInitialReceivedTargetPower deltaPreambleMsg3 messagePowerOffsetGroupB, then:
      - select the Random Access Preambles group B;
    - else:
      - select the Random Access Preambles group A.
  - else, if Msg3 is being retransmitted, the UE shall:
    - select the same group of Random Access Preambles as was used for the preamble transmission attempt corresponding to the first transmission of Msg3.
  - randomly select a Random Access Preamble within the selected group. The random function shall be such that each of the allowed selections can be chosen with equal probability;
  - set PRACH Mask Index to 0.
- determine the next available subframe containing PRACH permitted by the restrictions given by the *prach-ConfigIndex*, the PRACH Mask Index (see subclause 7.3) and physical layer timing requirements [2] (a UE may take into account the possible occurrence of measurement gaps when determining the next available PRACH subframe):
- if the transmission mode is TDD and the PRACH Mask Index is equal to zero:
  - if *ra-PreambleIndex* was explicitly signalled and it was not 000000 (i.e., not selected by MAC):
    - randomly select, with equal probability, one PRACH from the PRACHs available in the determined subframe.
  - else:
    - randomly select, with equal probability, one PRACH from the PRACHs available in the determined subframe and the next two consecutive subframes.
- else:
  - determine a PRACH within the determined subframe in accordance with the requirements of the PRACH Mask Index.
- proceed to the transmission of the Random Access Preamble (see subclause 5.1.3).

# 5.1.3 Random Access Preamble transmission

The random-access procedure shall be performed as follows:

- set PREAMBLE\_RECEIVED\_TARGET\_POWER to preambleInitialReceivedTargetPower + DELTA\_PREAMBLE + (PREAMBLE\_TRANSMISSION\_COUNTER - 1) \* powerRampingStep;
- instruct the physical layer to transmit a preamble using the selected PRACH, corresponding RA-RNTI, preamble index and PREAMBLE RECEIVED TARGET POWER.

# 5.1.4 Random Access Response reception

Once the Random Access Preamble is transmitted and regardless of the possible occurrence of a measurement gap, the UE shall monitor the PDCCH of the PCell for Random Access Response(s) identified by the RA-RNTI defined below, in the RA Response window which starts at the subframe that contains the end of the preamble transmission [7] plus three subframes and has length *ra-ResponseWindowSize* subframes. The RA-RNTI associated with the PRACH in which the Random Access Preamble is transmitted, is computed as:

$$RA-RNTI = 1 + t_id+10*f_id$$

Where  $t_i$  is the index of the first subframe of the specified PRACH ( $0 \le t_i$  id <10), and  $f_i$  is the index of the specified PRACH within that subframe, in ascending order of frequency domain ( $0 \le t_i$  id < 6). The UE may stop monitoring for Random Access Response(s) after successful reception of a Random Access Response containing Random Access Preamble identifiers that matches the transmitted Random Access Preamble.

- If a downlink assignment for this TTI has been received on the PDCCH for the RA-RNTI and the received TB is successfully decoded, the UE shall regardless of the possible occurrence of a measurement gap:
  - if the Random Access Response contains a Backoff Indicator subheader:
    - set the backoff parameter value in the UE as indicated by the BI field of the Backoff Indicator subheader and Table 7.2-1.
  - else, set the backoff parameter value in the UE to 0 ms.
  - if the Random Access Response contains a Random Access Preamble identifier corresponding to the transmitted Random Access Preamble (see subclause 5.1.3), the UE shall:
    - consider this Random Access Response reception successful and apply the following actions for the serving cell where the Random Access Preamble was transmitted:
      - process the received Timing Advance Command (see subclause 5.2);
      - indicate the *preambleInitialReceivedTargetPower* and the amount of power ramping applied to the latest preamble transmission to lower layers (i.e., (PREAMBLE\_TRANSMISSION\_COUNTER 1) \* powerRampingStep);
      - process the received UL grant value and indicate it to the lower layers;
    - if ra-PreambleIndex was explicitly signalled and it was not 000000 (i.e., not selected by MAC):
      - consider the Random Access procedure successfully completed.
    - else, if the Random Access Preamble was selected by UE MAC:
      - set the Temporary C-RNTI to the value received in the Random Access Response message no later than at the time of the first transmission corresponding to the UL grant provided in the Random Access Response message;
      - if this is the first successfully received Random Access Response within this Random Access procedure:
        - if the transmission is not being made for the CCCH logical channel, indicate to the Multiplexing and assembly entity to include a C-RNTI MAC control element in the subsequent uplink transmission;

- obtain the MAC PDU to transmit from the "Multiplexing and assembly" entity and store it in the Msg3 buffer.
- NOTE: When an uplink transmission is required, e.g., for contention resolution, the eNB should not provide a grant smaller than 56 bits in the Random Access Response.
- NOTE: If within a Random Access procedure, an uplink grant provided in the Random Access Response for the same group of Random Access Preambles has a different size than the first uplink grant allocated during that Random Access procedure, the UE behavior is not defined.

If no Random Access Response is received within the RA Response window, or if none of all received Random Access Responses contains a Random Access Preamble identifier corresponding to the transmitted Random Access Preamble, the Random Access Response reception is considered not successful and the UE shall:

- increment PREAMBLE TRANSMISSION COUNTER by 1;
- If PREAMBLE\_TRANSMISSION\_COUNTER = *preambleTransMax* + 1:
  - if the Random Access Preamble is transmitted on the PCell:
    - indicate a Random Access problem to upper layers;
  - if the Random Access Preamble is transmitted on an SCell:
    - consider the Random Access procedure unsuccessfully completed.
- if in this Random Access procedure, the Random Access Preamble was selected by MAC:
  - based on the backoff parameter in the UE, select a random backoff time according to a uniform distribution between 0 and the Backoff Parameter Value;
  - delay the subsequent Random Access transmission by the backoff time;
- proceed to the selection of a Random Access Resource (see subclause 5.1.2).

#### 5.1.5 Contention Resolution

Contention Resolution is based on either C-RNTI on PDCCH of the PCell or UE Contention Resolution Identity on DL-SCH.

Once Msg3 is transmitted, the UE shall:

- start mac-ContentionResolutionTimer and restart mac-ContentionResolutionTimer at each HARQ retransmission;
- regardless of the possible occurrence of a measurement gap, monitor the PDCCH until *mac-ContentionResolutionTimer* expires or is stopped;
- if notification of a reception of a PDCCH transmission is received from lower layers, the UE shall:
  - if the C-RNTI MAC control element was included in Msg3:
    - if the Random Access procedure was initiated by the MAC sublayer itself and the PDCCH transmission is addressed to the C-RNTI and contains an UL grant for a new transmission; or
    - if the Random Access procedure was initiated by a PDCCH order and the PDCCH transmission is addressed to the C-RNTI:
      - consider this Contention Resolution successful;
      - stop mac-ContentionResolutionTimer;
      - discard the Temporary C-RNTI;
      - consider this Random Access procedure successfully completed.

- else if the CCCH SDU was included in Msg3 and the PDCCH transmission is addressed to its Temporary C-RNTI:
  - if the MAC PDU is successfully decoded:
    - stop mac-ContentionResolutionTimer;
    - if the MAC PDU contains a UE Contention Resolution Identity MAC control element; and
    - if the UE Contention Resolution Identity included in the MAC control element matches the CCCH SDU transmitted in Msg3:
      - consider this Contention Resolution successful and finish the disassembly and demultiplexing of the MAC PDU;
      - set the C-RNTI to the value of the Temporary C-RNTI;
      - discard the Temporary C-RNTI;
      - consider this Random Access procedure successfully completed.
    - else
      - discard the Temporary C-RNTI;
      - consider this Contention Resolution not successful and discard the successfully decoded MAC PDU.
- if mac-ContentionResolutionTimer expires:
  - discard the Temporary C-RNTI;
  - consider the Contention Resolution not successful.
- if the Contention Resolution is considered not successful the UE shall:
  - flush the HARQ buffer used for transmission of the MAC PDU in the Msg3 buffer;
  - increment PREAMBLE\_TRANSMISSION\_COUNTER by 1;
  - If PREAMBLE\_TRANSMISSION\_COUNTER = preambleTransMax + 1:
    - indicate a Random Access problem to upper layers.
  - based on the backoff parameter in the UE, select a random backoff time according to a uniform distribution between 0 and the Backoff Parameter Value;
  - delay the subsequent Random Access transmission by the backoff time;
  - proceed to the selection of a Random Access Resource (see subclause 5.1.2).

# 5.1.6 Completion of the Random Access procedure

At completion of the Random Access procedure, the UE shall:

- discard explicitly signalled ra-PreambleIndex and ra-PRACH-MaskIndex, if any;
- flush the HARQ buffer used for transmission of the MAC PDU in the Msg3 buffer.

In addition, the RN shall resume the suspended RN subframe configuration, if any.

# 5.2 Maintenance of Uplink Time Alignment

The UE has a configurable timer *timeAlignmentTimer* per TAG. The *timeAlignmentTimer* is used to control how long the UE considers the Serving Cells belonging to the associated TAG to be uplink time aligned [8].

The UE shall:

- when a Timing Advance Command MAC control element is received:
  - apply the Timing Advance Command for the indicated TAG;
  - start or restart the *timeAlignmentTimer* associated with the indicated TAG.
- when a Timing Advance Command is received in a Random Access Response message for a serving cell belonging to a TAG:
  - if the Random Access Preamble was not selected by UE MAC:
    - apply the Timing Advance Command for this TAG;
    - start or restart the *timeAlignmentTimer* associated with this TAG.
  - else, if the *timeAlignmentTimer* associated with this TAG is not running:
    - apply the Timing Advance Command for this TAG;
    - start the *timeAlignmentTimer* associated with this TAG;
    - when the contention resolution is considered not successful as described in subclause 5.1.5, stop *timeAlignmentTimer* associated with this TAG.
  - else:
    - ignore the received Timing Advance Command.
- when a *timeAlignmentTimer* expires:
  - if the *timeAlignmentTimer* is associated with the pTAG:
    - flush all HARQ buffers for all serving cells;
    - notify RRC to release PUCCH/SRS for all serving cells;
    - clear any configured downlink assignments and uplink grants;
    - consider all running timeAlignmentTimers as expired;
  - else if the *timeAlignmentTimer* is associated with an sTAG, then for all Serving Cells belonging to this TAG:
    - flush all HARQ buffers;
    - notify RRC to release SRS.

The UE shall not perform any uplink transmission on a Serving Cell except the Random Access Preamble transmission when the *timeAlignmentTimer* associated with the TAG to which this Serving Cell belongs is not running. Furthermore, when the *timeAlignmentTimer* associated with the pTAG is not running, the UE shall not perform any uplink transmission on any Serving Cell except the Random Access Preamble transmission on the PCell.

NOTE: A UE stores or maintains  $N_{TA}$  upon expiry of associated timeAlignmentTimer, where  $N_{TA}$  is defined in [7]. The UE applies a received Timing Advance Command MAC control element and starts associated timeAlignmentTimer also when the timeAlignmentTimer is not running.

# 5.3 DL-SCH data transfer

# 5.3.1 DL Assignment reception

Downlink assignments transmitted on the PDCCH indicate if there is a transmission on a DL-SCH for a particular UE and provide the relevant HARQ information.

When the UE has a C-RNTI, Semi-Persistent Scheduling C-RNTI, or Temporary C-RNTI, the UE shall for each TTI during which it monitors PDCCH and for each Serving Cell:

- if a downlink assignment for this TTI and this Serving Cell has been received on the PDCCH for the UE's C-RNTI, or Temporary C-RNTI:
  - if this is the first downlink assignment for this Temporary C-RNTI:
    - consider the NDI to have been toggled.
  - if the downlink assignment is for UE's C-RNTI and if the previous downlink assignment indicated to the HARQ entity of the same HARQ process was either a downlink assignment received for the UE's Semi-Persistent Scheduling C-RNTI or a configured downlink assignment:
    - consider the NDI to have been toggled regardless of the value of the NDI.
  - indicate the presence of a downlink assignment and deliver the associated HARQ information to the HARQ entity for this TTI.
- else, if this Serving Cell is the PCell and a downlink assignment for this TTI has been received for the PCell on the PDCCH of the PCell for the UE's Semi-Persistent Scheduling C-RNTI:
  - if the NDI in the received HARQ information is 1:
    - consider the NDI not to have been toggled;
    - indicate the presence of a downlink assignment and deliver the associated HARQ information to the HARQ entity for this TTI.
  - else, if the NDI in the received HARQ information is 0:
    - if PDCCH contents indicate SPS release:
      - clear the configured downlink assignment (if any);
      - if the *timeAlignmentTimer* associated with the pTAG is running:
        - indicate a positive acknowledgement for the downlink SPS release to the physical layer.
    - else:
      - store the downlink assignment and the associated HARQ information as configured downlink assignment;
      - initialise (if not active) or re-initialise (if already active) the configured downlink assignment to start in this TTI and to recur according to rules in subclause 5.10.1;
      - set the HARQ Process ID to the HARQ Process ID associated with this TTI;
      - consider the NDI bit to have been toggled;
      - indicate the presence of a configured downlink assignment and deliver the stored HARQ information to the HARQ entity for this TTI.
- else, if this Serving Cell is the PCell and a downlink assignment for this TTI has been configured for the PCell and there is no measurement gap in this TTI; and
- if this TTI is not an MBSFN subframe of the PCell or the UE is configured with transmission mode *tm9* or *tm10* on the PCell:
  - instruct the physical layer to receive, in this TTI, transport block on the DL-SCH according to the configured downlink assignment and to deliver it to the HARQ entity;
  - set the HARQ Process ID to the HARQ Process ID associated with this TTI;
  - consider the NDI bit to have been toggled;

- indicate the presence of a configured downlink assignment and deliver the stored HARQ information to the HARQ entity for this TTI.

For configured downlink assignments, the HARQ Process ID associated with this TTI is derived from the following equation:

HARQ Process ID =  $[floor(CURRENT\_TTI/semiPersistSchedIntervalDL)]$  modulo numberOfConfSPS-Processes, where  $CURRENT\_TTI=[(SFN*10) + subframe number]$ .

When the UE needs to read BCCH, the UE may, based on the scheduling information from RRC:

- if a downlink assignment for this TTI has been received on the PDCCH for the SI-RNTI;
  - if the redundancy version is not defined in the PDCCH format:
    - the redundancy version of the received downlink assignment for this TTI is determined by  $RV_K = \text{ceiling}(3/2*k)$  modulo 4, where k depends on the type of system information message: for SystemInformationBlockType1 message, k = (SFN/2) modulo 4, where SFN is the system frame number; for SystemInformation messages,  $k=i \mod 4$ ,  $i=0,1,...,n_s^w-1$ , where i denotes the subframe number within the SI window  $n_s^w$ ;
  - indicate a downlink assignment and redundancy version for the dedicated broadcast HARQ process to the HARQ entity for this TTI.

# 5.3.2 HARQ operation

#### 5.3.2.1 HARQ Entity

There is one HARQ entity at the UE for each Serving Cell which maintains a number of parallel HARQ processes. Each HARQ process is associated with a HARQ process identifier. The HARQ entity directs HARQ information and associated TBs received on the DL-SCH to the corresponding HARQ processes (see subclause 5.3.2.2).

The number of DL HARQ processes per HARQ entity is specified in [2], clause 7.

When the physical layer is configured for downlink spatial multiplexing [2], one or two TBs are expected per subframe and they are associated with the same HARO process. Otherwise, one TB is expected per subframe.

The UE shall:

- If a downlink assignment has been indicated for this TTI:
  - allocate the TB(s) received from the physical layer and the associated HARQ information to the HARQ process indicated by the associated HARQ information.
- If a downlink assignment has been indicated for the broadcast HARQ process:
  - allocate the received TB to the broadcast HARQ process.

NOTE: In case of BCCH a dedicated broadcast HARQ process is used.

#### 5.3.2.2 HARQ process

For each subframe where a transmission takes place for the HARQ process, one or two (in case of downlink spatial multiplexing) TBs and the associated HARQ information are received from the HARQ entity.

For each received TB and associated HARQ information, the HARQ process shall:

- if the NDI, when provided, has been toggled compared to the value of the previous received transmission corresponding to this TB; or
- if the HARQ process is equal to the broadcast process and if this is the first received transmission for the TB according to the system information schedule indicated by RRC; or
- if this is the very first received transmission for this TB (i.e. there is no previous NDI for this TB):

- consider this transmission to be a new transmission.
- else:
  - consider this transmission to be a retransmission.

#### The UE then shall:

- if this is a new transmission:
  - attempt to decode the received data.
- else if this is a retransmission:
  - if the data for this TB has not yet been successfully decoded:
    - combine the received data with the data currently in the soft buffer for this TB and attempt to decode the combined data.
- if the data which the UE attempted to decode was successfully decoded for this TB; or
- if the data for this TB was successfully decoded before:
  - if the HARQ process is equal to the broadcast process:
    - deliver the decoded MAC PDU to upper layers.
  - else if this is the first successful decoding of the data for this TB:
    - deliver the decoded MAC PDU to the disassembly and demultiplexing entity.
  - generate a positive acknowledgement (ACK) of the data in this TB.
- else:
  - replace the data in the soft buffer for this TB with the data which the UE attempted to decode.
  - generate a negative acknowledgement (NACK) of the data in this TB.
- if the HARQ process is associated with a transmission indicated with a Temporary C-RNTI and the Contention Resolution is not yet successful (see subclause 5.1.5); or
- if the HARQ process is equal to the broadcast process; or
- if the *timeAlignmentTimer* associated with the pTAG is stopped or expired:
  - do not indicate the generated positive or negative acknowledgement to the physical layer.
- else:
  - indicate the generated positive or negative acknowledgement for this TB to the physical layer.

The UE shall ignore NDI received in all downlink assignments on PDCCH for its Temporary C-RNTI when determining if NDI on PDCCH for its C-RNTI has been toggled compared to the value in the previous transmission.

NOTE: When the UE is configured with more than one serving cell, UE behaviors for storing data to the soft buffer is specified in [2].

NOTE: If the UE receives a retransmission with a TB size different from the last valid TB size signalled for this TB, the UE behavior is left up to UE implementation.

# 5.3.3 Disassembly and demultiplexing

The UE shall disassemble and demultiplex a MAC PDU as defined in subclause 6.1.2.

# 5.4 UL-SCH data transfer

## 5.4.1 UL Grant reception

In order to transmit on the UL-SCH the UE must have a valid uplink grant (except for non-adaptive HARQ retransmissions) which it may receive dynamically on the PDCCH or in a Random Access Response or which may be configured semi-persistently. To perform requested transmissions, the MAC layer receives HARQ information from lower layers. When the physical layer is configured for uplink spatial multiplexing, the MAC layer can receive up to two grants (one per HARQ process) for the same TTI from lower layers.

If the UE has a C-RNTI, a Semi-Persistent Scheduling C-RNTI, or a Temporary C-RNTI, the UE shall for each TTI and for each Serving Cell belonging to a TAG that has a running *timeAlignmentTimer* and for each grant received for this TTI-

- if an uplink grant for this TTI and this Serving Cell has been received on the PDCCH for the UE's C-RNTI or Temporary C-RNTI; or
- if an uplink grant for this TTI has been received in a Random Access Response:
  - if the uplink grant is for UE's C-RNTI and if the previous uplink grant delivered to the HARQ entity for the same HARQ process was either an uplink grant received for the UE's Semi-Persistent Scheduling C-RNTI or a configured uplink grant:
    - consider the NDI to have been toggled for the corresponding HARQ process regardless of the value of the NDI
  - deliver the uplink grant and the associated HARQ information to the HARQ entity for this TTI.
- else, if this Serving Cell is the PCell and if an uplink grant for this TTI has been received for the PCell on the PDCCH of the PCell for the UE's Semi-Persistent Scheduling C-RNTI:
  - if the NDI in the received HARQ information is 1:
    - consider the NDI for the corresponding HARQ process not to have been toggled;
    - deliver the uplink grant and the associated HARQ information to the HARQ entity for this TTI.
  - else if the NDI in the received HARQ information is 0:
    - if PDCCH contents indicate SPS release:
      - clear the configured uplink grant (if any).
    - else:
      - store the uplink grant and the associated HARQ information as configured uplink grant;
      - initialise (if not active) or re-initialise (if already active) the configured uplink grant to start in this TTI and to recur according to rules in subclause 5.10.2;
      - consider the NDI bit for the corresponding HARQ process to have been toggled;
      - deliver the configured uplink grant and the associated HARQ information to the HARQ entity for this TTI.
- else, if this Serving Cell is the PCell and an uplink grant for this TTI has been configured for the PCell:
  - consider the NDI bit for the corresponding HARQ process to have been toggled;
  - deliver the configured uplink grant, and the associated HARQ information to the HARQ entity for this TTI.

NOTE: The period of configured uplink grants is expressed in TTIs.

NOTE: If the UE receives both a grant in a Random Access Response and a grant for its C-RNTI or Semi persistent scheduling C-RNTI requiring transmissions on the PCell in the same UL subframe, the UE may choose to continue with either the grant for its RA-RNTI or the grant for its C-RNTI or Semi persistent scheduling C-RNTI.

NOTE: When a configured uplink grant is indicated during a measurement gap and indicates an UL-SCH transmission during a measurement gap, the UE processes the grant but does not transmit on UL-SCH.

#### 5.4.2 HARQ operation

# 5.4.2.1 HARQ entity

There is one HARQ entity at the UE for each Serving Cell with configured uplink, which maintains a number of parallel HARQ processes allowing transmissions to take place continuously while waiting for the HARQ feedback on the successful or unsuccessful reception of previous transmissions.

The number of parallel HARQ processes per HARQ entity is specified in [2], clause 8.

When the physical layer is configured for uplink spatial multiplexing [2], there are two HARQ processes associated with a given TTI. Otherwise there is one HARQ process associated with a given TTI.

At a given TTI, if an uplink grant is indicated for the TTI, the HARQ entity identifies the HARQ process(es) for which a transmission should take place. It also routes the received HARQ feedback (ACK/NACK information), MCS and resource, relayed by the physical layer, to the appropriate HARQ process(es).

When TTI bundling is configured, the parameter TTI\_BUNDLE\_SIZE provides the number of TTIs of a TTI bundle. TTI bundling operation relies on the HARQ entity for invoking the same HARQ process for each transmission that is part of the same bundle. Within a bundle HARQ retransmissions are non-adaptive and triggered without waiting for feedback from previous transmissions according to TTI\_BUNDLE\_SIZE. The HARQ feedback of a bundle is only received for the last TTI of the bundle (i.e the TTI corresponding to TTI\_BUNDLE\_SIZE), regardless of whether a transmission in that TTI takes place or not (e.g. when a measurement gap occurs). A retransmission of a TTI bundle is also a TTI bundle. TTI bundling is not supported when the UE is configured with one or more SCells with configured uplink.

TTI bundling is not supported for RN communication with the E-UTRAN in combination with an RN subframe configuration.

For transmission of Msg3 during Random Access (see section 5.1.5) TTI bundling does not apply.

For each TTI, the HARQ entity shall:

- identify the HARQ process(es) associated with this TTI, and for each identified HARQ process:
  - if an uplink grant has been indicated for this process and this TTI:
    - if the received grant was not addressed to a Temporary C-RNTI on PDCCH and if the NDI provided in the associated HARQ information has been toggled compared to the value in the previous transmission of this HARQ process; or
    - if the uplink grant was received on PDCCH for the C-RNTI and the HARQ buffer of the identified process is empty; or
    - if the uplink grant was received in a Random Access Response:
      - if there is a MAC PDU in the Msg3 buffer and the uplink grant was received in a Random Access Response:
        - obtain the MAC PDU to transmit from the Msg3 buffer.
      - else:
        - obtain the MAC PDU to transmit from the "Multiplexing and assembly" entity;
      - deliver the MAC PDU and the uplink grant and the HARQ information to the identified HARQ process;

- instruct the identified HARQ process to trigger a new transmission.
- else:
  - deliver the uplink grant and the HARQ information (redundancy version) to the identified HARQ process;
  - instruct the identified HARQ process to generate an adaptive retransmission.
- else, if the HARQ buffer of this HARQ process is not empty:
  - instruct the identified HARQ process to generate a non-adaptive retransmission.

When determining if NDI has been toggled compared to the value in the previous transmission UE shall ignore NDI received in all uplink grants on PDCCH for its Temporary C-RNTI.

#### 5.4.2.2 HARQ process

Each HARQ process is associated with a HARQ buffer.

Each HARQ process shall maintain a state variable CURRENT\_TX\_NB, which indicates the number of transmissions that have taken place for the MAC PDU currently in the buffer, and a state variable HARQ\_FEEDBACK, which indicates the HARQ feedback for the MAC PDU currently in the buffer. When the HARQ process is established, CURRENT\_TX\_NB shall be initialized to 0.

The sequence of redundancy versions is 0, 2, 3, 1. The variable CURRENT\_IRV is an index into the sequence of redundancy versions. This variable is up-dated modulo 4.

New transmissions are performed on the resource and with the MCS indicated on PDCCH or Random Access Response. Adaptive retransmissions are performed on the resource and, if provided, with the MCS indicated on PDCCH. Non-adaptive retransmission is performed on the same resource and with the same MCS as was used for the last made transmission attempt.

The UE is configured with a Maximum number of HARQ transmissions and a Maximum number of Msg3 HARQ transmissions by RRC: maxHARQ-Tx and maxHARQ-Msg3Tx respectively. For transmissions on all HARQ processes and all logical channels except for transmission of a MAC PDU stored in the Msg3 buffer, the maximum number of transmissions shall be set to maxHARQ-Tx. For transmission of a MAC PDU stored in the Msg3 buffer, the maximum number of transmissions shall be set to maxHARQ-Msg3Tx.

When the HARQ feedback is received for this TB, the HARQ process shall:

- set HARQ\_FEEDBACK to the received value.

If the HARQ entity requests a new transmission, the HARQ process shall:

- set CURRENT\_TX\_NB to 0;
- set CURRENT\_IRV to 0;
- store the MAC PDU in the associated HARQ buffer;
- store the uplink grant received from the HARQ entity;
- set HARQ\_FEEDBACK to NACK;
- generate a transmission as described below.

If the HARQ entity requests a retransmission, the HARQ process shall:

- increment CURRENT\_TX\_NB by 1;

- if the HARQ entity requests an adaptive retransmission:
  - store the uplink grant received from the HARQ entity;
  - set CURRENT\_IRV to the index corresponding to the redundancy version value provided in the HARQ information;
  - set HARQ FEEDBACK to NACK;
  - generate a transmission as described below.
- else if the HARQ entity requests a non-adaptive retransmission:
  - if HARQ\_FEEDBACK = NACK:
    - generate a transmission as described below.

NOTE: When receiving a HARQ ACK alone, the UE keeps the data in the HARQ buffer.

NOTE: When no UL-SCH transmission can be made due to the occurrence of a measurement gap, no HARQ feedback can be received and a non-adaptive retransmission follows.

To generate a transmission, the HARQ process shall:

- if the MAC PDU was obtained from the Msg3 buffer; or
- if there is no measurement gap at the time of the transmission and, in case of retransmission, the retransmission does not collide with a transmission for a MAC PDU obtained from the Msg3 buffer in this TTI:
  - instruct the physical layer to generate a transmission according to the stored uplink grant with the redundancy version corresponding to the CURRENT\_IRV value;
  - increment CURRENT\_IRV by 1;
  - if there is a measurement gap at the time of the HARQ feedback reception for this transmission and if the MAC PDU was not obtained from the Msg3 buffer:
    - set HARQ\_FEEDBACK to ACK at the time of the HARQ feedback reception for this transmission.

After performing above actions, the HARQ process then shall:

- if CURRENT TX NB = maximum number of transmissions 1:
  - flush the HARQ buffer;

# 5.4.3 Multiplexing and assembly

#### 5.4.3.1 Logical channel prioritization

The Logical Channel Prioritization procedure is applied when a new transmission is performed.

RRC controls the scheduling of uplink data by signalling for each logical channel: *priority* where an increasing *priority* value indicates a lower priority level, *prioritisedBitRate* which sets the Prioritized Bit Rate (PBR), *bucketSizeDuration* which sets the Bucket Size Duration (BSD).

The UE shall maintain a variable Bj for each logical channel j. Bj shall be initialized to zero when the related logical channel is established, and incremented by the product  $PBR \times TTI$  duration for each TTI, where PBR is Prioritized Bit Rate of logical channel j. However, the value of Bj can never exceed the bucket size and if the value of Bj is larger than the bucket size of logical channel j, it shall be set to the bucket size. The bucket size of a logical channel is equal to  $PBR \times BSD$ , where PBR and BSD are configured by upper layers.

The UE shall perform the following Logical Channel Prioritization procedure when a new transmission is performed:

- The UE shall allocate resources to the logical channels in the following steps:
  - Step 1: All the logical channels with Bj > 0 are allocated resources in a decreasing priority order. If the PBR of a radio bearer is set to "infinity", the UE shall allocate resources for all the data that is available for transmission on the radio bearer before meeting the PBR of the lower priority radio bearer(s);
  - Step 2: the UE shall decrement Bj by the total size of MAC SDUs served to logical channel j in Step 1

NOTE: The value of Bj can be negative.

- Step 3: if any resources remain, all the logical channels are served in a strict decreasing priority order (regardless of the value of Bj) until either the data for that logical channel or the UL grant is exhausted, whichever comes first. Logical channels configured with equal priority should be served equally.
- The UE shall also follow the rules below during the scheduling procedures above:
  - the UE should not segment an RLC SDU (or partially transmitted SDU or retransmitted RLC PDU) if the whole SDU (or partially transmitted SDU or retransmitted RLC PDU) fits into the remaining resources;
  - if the UE segments an RLC SDU from the logical channel, it shall maximize the size of the segment to fill the grant as much as possible;
  - the UE should maximise the transmission of data.
  - if the UE is given an UL grant size that is equal to or larger than 4 bytes while having data available for transmission, the UE shall not transmit only padding BSR and/or padding (unless the UL grant size is less than 7 bytes and an AMD PDU segment needs to be transmitted).

The UE shall not transmit data for a logical channel corresponding to a radio bearer that is suspended (the conditions for when a radio bearer is considered suspended are defined in [8]).

For the Logical Channel Prioritization procedure, the UE shall take into account the following relative priority in decreasing order:

- MAC control element for C-RNTI or data from UL-CCCH;
- MAC control element for BSR, with exception of BSR included for padding;
- MAC control element for PHR or Extended PHR:
- data from any Logical Channel, except data from UL-CCCH;
- MAC control element for BSR included for padding.

NOTE: When the UE is requested to transmit multiple MAC PDUs in one TTI, steps 1 to 3 and the associated rules may be applied either to each grant independently or to the sum of the capacities of the grants. Also the order in which the grants are processed is left up to UE implementation. It is up to the UE implementation to decide in which MAC PDU a MAC control element is included when UE is requested to transmit multiple MAC PDUs in one TTI.

#### 5.4.3.2 Multiplexing of MAC Control Elements and MAC SDUs

The UE shall multiplex MAC control elements and MAC SDUs in a MAC PDU according to subclauses 5.4.3.1 and 6.1.2.

# 5.4.4 Scheduling Request

The Scheduling Request (SR) is used for requesting UL-SCH resources for new transmission.

When an SR is triggered, it shall be considered as pending until it is cancelled. All pending SR(s) shall be cancelled and *sr-ProhibitTimer* shall be stopped when a MAC PDU is assembled and this PDU includes a BSR which contains buffer status up to (and including) the last event that triggered a BSR (see subclause 5.4.5), or when the UL grant(s) can accommodate all pending data available for transmission.

If an SR is triggered and there is no other SR pending, the UE shall set the SR\_COUNTER to 0.

As long as one SR is pending, the UE shall for each TTI:

- if no UL-SCH resources are available for a transmission in this TTI:
  - if the UE has no valid PUCCH resource for SR configured in any TTI: initiate a Random Access procedure (see subclause 5.1) on the PCell and cancel all pending SRs;
  - else if the UE has a valid PUCCH resource for SR configured for this TTI and if this TTI is not part of a measurement gap and if *sr-ProhibitTimer* is not running:
    - if SR\_COUNTER < *dsr-TransMax*:
      - increment SR\_COUNTER by 1;
      - instruct the physical layer to signal the SR on PUCCH;
      - start the *sr-ProhibitTimer*.
    - else:
      - notify RRC to release PUCCH/SRS for all serving cells;
      - clear any configured downlink assignments and uplink grants;
      - initiate a Random Access procedure (see subclause 5.1) on the PCell and cancel all pending SRs.

# 5.4.5 Buffer Status Reporting

The Buffer Status reporting procedure is used to provide the serving eNB with information about the amount of data available for transmission in the UL buffers of the UE. RRC controls BSR reporting by configuring the two timers *periodicBSR-Timer* and *retxBSR-Timer* and by, for each logical channel, optionally signalling *logicalChannelGroup* which allocates the logical channel to an LCG [8].

For the Buffer Status reporting procedure, the UE shall consider all radio bearers which are not suspended and may consider radio bearers which are suspended.

A Buffer Status Report (BSR) shall be triggered if any of the following events occur:

- UL data, for a logical channel which belongs to a LCG, becomes available for transmission in the RLC entity or in the PDCP entity (the definition of what data shall be considered as available for transmission is specified in [3] and [4] respectively) and either the data belongs to a logical channel with higher priority than the priorities of the logical channels which belong to any LCG and for which data is already available for transmission, or there is no data available for transmission for any of the logical channels which belong to a LCG, in which case the BSR is referred below to as "Regular BSR";
- UL resources are allocated and number of padding bits is equal to or larger than the size of the Buffer Status Report MAC control element plus its subheader, in which case the BSR is referred below to as "Padding BSR";
- retxBSR-Timer expires and the UE has data available for transmission for any of the logical channels which belong to a LCG, in which case the BSR is referred below to as "Regular BSR";
- periodicBSR-Timer expires, in which case the BSR is referred below to as "Periodic BSR".

For Regular and Periodic BSR:

- if more than one LCG has data available for transmission in the TTI where the BSR is transmitted: report Long BSR:
- else report Short BSR.

#### For Padding BSR:

- if the number of padding bits is equal to or larger than the size of the Short BSR plus its subheader but smaller than the size of the Long BSR plus its subheader:

- if more than one LCG has data available for transmission in the TTI where the BSR is transmitted: report Truncated BSR of the LCG with the highest priority logical channel with data available for transmission;
- else report Short BSR.
- else if the number of padding bits is equal to or larger than the size of the Long BSR plus its subheader, report Long BSR.

If the Buffer Status reporting procedure determines that at least one BSR has been triggered and not cancelled:

- if the UE has UL resources allocated for new transmission for this TTI:
  - instruct the Multiplexing and Assembly procedure to generate the BSR MAC control element(s);
  - start or restart periodicBSR-Timer except when all the generated BSRs are Truncated BSRs;
  - start or restart retxBSR-Timer.
- else if a Regular BSR has been triggered:
  - if an uplink grant is not configured or the Regular BSR was not triggered due to data becoming available for transmission for a logical channel for which logical channel SR masking (*logicalChannelSR-Mask*) is setup by upper layers:
    - a Scheduling Request shall be triggered.

A MAC PDU shall contain at most one MAC BSR control element, even when multiple events trigger a BSR by the time a BSR can be transmitted in which case the Regular BSR and the Periodic BSR shall have precedence over the padding BSR.

The UE shall restart retxBSR-Timer upon indication of a grant for transmission of new data on any UL-SCH.

All triggered BSRs shall be cancelled in case the UL grant(s) in this subframe can accommodate all pending data available for transmission but is not sufficient to additionally accommodate the BSR MAC control element plus its subheader. All triggered BSRs shall be cancelled when a BSR is included in a MAC PDU for transmission.

The UE shall transmit at most one Regular/Periodic BSR in a TTI. If the UE is requested to transmit multiple MAC PDUs in a TTI, it may include a padding BSR in any of the MAC PDUs which do not contain a Regular/Periodic BSR.

All BSRs transmitted in a TTI always reflect the buffer status after all MAC PDUs have been built for this TTI. Each LCG shall report at the most one buffer status value per TTI and this value shall be reported in all BSRs reporting buffer status for this LCG.

NOTE: A Padding BSR is not allowed to cancel a triggered Regular/Periodic BSR. A Padding BSR is triggered for a specific MAC PDU only and the trigger is cancelled when this MAC PDU has been built.

# 5.4.6 Power Headroom Reporting

The Power Headroom reporting procedure is used to provide the serving eNB with information about the difference between the nominal UE maximum transmit power and the estimated power for UL-SCH transmission per activated Serving Cell and also with information about the difference between the nominal UE maximum power and the estimated power for UL-SCH and PUCCH transmission on PCell.

The reporting period, delay and mapping of Power Headroom are defined in subclause 9.1.8 of [9]. RRC controls Power Headroom reporting by configuring the two timers *periodicPHR-Timer* and *prohibitPHR-Timer*, and by signalling *dl-PathlossChange* which sets the change in measured downlink pathloss and the required power backoff due to power management (as allowed by P-MPR<sub>c</sub> [10]) to trigger a PHR [8].

A Power Headroom Report (PHR) shall be triggered if any of the following events occur:

- *prohibitPHR-Timer* expires or has expired and the path loss has changed more than *dl-PathlossChange* dB for at least one activated Serving Cell which is used as a pathloss reference since the last transmission of a PHR when the UE has UL resources for new transmission;
- periodicPHR-Timer expires;

- upon configuration or reconfiguration of the power headroom reporting functionality by upper layers [8], which is not used to disable the function;
- activation of an SCell with configured uplink.
- *prohibitPHR-Timer* expires or has expired, when the UE has UL resources for new transmission, and the following is true in this TTI for any of the actived Serving Cells with configured uplink:
  - there are UL resources allocated for transmission or there is a PUCCH transmission on this cell, and the required power backoff due to power management (as allowed by P-MPR<sub>c</sub> [10]) for this cell has changed more than *dl-PathlossChange* dB since the last transmission of a PHR when the UE had UL resources allocated for transmission or PUCCH transmission on this cell.

NOTE: The UE should avoid triggering a PHR when the required power backoff due to power management decreases only temporarily (e.g. for up to a few tens of milliseconds) and it should avoid reflecting such temporary decrease in the values of P<sub>CMAX,c</sub>/PH when a PHR is triggered by other triggering conditions.

If the UE has UL resources allocated for new transmission for this TTI:

- if it is the first UL resource allocated for a new transmission since the last MAC reset, start *periodicPHR-Timer*;
- if the Power Headroom reporting procedure determines that at least one PHR has been triggered and not cancelled, and;
- if the allocated UL resources can accommodate a PHR MAC control element plus its subheader if *extendedPHR* is not configured, or the Extended PHR MAC control element plus its subheader if *extendedPHR* is configured, as a result of logical channel prioritization:
  - if extendedPHR is configured:
    - for each activated Serving Cell with configured uplink:
      - obtain the value of the Type 1 power headroom;
      - if the UE has UL resources allocated for transmission on this Serving Cell for this TTI:
        - obtain the value for the corresponding P<sub>CMAX,c</sub> field from the physical layer;
    - if *simultaneousPUCCH-PUSCH* is configured:
      - obtain the value of the Type 2 power headroom for the PCell;
      - if the UE has a PUCCH transmission in this TTI:
        - obtain the value for the corresponding  $P_{CMAX,c}$  field from the physical layer;
    - instruct the Multiplexing and Assembly procedure to generate and transmit an Extended PHR MAC control element as defined in subclause 6.1.3.6a based on the values reported by the physical layer;
  - else:
    - obtain the value of the Type 1 power headroom from the physical layer;
    - instruct the Multiplexing and Assembly procedure to generate and transmit a PHR MAC control element as defined in subclause 6.1.3.6 based on the value reported by the physical layer;
  - start or restart *periodicPHR-Timer*;
  - start or restart prohibitPHR-Timer;
  - cancel all triggered PHR(s).

# 5.5 PCH reception

When the UE needs to receive PCH, the UE shall:

- if a PCH assignment has been received on the PDCCH for the P-RNTI:
  - attempt to decode the TB on the PCH as indicated by the PDCCH information.
- if a TB on the PCH has been successfully decoded:
  - deliver the decoded MAC PDU to upper layers.

# 5.6 BCH reception

When the UE needs to receive BCH, the UE shall:

- receive and attempt to decode the BCH;
- if a TB on the BCH has been successfully decoded:
  - deliver the decoded MAC PDU to upper layers.

# 5.7 Discontinuous Reception (DRX)

The UE may be configured by RRC with a DRX functionality that controls the UE's PDCCH monitoring activity for the UE's C-RNTI, TPC-PUCCH-RNTI, TPC-PUSCH-RNTI and Semi-Persistent Scheduling C-RNTI (if configured). When in RRC\_CONNECTED, if DRX is configured, the UE is allowed to monitor the PDCCH discontinuously using the DRX operation specified in this subclause; otherwise the UE monitors the PDCCH continuously. When using DRX operation, the UE shall also monitor PDCCH according to requirements found in other subclauses of this specification. RRC controls DRX operation by configuring the timers *onDurationTimer*, *drx-InactivityTimer*, *drx-RetransmissionTimer* (one per DL HARQ process except for the broadcast process), the *longDRX-Cycle*, the value of the *drxStartOffset* and optionally the *drxShortCycleTimer* and *shortDRX-Cycle*. A HARQ RTT timer per DL HARQ process (except for the broadcast process) is also defined (see subclause 7.7).

When a DRX cycle is configured, the Active Time includes the time while:

- on Duration Timer or drx-Inactivity Timer or drx-Retransmission Timer or mac-Contention Resolution Timer (as described in subclause 5.1.5) is running; or
- a Scheduling Request is sent on PUCCH and is pending (as described in subclause 5.4.4); or
- an uplink grant for a pending HARQ retransmission can occur and there is data in the corresponding HARQ buffer; or
- a PDCCH indicating a new transmission addressed to the C-RNTI of the UE has not been received after successful reception of a Random Access Response for the preamble not selected by the UE (as described in subclause 5.1.4).

When DRX is configured, the UE shall for each subframe:

- if a HARQ RTT Timer expires in this subframe and the data of the corresponding HARQ process was not successfully decoded:
  - start the *drx-RetransmissionTimer* for the corresponding HARQ process.
- if a DRX Command MAC control element is received:
  - stop onDurationTimer;
  - stop drx-InactivityTimer.
- if *drx-InactivityTimer* expires or a DRX Command MAC control element is received in this subframe:
  - if the Short DRX cycle is configured:
    - start or restart drxShortCycleTimer;
    - use the Short DRX Cycle.

- else:
  - use the Long DRX cycle.
- if *drxShortCycleTimer* expires in this subframe:
  - use the Long DRX cycle.
- If the Short DRX Cycle is used and [(SFN \* 10) + subframe number] modulo (*shortDRX-Cycle*) = (*drxStartOffset*) modulo (*shortDRX-Cycle*); or
- if the Long DRX Cycle is used and [(SFN \* 10) + subframe number] modulo (longDRX-Cycle) = drxStartOffset:
  - start onDurationTimer.
- during the Active Time, for a PDCCH-subframe, if the subframe is not required for uplink transmission for halfduplex FDD UE operation and if the subframe is not part of a configured measurement gap:
  - monitor the PDCCH;
  - if the PDCCH indicates a DL transmission or if a DL assignment has been configured for this subframe:
    - start the HARQ RTT Timer for the corresponding HARQ process;
    - stop the drx-RetransmissionTimer for the corresponding HARQ process.
  - if the PDCCH indicates a new transmission (DL or UL):
    - start or restart drx-InactivityTimer.
- in current subframe n, if the UE would not be in Active Time considering grants/assignments/DRX Command MAC control elements received and Scheduling Request sent until and including subframe n-5 when evaluating all DRX Active Time conditions as specified in this subclause, type-0-triggered SRS [2] shall not be reported.
- if CQI masking (*cqi-Mask*) is setup by upper layers:
  - in current subframe n, if *onDurationTimer* would not be running considering grants/assignments/DRX Command MAC control elements received until and including subframe n-5 when evaluating all DRX Active Time conditions as specified in this subclause, CQI/PMI/RI/PTI on PUCCH shall not be reported.
- else:
  - in current subframe n, if the UE would not be in Active Time considering grants/assignments/DRX Command MAC control elements received and Scheduling Request sent until and including subframe n-5 when evaluating all DRX Active Time conditions as specified in this subclause, CQI/PMI/RI/PTI on PUCCH shall not be reported.

Regardless of whether the UE is monitoring PDCCH or not, the UE receives and transmits HARQ feedback and transmits type-1-triggered SRS [2] when such is expected.

NOTE: The same active time applies to all activated serving cell(s).

NOTE: In case of downlink spatial multiplexing, if a TB is received while the HARQ RTT Timer is running and the previous transmission of the same TB was received at least N subframes before the current subframe (where N corresponds to the HARQ RTT Timer), the UE should process it and restart the HARQ RTT Timer.

# 5.8 MAC reconfiguration

When a reconfiguration of the MAC entity is requested by upper layers, the UE shall:

- upon addition of an SCell, initialize the corresponding HARQ entity;
- upon removal of an SCell, remove the corresponding HARQ entity;
- for timers apply the new value when the timer is (re)started;

- when counters are initialized apply the new maximum parameter value;
- for other parameters, apply immediately the configurations received from upper layers.

## 5.9 MAC Reset

If a reset of the MAC entity is requested by upper layers, the UE shall:

- initialize Bj for each logical channel to zero;
- stop (if running) all timers;
- consider all *timeAlignmentTimers* as expired and perform the corresponding actions in subclause 5.2;
- set the NDIs for all uplink HARQ processes to the value 0;
- stop, if any, ongoing RACH procedure;
- discard explicitly signalled ra-PreambleIndex and ra-PRACH-MaskIndex, if any;
- flush Msg3 buffer;
- cancel, if any, triggered Scheduling Request procedure;
- cancel, if any, triggered Buffer Status Reporting procedure;
- cancel, if any, triggered Power Headroom Reporting procedure;
- flush the soft buffers for all DL HARQ processes;
- for each DL HARQ process, consider the next received transmission for a TB as the very first transmission;
- release, if any, Temporary C-RNTI.

# 5.10 Semi-Persistent Scheduling

When Semi-Persistent Scheduling is enabled by RRC, the following information is provided [8]:

- Semi-Persistent Scheduling C-RNTI;
- Uplink Semi-Persistent Scheduling interval *semiPersistSchedIntervalUL* and number of empty transmissions before implicit release *implicitReleaseAfter*, if Semi-Persistent Scheduling is enabled for the uplink;
- Whether twoIntervalsConfig is enabled or disabled for uplink, only for TDD;
- Downlink Semi-Persistent Scheduling interval *semiPersistSchedIntervalDL* and number of configured HARQ processes for Semi-Persistent Scheduling *numberOfConfSPS-Processes*, if Semi-Persistent Scheduling is enabled for the downlink;

When Semi-Persistent Scheduling for uplink or downlink is disabled by RRC, the corresponding configured grant or configured assignment shall be discarded.

Semi-Persistent Scheduling is supported on the PCell only.

Semi-Persistent Scheduling is not supported for RN communication with the E-UTRAN in combination with an RN subframe configuration.

#### 5.10.1 Downlink

After a Semi-Persistent downlink assignment is configured, the UE shall consider sequentially that the N<sup>th</sup> assignment occurs in the subframe for which:

-  $(10 * SFN + subframe) = [(10 * SFN_{start time} + subframe_{start time}) + N * semiPersistSchedIntervalDL]$  modulo 10240.

Where  $SFN_{start\ time}$  and subframe  $_{start\ time}$  are the SFN and subframe, respectively, at the time the configured downlink assignment were (re-)initialised.

# 5.10.2 Uplink

After a Semi-Persistent Scheduling uplink grant is configured, the UE shall:

- if twoIntervalsConfig is enabled by upper layer:
  - set the Subframe\_Offset according to Table 7.4-1.
- else:
  - set Subframe\_Offset to 0.
- consider sequentially that the N<sup>th</sup> grant occurs in the subframe for which:
  - (10 \* SFN + subframe) = [(10 \* SFN<sub>start time</sub> + subframe<sub>start time</sub>) + N \* semiPersistSchedIntervalUL + Subframe Offset \* (N modulo 2)] modulo 10240.

Where  $SFN_{start\ time}$  and subframe are the SFN and subframe, respectively, at the time the configured uplink grant were (re-)initialised.

The UE shall clear the configured uplink grant immediately after *implicitReleaseAfter* [8] number of consecutive new MAC PDUs each containing zero MAC SDUs have been provided by the Multiplexing and Assembly entity, on the Semi-Persistent Scheduling resource.

NOTE: Retransmissions for Semi-Persistent Scheduling can continue after clearing the configured uplink grant.

# 5.11 Handling of unknown, unforeseen and erroneous protocol data

When a MAC entity receives a MAC PDU for the UE's C-RNTI or Semi-Persistent Scheduling C-RNTI, or by the configured downlink assignment, containing reserved or invalid values, the MAC entity shall:

- discard the received PDU.

When a MAC entity receives a MAC PDU on MCH containing reserved values, the UE shall:

- ignore the fields in the PDU header and the control elements containing reserved values and the corresponding parts indicated by the fields in the received PDU.

# 5.12 MCH reception

MCH transmission may occur in subframes configured by upper layer for MCCH or MTCH transmission. For each such subframe, upper layer indicates if *signallingMCS* or *dataMCS* applies. The transmission of an MCH occurs in a set of subframes defined by *PMCH-Config*. An MCH Scheduling Information MAC control element is included in the first subframe allocated to the MCH within the MCH scheduling period to indicate the position of each MTCH and unused subframes on the MCH. The UE shall assume that the first scheduled MTCH starts immediately after the MCCH or the MCH Scheduling Information MAC control element if the MCCH is not present, and the other scheduled MTCH(s) start immediately after the previous MTCH, at the earliest in the subframe where the previous MTCH stops. When the UE needs to receive MCH, the UE shall:

- attempt to decode the TB on the MCH;
- if a TB on the MCH has been successfully decoded:
  - demultiplex the MAC PDU and deliver the MAC SDU(s) to upper layers.

## 5.13 Activation/Deactivation of SCells

If the UE is configured with one or more SCells, the network may activate and deactivate the configured SCells. The PCell is always activated. The network activates and deactivates the SCell(s) by sending the Activation/Deactivation MAC control element described in subclause 6.1.3.8. Furthermore, the UE maintains a *sCellDeactivationTimer* timer per configured SCell and deactivates the associated SCell upon its expiry. The same initial timer value applies to each instance of the *sCellDeactivationTimer* and it is configured by RRC. The configured SCells are initially deactivated upon addition and after a handover.

The UE shall for each TTI and for each configured SCell:

- if the UE receives an Activation/Deactivation MAC control element in this TTI activating the SCell, the UE shall in the TTI according to the timing defined in [2]:
  - activate the SCell; i.e. apply normal SCell operation including:
    - SRS transmissions on the SCell;
    - CQI/PMI/RI/PTI reporting for the SCell;
    - PDCCH monitoring on the SCell;
    - PDCCH monitoring for the SCell.
  - start or restart the *sCellDeactivationTimer* associated with the SCell;
  - trigger PHR according to subclause 5.4.6.
- else, if the UE receives an Activation/Deactivation MAC control element in this TTI deactivating the SCell; or
- if the sCellDeactivationTimer associated with the activated SCell expires in this TTI:
  - in the TTI according to the timing defined in [2]:
    - deactivate the SCell;
    - stop the *sCellDeactivationTimer* associated with the SCell;
    - flush all HARQ buffers associated with the SCell.
- if PDCCH on the activated SCell indicates an uplink grant or downlink assignment; or
- if PDCCH on the Serving Cell scheduling the activated SCell indicates an uplink grant or a downlink assignment for the activated SCell:
  - restart the *sCellDeactivationTimer* associated with the SCell;
- if the SCell is deactivated:
  - not transmit SRS on the SCell;
  - not report CQI/PMI/RI/PTI for the SCell;
  - not transmit on UL-SCH on the SCell;
  - not transmit on RACH on the SCell;
  - not monitor the PDCCH on the SCell;
  - not monitor the PDCCH for the SCell.

HARQ feedback for the MAC PDU containing Activation/Deactivation MAC control element shall not be impacted by PCell interruption due to SCell activation/deactivation [9].

NOTE: When SCell is deactivated, the ongoing Random Access procedure on the SCell, if any, is aborted.

# 6 Protocol Data Units, formats and parameters

#### 6.1 Protocol Data Units

#### 6.1.1 General

A MAC PDU is a bit string that is byte aligned (i.e. multiple of 8 bits) in length. In the figures in subclause 6.1, bit strings are represented by tables in which the most significant bit is the leftmost bit of the first line of the table, the least significant bit is the rightmost bit on the last line of the table, and more generally the bit string is to be read from left to right and then in the reading order of the lines. The bit order of each parameter field within a MAC PDU is represented with the first and most significant bit in the leftmost bit and the last and least significant bit in the rightmost bit.

MAC SDUs are bit strings that are byte aligned (i.e. multiple of 8 bits) in length. An SDU is included into a MAC PDU from the first bit onward.

The UE shall ignore the value of Reserved bits in downlink MAC PDUs.


# 6.1.2 MAC PDU (DL-SCH and UL-SCH except transparent MAC and Random Access Response, MCH)

A MAC PDU consists of a MAC header, zero or more MAC Service Data Units (MAC SDU), zero, or more MAC control elements, and optionally padding; as described in Figure 6.1.2-3.

Both the MAC header and the MAC SDUs are of variable sizes.

A MAC PDU header consists of one or more MAC PDU subheaders; each subheader corresponds to either a MAC SDU, a MAC control element or padding.


A MAC PDU subheader consists of the six header fields R/R/E/LCID/F/L but for the last subheader in the MAC PDU and for fixed sized MAC control elements. The last subheader in the MAC PDU and subheaders for fixed sized MAC control elements consist solely of the four header fields R/R/E/LCID. A MAC PDU subheader corresponding to padding consists of the four header fields R/R/E/LCID.



R/R/E/LCID/F/L sub-header with 7-bits L field

R/R/E/LCID/F/L sub-header with 15-bits L field

Figure 6.1.2-1: R/R/E/LCID/F/L MAC subheader



R/R/E/LCID sub-header

Figure 6.1.2-2: R/R/E/LCID MAC subheader

MAC PDU subheaders have the same order as the corresponding MAC SDUs, MAC control elements and padding.

MAC control elements are always placed before any MAC SDU.

Padding occurs at the end of the MAC PDU, except when single-byte or two-byte padding is required. Padding may have any value and the UE shall ignore it. When padding is performed at the end of the MAC PDU, zero or more padding bytes are allowed.

When single-byte or two-byte padding is required, one or two MAC PDU subheaders corresponding to padding are placed at the beginning of the MAC PDU before any other MAC PDU subheader.

A maximum of one MAC PDU can be transmitted per TB per UE. A maximum of one MCH MAC PDU can be transmitted per TTI.

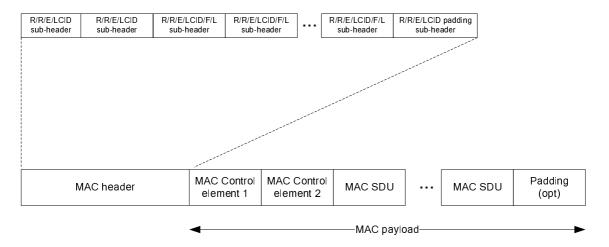


Figure 6.1.2-3: Example of MAC PDU consisting of MAC header, MAC control elements, MAC SDUs and padding

#### 6.1.3 MAC Control Elements

#### 6.1.3.1 Buffer Status Report MAC Control Elements

Buffer Status Report (BSR) MAC control elements consist of either:

- Short BSR and Truncated BSR format: one LCG ID field and one corresponding Buffer Size field (figure 6.1.3.1-1); or
- Long BSR format: four Buffer Size fields, corresponding to LCG IDs #0 through #3 (figure 6.1.3.1-2).

The BSR formats are identified by MAC PDU subheaders with LCIDs as specified in table 6.2.1-2.

The fields LCG ID and Buffer Size are defined as follow:

- LCG ID: The Logical Channel Group ID field identifies the group of logical channel(s) which buffer status is being reported. The length of the field is 2 bits;
- Buffer Size: The Buffer Size field identifies the total amount of data available across all logical channels of a logical channel group after all MAC PDUs for the TTI have been built. The amount of data is indicated in number of bytes. It shall include all data that is available for transmission in the RLC layer and in the PDCP layer; the definition of what data shall be considered as available for transmission is specified in [3] and [4] respectively. The size of the RLC and MAC headers are not considered in the buffer size computation. The length of this field is 6 bits. If *extendedBSR-Sizes* is not configured, the values taken by the Buffer Size field are shown in Table 6.1.3.1-1. If *extendedBSR-Sizes* is configured, the values taken by the Buffer Size field are shown in Table 6.1.3.1-2.




Figure 6.1.3.1-1: Short BSR and Truncated BSR MAC control element




Figure 6.1.3.1-2: Long BSR MAC control element

Table 6.1.3.1-1: Buffer size levels for BSR

Index	Buffer Size (BS) value [bytes]	Index	Buffer Size (BS) value [bytes]	
0	BS = 0	32	1132 < BS <= 1326	
1	0 < BS <= 10	33	1326 < BS <= 1552	
2	10 < BS <= 12	34	34 1552 < BS <= 1817	
3	12 < BS <= 14	35	1817 < BS <= 2127	
4	14 < BS <= 17	36	2127 < BS <= 2490	
5	17 < BS <= 19	37	2490 < BS <= 2915	
6	19 < BS <= 22	38	2915 < BS <= 3413	
7	22 < BS <= 26	39	3413 < BS <= 3995	
8	26 < BS <= 31	40	3995 < BS <= 4677	
9	31 < BS <= 36	41	4677 < BS <= 5476	
10	36 < BS <= 42	42	5476 < BS <= 6411	
11	42 < BS <= 49	43	6411 < BS <= 7505	
12	49 < BS <= 57	44	7505 < BS <= 8787	
13	57 < BS <= 67	45	8787 < BS <= 10287	
14	67 < BS <= 78	46	10287 < BS <= 12043	
15	78 < BS <= 91	47	12043 < BS <= 14099	
16	91 < BS <= 107	48	14099 < BS <= 16507	
17	107 < BS <= 125	49	16507 < BS <= 19325	
18	125 < BS <= 146	50	19325 < BS <= 22624	
19	146 < BS <= 171	51	22624 < BS <= 26487	
20	171 < BS <= 200	52	26487 < BS <= 31009	
21	200 < BS <= 234	53	31009 < BS <= 36304	
22	234 < BS <= 274	54	36304 < BS <= 42502	
23	274 < BS <= 321	55	42502 < BS <= 49759	
24	321 < BS <= 376	56	49759 < BS <= 58255	
25	376 < BS <= 440	57	58255 < BS <= 68201	
26	440 < BS <= 515	58	68201 < BS <= 79846	
27	515 < BS <= 603	59	79846 < BS <= 93479	
28	603 < BS <= 706	60	93479 < BS <= 109439	
29	706 < BS <= 826	61	109439 < BS <= 128125	
30	826 < BS <= 967	62	128125 < BS <= 150000	
31	967 < BS <=1132	63	BS > 150000	

Table 6.1.3.1-2: Extended Buffer size levels for BSR

Index	Buffer Size (BS) value [bytes]	Index	Buffer Size (BS) value [bytes]
0	BS = 0	32	4940 < BS <= 6074
1	0 < BS <= 10	33	6074 < BS <= 7469
2	10 < BS <= 13	34	7469 < BS <= 9185
3	13 < BS <= 16	35	9185 < BS <= 11294
4	16 < BS <= 19	36	11294 < BS <= 13888
5	19 < BS <= 23	37	13888 < BS <= 17077

6	23 < BS <= 29	38	17077 < BS <= 20999
7	29 < BS <= 35	39	20999 < BS <= 25822
8	35 < BS <= 43	40	25822 < BS <= 31752
9	43 < BS <= 53	41	31752 < BS <= 39045
10	53 < BS <= 65	42	39045 < BS <= 48012
11	65 < BS <= 80	43	48012 < BS <= 59039
12	80 < BS <= 98	44	59039 < BS <= 72598
13	98 < BS <= 120	45	72598 < BS <= 89272
14	120 < BS <= 147	46	89272 < BS <= 109774
15	147 < BS <= 181	47	109774 < BS <= 134986
16	181 < BS <= 223	48	134986 < BS <= 165989
17	223 < BS <= 274	49	165989 < BS <= 204111
18	274 < BS <= 337	50	204111 < BS <= 250990
19	337 < BS <= 414	51	250990 < BS <= 308634
20	414 < BS <= 509	52	308634 < BS <= 379519
21	509 < BS <= 625	53	379519 < BS <= 466683
22	625 < BS <= 769	54	466683 < BS <= 573866
23	769 < BS <= 945	55	573866 < BS <= 705666
24	945 < BS <= 1162	56	705666 < BS <= 867737
25	1162 < BS <= 1429	57	867737 < BS <= 1067031
26	1429 < BS <= 1757	58	1067031 < BS <= 1312097
27	1757 < BS <= 2161	59	1312097 < BS <= 1613447
28	2161 < BS <= 2657	60	1613447 < BS <= 1984009
29	2657 < BS <= 3267	61	1984009 < BS <= 2439678
30	3267 < BS <= 4017	62	2439678 < BS <= 3000000
31	4017 < BS <=4940	63	BS > 3000000

#### 6.1.3.2 C-RNTI MAC Control Element

The C-RNTI MAC control element is identified by MAC PDU subheader with LCID as specified in table 6.2.1-2.

It has a fixed size and consists of a single field defined as follows (figure 6.1.3.2-1):

- C-RNTI: This field contains the C-RNTI of the UE. The length of the field is 16 bits.




Figure 6.1.3.2-1: C-RNTI MAC control element

#### 6.1.3.3 DRX Command MAC Control Element

The DRX Command MAC control element is identified by a MAC PDU subheader with LCID as specified in table 6.2.1-1.

It has a fixed size of zero bits.

#### 6.1.3.4 UE Contention Resolution Identity MAC Control Element

The UE Contention Resolution Identity MAC control element is identified by MAC PDU subheader with LCID as specified in table 6.2.1-1. This control element has a fixed 48-bit size and consists of a single field defined as follows (figure 6.1.3.4-1)

- UE Contention Resolution Identity: This field contains the uplink CCCH SDU.

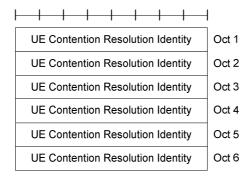


Figure 6.1.3.4-1: UE Contention Resolution Identity MAC control element

#### 6.1.3.5 Timing Advance Command MAC Control Element

The Timing Advance Command MAC control element is identified by MAC PDU subheader with LCID as specified in table 6.2.1-1.

It has a fixed size and consists of a single octet defined as follows (figure 6.1.3.5-1):

- TAG Identity (TAG Id): This field indicates the TAG Identity of the addressed TAG. The TAG containing the PCell has the TAG Identity 0. The length of the field is 2 bits;
- Timing Advance Command: This field indicates the index value  $T_A$  (0, 1, 2... 63) used to control the amount of timing adjustment that UE has to apply (see subclause 4.2.3 of [2]). The length of the field is 6 bits.




Figure 6.1.3.5-1: Timing Advance Command MAC control element

#### 6.1.3.6 Power Headroom MAC Control Element

The Power Headroom MAC control element is identified by a MAC PDU subheader with LCID as specified in table 6.2.1-2. It has a fixed size and consists of a single octet defined as follows (figure 6.1.3.6-1):

- R: reserved bit, set to "0";
- Power Headroom (PH): this field indicates the power headroom level. The length of the field is 6 bits. The reported PH and the corresponding power headroom levels are shown in Table 6.1.3.6-1 below (the corresponding measured values in dB can be found in subclause 9.1.8.4 of [9]).




Figure 6.1.3.6-1: Power Headroom MAC control element

Table 6.1.3.6-1: Power Headroom levels for PHR

PH	Power Headroom Level
0	POWER_HEADROOM_0
1	POWER_HEADROOM_1
2	POWER_HEADROOM_2
3	POWER_HEADROOM_3
60	POWER_HEADROOM_60
61	POWER_HEADROOM_61
62	POWER_HEADROOM_62
63	POWER_HEADROOM_63

#### 6.1.3.6a Extended Power Headroom MAC Control Element

The Extended Power Headroom MAC control element is identified by a MAC PDU subheader with LCID as specified in table 6.2.1-2. It has a variable size and is defined in Figure 6.1.3.6a-2. When Type 2 PH is reported, the octet containing the Type 2 PH field is included first after the octet indicating the presence of PH per SCell and followed by an octet containing the associated  $P_{\text{CMAX,c}}$  field (if reported). Then follows in ascending order based on the ServCellIndex [8] an octet with the Type 1 PH field and an octet with the associated  $P_{\text{CMAX,c}}$  field (if reported), for the PCell and for each SCell indicated in the bitmap.

The Extended Power Headroom MAC Control Element is defined as follows:

- C<sub>i</sub>: this field indicates the presence of a PH field for the SCell with *SCellIndex* i as specified in [8]. The C<sub>i</sub> field set to "1" indicates that a PH field for the SCell with *SCellIndex* i is reported. The C<sub>i</sub> field set to "0" indicates that a PH field for the SCell with *SCellIndex* i is not reported;
- R: reserved bit, set to "0";
- V: this field indicates if the PH value is based on a real transmission or a reference format. For Type 1 PH, V=0 indicates real transmission on PUSCH and V=1 indicates that a PUSCH reference format is used. For Type 2 PH, V=0 indicates real transmission on PUCCH and V=1 indicates that a PUCCH reference format is used. Furthermore, for both Type 1 and Type 2 PH, V=0 indicates the presence of the octet containing the associated P<sub>CMAX,c</sub> field, and V=1 indicates that the octet containing the associated P<sub>CMAX,c</sub> field is omitted;
- Power Headroom (PH): this field indicates the power headroom level. The length of the field is 6 bits. The reported PH and the corresponding power headroom levels are shown in Table 6.1.3.6-1 (the corresponding measured values in dB can be found in subclause 9.1.8.4 of [9]);
- P: this field indicates whether the UE applies power backoff due to power management (as allowed by P-MPR<sub>c</sub> [10]). The UE shall set P=1 if the corresponding P<sub>CMAX,c</sub> field would have had a different value if no power backoff due to power management had been applied;
- $P_{CMAX,c}$ : if present, this field indicates the  $P_{CMAX,c}$  or  $\tilde{P}_{CMAX,c}$  [2] used for calculation of the preceding PH field. The reported  $P_{CMAX,c}$  and the corresponding nominal UE transmit power levels are shown in Table 6.1.3.6a-1 (the corresponding measured values in dBm can be found in subclause 9.6.1 of [9]).

Figure 6.1.3.6a-1: Void

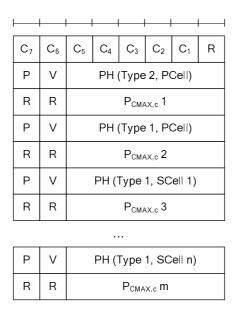


Figure 6.1.3.6a-2: Extended Power Headroom MAC Control Element

Table 6.1.3.6a-1: Nominal UE transmit power level for Extended PHR

P <sub>CMAX,c</sub>	Nominal UE transmit power level
0	PCMAX_C_00
1	PCMAX_C_01
2	PCMAX_C_02
61	PCMAX_C_61
62	PCMAX_C_62
63	PCMAX_C_63

#### 6.1.3.7 MCH Scheduling Information MAC Control Element

The MCH Scheduling Information MAC Control Element illustrated in Figure 6.1.3.7-1 is identified by a MAC PDU subheader with LCID as specified in Table 6.2.1-4. This control element has a variable size. For each MTCH the fields below are included:

- LCID: this field indicates the Logical Channel ID of the MTCH. The length of the field is 5 bits;
- Stop MTCH: this field indicates the ordinal number of the subframe within the MCH scheduling period, counting only the subframes allocated to the MCH, where the corresponding MTCH stops. Value 0 corresponds to the first subframe. The length of the field is 11 bits. The special Stop MTCH value 2047 indicates that the corresponding MTCH is not scheduled. The value range 2043 to 2046 is reserved.

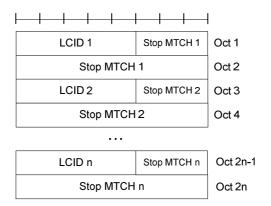


Figure 6.1.3.7-1: MCH Scheduling Information MAC control element

#### 6.1.3.8 Activation/Deactivation MAC Control Element

The Activation/Deactivation MAC control element is identified by a MAC PDU subheader with LCID as specified in table 6.2.1-1. It has a fixed size and consists of a single octet containing seven C-fields and one R-field. The Activation/Deactivation MAC control element is defined as follows (figure 6.1.3.8-1).

- $C_i$ : if there is an SCell configured with SCellIndex i as specified in [8], this field indicates the activation/deactivation status of the SCell with SCellIndex i, else the UE shall ignore the  $C_i$  field. The  $C_i$  field is set to "1" to indicate that the SCell with SCellIndex i shall be activated. The  $C_i$  field is set to "0" to indicate that the SCell with SCellIndex i shall be deactivated;
- R: Reserved bit, set to "0".




Figure 6.1.3.8-1: Activation/Deactivation MAC control element

#### 6.1.4 MAC PDU (transparent MAC)

A MAC PDU consists solely of a MAC Service Data Unit (MAC SDU) whose size is aligned to a TB; as described in figure 6.1.4-1.




Figure 6.1.4-1: Example of MAC PDU (transparent MAC)

#### 6.1.5 MAC PDU (Random Access Response)

A MAC PDU consists of a MAC header and zero or more MAC Random Access Responses (MAC RAR) and optionally padding as described in figure 6.1.5-4.

The MAC header is of variable size.

A MAC PDU header consists of one or more MAC PDU subheaders; each subheader corresponding to a MAC RAR except for the Backoff Indicator subheader. If included, the Backoff Indicator subheader is only included once and is the first subheader included within the MAC PDU header.

A MAC PDU subheader consists of the three header fields E/T/RAPID (as described in figure 6.1.5-1) but for the Backoff Indicator subheader which consists of the five header field E/T/R/BI (as described in figure 6.1.5-2).

A MAC RAR consists of the four fields R/Timing Advance Command/UL Grant/Temporary C-RNTI (as described in figure 6.1.5-3).

Padding may occur after the last MAC RAR. Presence and length of padding is implicit based on TB size, size of MAC header and number of RARs.




Figure 6.1.5-1: E/T/RAPID MAC subheader




Figure 6.1.5-2: E/T/R/R/BI MAC subheader

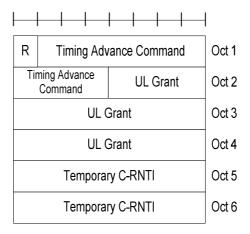


Figure 6.1.5-3: MAC RAR

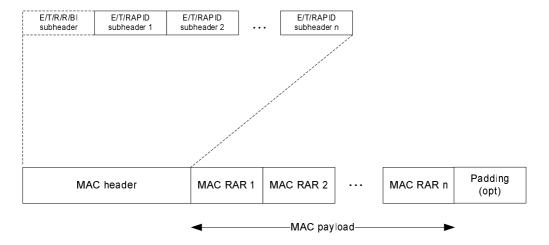


Figure 6.1.5-4: Example of MAC PDU consisting of a MAC header and MAC RARs

#### 6.2 Formats and parameters

#### 6.2.1 MAC header for DL-SCH, UL-SCH and MCH

The MAC header is of variable size and consists of the following fields:

- LCID: The Logical Channel ID field identifies the logical channel instance of the corresponding MAC SDU or the type of the corresponding MAC control element or padding as described in tables 6.2.1-1, 6.2.1-2 and 6.2.1-4 for the DL-SCH, UL-SCH and MCH respectively. There is one LCID field for each MAC SDU, MAC control element or padding included in the MAC PDU. In addition to that, one or two additional LCID fields are included in the MAC PDU, when single-byte or two-byte padding is required but cannot be achieved by padding at the end of the MAC PDU. The LCID field size is 5 bits;
- L: The Length field indicates the length of the corresponding MAC SDU or variable-sized MAC control element in bytes. There is one L field per MAC PDU subheader except for the last subheader and subheaders corresponding to fixed-sized MAC control elements. The size of the L field is indicated by the F field;
- F: The Format field indicates the size of the Length field as indicated in table 6.2.1-3. There is one F field per MAC PDU subheader except for the last subheader and subheaders corresponding to fixed-sized MAC control

elements. The size of the F field is 1 bit. If the size of the MAC SDU or variable-sized MAC control element is less than 128 bytes, the value of the F field is set to 0, otherwise it is set to 1;

- E: The Extension field is a flag indicating if more fields are present in the MAC header or not. The E field is set to "1" to indicate another set of at least R/R/E/LCID fields. The E field is set to "0" to indicate that either a MAC SDU, a MAC control element or padding starts at the next byte;
- R: Reserved bit, set to "0".

The MAC header and subheaders are octet aligned.

Table 6.2.1-1 Values of LCID for DL-SCH

Index	LCID values
00000	CCCH
00001-01010	Identity of the logical channel
01011-11010	Reserved
11011	Activation/Deactivation
11100	UE Contention Resolution Identity
11101	Timing Advance Command
11110	DRX Command
11111	Padding

Table 6.2.1-2 Values of LCID for UL-SCH

Index	LCID values	
00000	CCCH	
00001-01010	Identity of the logical channel	
01011-11000	Reserved	
11001	Extended Power Headroom Report	
11010	Power Headroom Report	
11011	C-RNTI	
11100	Truncated BSR	
11101	Short BSR	
11110	Long BSR	
11111	Padding	

Table 6.2.1-3 Values of F field:

Index	Size of Length field (in bits)
0	7
1	15

Table 6.2.1-4 Values of LCID for MCH

Index	LCID values	
00000	MCCH (see note)	
00001-11100	MTCH	
11101	Reserved	
11110	MCH Scheduling Information	
11111	Padding	
NOTE: If there is no MCCH on MCH, an		
MTCH could use this value.		

#### 6.2.2 MAC header for Random Access Response

The MAC header is of variable size and consists of the following fields:

- E: The Extension field is a flag indicating if more fields are present in the MAC header or not. The E field is set to "1" to indicate at least another set of E/T/RAPID fields follows. The E field is set to "0" to indicate that a MAC RAR or padding starts at the next byte;
- T: The Type field is a flag indicating whether the MAC subheader contains a Random Access ID or a Backoff Indicator. The T field is set to "0" to indicate the presence of a Backoff Indicator field in the subheader (BI). The T field is set to "1" to indicate the presence of a Random Access Preamble ID field in the subheader (RAPID);
- R: Reserved bit, set to "0";
- BI: The Backoff Indicator field identifies the overload condition in the cell. The size of the BI field is 4 bits;
- RAPID: The Random Access Preamble IDentitfier field identifies the transmitted Random Access Preamble (see subclause 5.1.3). The size of the RAPID field is 6 bits.

The MAC header and subheaders are octet aligned.

#### 6.2.3 MAC payload for Random Access Response

The MAC RAR is of fixed size and consists of the following fields:

- R: Reserved bit, set to "0";
- Timing Advance Command: The Timing Advance Command field indicates the index value  $T_A$  (0, 1, 2... 1282) used to control the amount of timing adjustment that UE has to apply (see subclause 4.2.3 of [2]). The size of the Timing Advance Command field is 11 bits;
- UL Grant: The UpLink Grant field indicates the resources to be used on the uplink (see subclause 6.2 of [2]). The size of the UL Grant field is 20 bits;
- Temporary C-RNTI: The Temporary C-RNTI field indicates the temporary identity that is used by the UE during Random Access. The size of the Temporary C-RNTI field is 16 bits.

The MAC RAR is octet aligned.

#### 7 Variables and constants

#### 7.1 RNTI values

RNTI values are presented in Table 7.1-1 and their usage and associated Transport Channels and Logical Channels are presented in Table 7.1-2.

Table 7.1-1: RNTI values.

Value (hexa-decimal)	RNTI
0000	N/A
0001-003C	RA-RNTI, C-RNTI, Semi-Persistent Scheduling C-RNTI, Temporary C-RNTI, TPC-PUCCH-RNTI and TPC-PUSCH-RNTI (see note)
003D-FFF3	C-RNTI, Semi-Persistent Scheduling C-RNTI, Temporary C-RNTI, TPC-PUCCH-RNTI and TPC-PUSCH-RNTI
FFF4-FFC	Reserved for future use
FFFD	M-RNTI
FFFE	P-RNTI
FFFF	SI-RNTI

NOTE: A UE uses the same C-RNTI on all Serving Cells.

Table 7.1-2: RNTI usage.

RNTI	Usage	Transport Channel	Logical Channel
P-RNTI	P-RNTI Paging and System Information change		PCCH
	notification		
SI-RNTI	Broadcast of System Information	DL-SCH	BCCH
M-RNTI	MCCH Information change notification	N/A	N/A
RA-RNTI	Random Access Response	DL-SCH	N/A
Temporary C-RNTI	Contention Resolution	DL-SCH	CCCH
	(when no valid C-RNTI is available)		
Temporary C-RNTI	Msg3 transmission	UL-SCH	CCCH, DCCH, DTCH
C-RNTI	Dynamically scheduled unicast transmission	UL-SCH	DCCH, DTCH
C-RNTI	Dynamically scheduled unicast transmission	DL-SCH	CCCH, DCCH, DTCH
C-RNTI	Triggering of PDCCH ordered random access	N/A	N/A
Semi-Persistent	Semi-Persistently scheduled unicast	DL-SCH, UL-SCH	DCCH, DTCH
Scheduling C-RNTI	transmission		
	(activation, reactivation and retransmission)		
Semi-Persistent	Semi-Persistently scheduled unicast	N/A	N/A
Scheduling C-RNTI	transmission		
	(deactivation)		
TPC-PUCCH-RNTI	Physical layer Uplink power control	N/A	N/A
TPC-PUSCH-RNTI	Physical layer Uplink power control	N/A	N/A

#### 7.2 Backoff Parameter values

Backoff Parameter values are presented in Table 7.2-1.

Table 7.2-1: Backoff Parameter values.

Index	Backoff Parameter value (ms)
0	0
1	10
2	20
3	30
4	40
5	60
6	80
7	120
8	160
9	240
10	320
11	480
12	960
13	Reserved
14	Reserved
15	Reserved

The reserved values of the backoff parameter if received by the current release version UEs shall be taken as 960 ms.

#### 7.3 PRACH Mask Index values

Table 7.3-1: PRACH Mask Index values

PRACH	Allowed PRACH (FDD)	Allowed PRACH (TDD)
Mask Index		
0	All	All
1	PRACH Resource Index 0	PRACH Resource Index 0
2	PRACH Resource Index 1	PRACH Resource Index 1
3	PRACH Resource Index 2	PRACH Resource Index 2
4	PRACH Resource Index 3	PRACH Resource Index 3
5	PRACH Resource Index 4	PRACH Resource Index 4
6	PRACH Resource Index 5	PRACH Resource Index 5
7	PRACH Resource Index 6	Reserved
8	PRACH Resource Index 7	Reserved
9	PRACH Resource Index 8	Reserved
10	PRACH Resource Index 9	Reserved
11	Every, in the time domain, even PRACH opportunity	Every, in the time domain, even PRACH opportunity
	1 <sup>st</sup> PRACH Resource Index in subframe	1 <sup>st</sup> PRACH Resource Index in subframe
12	Every, in the time domain, odd PRACH opportunity	Every, in the time domain, odd PRACH opportunity
	1 <sup>st</sup> PRACH Resource Index in subframe	1 <sup>st</sup> PRACH Resource Index in subframe
13	Reserved	1 <sup>st</sup> PRACH Resource Index in subframe
14	Reserved	2 <sup>nd</sup> PRACH Resource Index in subframe
15	Reserved	3 <sup>rd</sup> PRACH Resource Index in subframe

#### 7.4 Subframe Offset values

Subframe\_Offset values are presented in Table 7.4-1.

Table 7.4-1: Subframe\_Offset values

TDD UL/DL configuration	Position of initial Semi-Persistent grant	Subframe_Offset value (ms)
0	N/A	0
1	Subframes 2 and 7	1
'	Subframes 3 and 8	-1
2	Subframe 2	5
2	Subframe 7	-5
2	Subframes 2 and 3	1
3	Subframe 4	-2
4	Subframe 2	1
4	Subframe 3	-1
5	N/A	0
6	N/A	0

#### 7.5 TTI\_BUNDLE\_SIZE value

The parameter TTI\_BUNDLE\_SIZE is 4.

#### 7.6 DELTA\_PREAMBLE values

The DELTA\_PREAMBLE preamble format based power offset values are presented in Table 7.6-1.

Table 7.6-1: DELTA\_PREAMBLE values.

Preamble Format	DELTA_PREAMBLE value
0	0 dB
1	0 dB
2	-3 dB
3	-3 dB
4	8 dB

Where the Preamble Format is given by *prach-ConfigIndex* [7].

#### 7.7 HARQ RTT Timer

For FDD the HARQ RTT Timer is set to 8 subframes. For TDD the HARQ RTT Timer is set to k+4 subframes, where k is the interval between the downlink transmission and the transmission of associated HARQ feedback, as indicated in Table 10.1.3.1-1 of [2], and for an RN configured with rn-SubframeConfig [8] and not suspended, as indicated in Table 7.5.1-1 of [11].

## Annex A (normative): Handling of measurement gaps

In this specification, the subframes which cannot be used for transmission according to subclause 8.1.2.1 of [9] are also considered as part of measurement gaps in uplink. Measurement gaps are defined in [9].


In a subframe that is part of a measurement gap, the UE shall not perform the transmission of HARQ feedback and CQI/PMI/RI/PTI, and SRS shall not be reported.

### Annex B (normative): Contention resolution for RACH access


When checking whether contention resolution was successful a UE considers the MAC header structures shown below for the processing of a MAC PDU containing a UE Contention Resolution Identity MAC control element.



Case 1: MAC subheader for MAC control element




Case 2: MAC subheader for MAC control element + MAC subheader for MAC SDU (CCCH)



Case 3: MAC subheader for single-byte padding + MAC subheader for MAC control element + MAC subheader for MAC SDU (CCCH)

R	R	Е	LCID (11111)
R	R	Е	LCID (11111)
R	R	Е	LCID (11100)
R	R	Е	LCID (00000)

Case 4: MAC subheaders for two-byte padding + MAC subheader for MAC control element + MAC subheader for MAC SDU (CCCH)

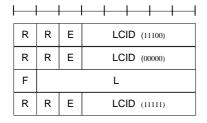

Case 5: MAC subheader for MAC control element + MAC subheader (7-bits L-field) for MAC SDU (CCCH) + MAC subheader for padding

<u> </u>		-	<del>                                     </del>
R	R	Е	LCID (11100)
R	R	Е	LCID (00000)
F		•	L
			L
R	R	Е	LCID (11111)

Case 6: MAC subheader for MAC control element + MAC subheader (15-bits L-field) for MAC SDU (CCCH) + MAC subheader for padding

### Annex C (informative): Intended UE behaviour for DRX Timers

When a DRX timer is set to a value of X, and n denotes the subframe in which the related event is triggered according to the section 5.7, the intended behaviours of each DRX timer are presented in the Table C-1 below:

Table C-1: Intended UE behaviour for DRX timers

DRX Timers	Intended UE behaviour		
	([x, y] means including subframe x and y)		
drx-InactivityTimer	The UE monitors PDCCH in PDCCH-subframes during the subframes [n+1,		
	n+m].		
	The UE starts or restarts drxShortCycleTimer, and uses Short DRX Cycle in		
	the subframe n+m+1, if configured.		
mac-ContentionResolutionTimer	The UE monitors PDCCH in PDCCH-subframes during the subframes [n+1,		
	n+X].		
drx-RetransmissionTimer	The UE monitors PDCCH in PDCCH-subframes during the subframes [n,		
	n+m-1].		
onDurationTimer	The UE monitors PDCCH in PDCCH-subframes during the subframes [n,		
	n+m-1].		
drxShortCycleTimer	The UE uses the Short DRX Cycle during the subframes [n, n+X-1].		
	The UE starts to use the Long DRX Cycle in the subframe n+X.		
HARQ RTT Timer	The UE starts drx-RetransmissionTimer in the subframe n+X, if needed.		
	K; for TDD, m is equal to the minimum number of subframes so that X PDCCH-		
subframes are included	during the subframes [x, y].		

For drx-InactivityTimer and drx-RetransmissionTimer, if X=0, the timer does not make the UE to monitor the PDCCH.

# Annex D (informative): Change history

Date   TSG #   TSG Doc.   CR   Rev   Subject/Comment   Nac Protocol Specification Baseline						Change history		
Dis   NAIVESS   R2-072912   Dis   Text Proposal for UL HARQ (Tdoc R2-072708)   Text Proposal for RACH procedure (Tdoc R2-072707)   Text Proposal for RACH procedure (Tdoc R2-072640)   Text Proposal for RACH procedure (Tdoc R2-072643)   Text Proposal for Rach procedure (Tdoc R2-072643)   Text Proposal for Lugical Channel prioritization (Tdoc R2-072643)   Text Proposal for Lugical Channel prioritization (Tdoc R2-072643)   Text Proposal for Lugical Channel prioritization (Tdoc R2-072643)   Text Proposal for RACH procedure (Tdoc R2-073993)   Text Proposal for RACH procedure (Tdoc R2-073993)   Text Proposal for RACH procedure (Tdoc R2-073473)   Text Proposal for Rach Procedure (Tdoc R2-07431)   Tox Proposal for Pack Procedure (Tdoc R2-07432)   Tox Proposal for Pack Procedure (Tdoc R2-07432)   Tox Proposal				CR	Rev		Old	New
Dis	2007-06		R2-072710			MAC Protocol Specification Baseline	-	
Text Proposal for RACH procedure (Tdoo R2-072640)   Text Proposal for Logical Channel printization (Tdoo R2-072643)   Text Proposal for Logical Channel printization (Tdoo R2-072643)   Sease MAC PDU structure (Tdoo R2-072993) with updates Agreements on Internet Procedure (Tdoo R2-072993)   Agreement on RA-RNTI association (Tdoc R2-072993)   Agreement on RA-RNTI association (Tdoc R2-072993)   Calarification on RA Response reception (Tdoc R2-072993)   Calarification on RA Response reception (Tdoc R2-073473)   Un-recessary error checking in HARQ process procedure (Tdoo R2-073473)   Un-recessary error checking in HARQ process procedure (Tdoo R2-073473)   Un-recessary error checking in HARQ process procedure (Tdoo R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of Procedure (Text Proposal of NARQ Calrification for TDD   Text proposal on HARQ	2007-06	RAN2#58	R2-072912			Text Proposal for UL HARQ (Tdoc R2-072708)		0.1.0
Text Proposal for Logical Channel prioritization (Tdoc R2-072643)		bis				Text Proposal for DL HARQ (Tdoc R2-072707)		
Basic MAC PDU Structure (Tdoc R2-072983) with updates Agreements on time-frequency resource configuration (Tdoc R2-072993) Clarification on RA Response reception (Tdoc R2-072993) Incorrect mapping of logical to transport channel (Tdoc R2-073473) Un-necessary error checking in HARQ process procedure (Tdoc R2-073473) Incorrect mapping of logical to transport channel (Tdoc R2-073473) Correction of Internal variable name (Tdoc R2-073								
bis   Agreements on time-frequency resource configuration (Tdoc R2-072993)   Agreement on RA-RNTI association (Tdoc R2-072993)   Calification on RA Response reception (Tdoc R2-072993)   Calification on RA Response reception (Tdoc R2-073473)   0.1.1   0.2.0   1.0.2.0   0.2.1   0.2.0   0.2.1   0.2.0   0.2.1   0.2.0								
Agreement on RA-RNTI association (Tdoc R2-072993)   Clarification on RA Response reception (Tdoc R2-072993)   Clarification on RA Response reception (Tdoc R2-072993)   Clarification on RA Response reception (Tdoc R2-072473)   0.1.1   0.2.0	2007-06	RAN2#58	R2-072994				0.1.0	0.1.1
Ciarlication on RA Response reception (Tdoc R2-07293)   Content of the National Content of the Natio		bis				072993)		
Incorrect mapping of logical to transport channel (Tdoc R2-073473)   Un-necessary error checking in HARQ process procedure (Tdoc R2-073473)   Un-necessary error checking in HARQ process procedure (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Correction of Park proposal on HARQ clarification for TDD   Text proposal on HARQ clarification for TDD   Text proposal on HARQ clarification for TDD   Text proposal on HARQ clarification for TDD   Corrections on Pandoma (R2-074536)   Corrections on Randoma Access Procedure (R2-074211).   1.0.0   1.1.0   Corrections on Random Access Procedure (R2-074536)   R2-075488   Agreement on Indentity used Random Access Response (R2-075432)   Agreement on Indentity used Random Access Response (R2-075432)   Agreements on Seni-persistent scheduling (R2-075432)   Agreements on BSR contents (R2-075432)   Agreements on DSR contents (						Clarification on RA Response reception (Tdoc R2-072993)		
Un-necessary error checking in HARQ process procedure (Tdoc R2-073473)   Removal of reference to timing relation for HARQ feedback (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Text proposal for Random Access procedure   0.2.0   0.2.1   Text proposal on HARQ clarification for TDD   1.0.0   1.1.0	2007-08	RAN2#59	R2-073715				0.1.1	0.2.0
R2-073473  Removal of reference to timing relation for HARQ feedback (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of HARQ clarification for TDD   Text proposal on HARQ for grants   Clean version for information   Clean version								
Removal of reference to timing relation for HARQ feedback (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Text proposal for Random Access procedure   0.2.0								
R2-073473   Correction of Internal variable name (Tdoc R2-073473)   Correction of Internal variable name (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Text proposal or HARQ diartification for TDD   Text proposal on HARQ diartification for TDD   Text proposal on HARQ for grants   0.2.0								
Correction of Internal variable name (Tdoc R2-073473)   Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Text proposal or Pandom Access procedure Text proposal on HARQ clarification for TDD Text proposal on HARQ clarification for TDD Text proposal on HARQ clarification for TDD Text proposal on HARQ for grants   Decision for Information   Decision of Part proposal on HARQ for grants   Decision for Information   Decision   Decision for Information   Decision for Information   Decision								
Correction of procedure in case of successful HARQ reception (Tdoc R2-073473)   Text proposal for Random Access procedure Text proposal on HARQ Lordification for TDD Text proposal on HARQ Lordification Lordification Lord								
Close Name								
Text proposal for Random Access procedure								
Text proposal on HARQ clarification for TDD	2007-09	RAN2#59	R2-073885			, ,	0.2.0	0.2.1
2007-09   RAN#37   RP-070688   Clean version for information   Clean version   Clean version for information   Clean version   Clean version								
Description						Text proposal on HARQ for grants		
Dis   Corrections on MAC PDU format (R2-074536)   Corrections on Random Access Procedure (R2-074536)   1.1.0   1.1.1   1.2.0   1.1.1   RAN2#60   R2-075243   Endorsement of v1.1.1   Removal of FF5 on DL CCCH existence   1.1.1   1.2.0   1.3.0   1.3.0   RAN2#60   R2-075488   Endorsement of v1.1.1   Removal of FF5 on DL CCCH existence   1.2.0   1.3.0   1.3.0   RAN2#60   R2-075488   Agreement on identity used Random Access Response (R2-075038)   Agreement on Local Nack1 (R2-074949)   PUCCH Resource handling (R2-075432)   UL HARQ agreements (R2-075432)   Agreements on BSR contents (R2-075432)   Agreements on	2007-09	RAN#37	RP-070688			Clean version for information	0.2.1	1.0.0
Agreements on MAC PDU format (R2-074536)   1.1.0   1.1.1   1.2.0   1.3.0   1	2007-10	RAN2#59	R2-074530			Editorial update with Editor's notes (Tdoc R2-074211).	1.0.0	1.1.0
Corrections on Random Access Procedure (R2-074536)   Endorsement of V1.1.1   RAN2#60   R2-075243   Endorsement of V1.1.1   Removal of FFS on DL CCCH existence   1.1.1   1.2.0   1.3.0   1.3.0   RAN2#60   R2-075488   Agreement on identity used Random Access Response (R2-075438)   Agreement on Identity used Random Access Response (R2-075638)   Agreement on Local Nack1 (R2-074949)   PUCCH Resource handling (R2-075432)   UL HARQ agreements (R2-075432)   Agreements on SBR/SR triggers (R2-075432)   Agreements on SBR/SR triggers (R2-075432)   Agreements on SBR/SR triggers (R2-075432)   Agreements on DBR control (36.300)   Agreements on DB								
Endorsement of V1.1.1   Removal of FFS on DL CCCH existence   1.1.1   1.2.0	2007-11	RAN2#60	R2-075093				1.1.0	1.1.1
Removal of FFS on DL CCCH existence   Agreement on identity used Random Access Response (R2-075038)   Agreement on identity used Random Access Response (R2-075038)   Agreement on Local Nack1 (R2-074949)   PUCCH Resource handling (R2-075432)   UL HARQ agreements (R2-075432)   UL HARQ agreements (R2-075432)   Agreements on BSR/SR triggers (R2-075432)   Agreements on BSR/SR triggers (R2-075432)   Agreements on DRX control (36,300)   Agreements on DRX c	2007 11	D V N D # C O	D2 075242				111	120
0.75038)	2007-11	KANZ#00	KZ-073243				1.1.1	1.2.0
Agreement on Local Nack1 (R2-074949)   PUCCH Resource handling (R2-075432)   UL HARQ agreements (R2-075432)   Agreements on semi-persistent scheduling (R2-075432, 36.300)   Agreements on semi-persistent scheduling (R2-075432, 36.300)   Agreements on BSR contents (R2-075432)   Agreements on BSR contents (R2-075432)   Agreements on DRX control (36.300)   Agreements on DRX contro	2007-11	RAN2#60	R2-075488				1.2.0	1.3.0
PÜCCH Resource handling (R2-075432)   UL HARQ agreements (R2-075432)   Agreements on semi-persistent scheduling (R2-075432, 36.300)   Agreements on BSR/SR triggers (R2-075432)   Agreements on BSR/SR triggers (R2-075432)   Agreements on BSR contents (R2-075432)   Agreements on DSR control (36.300)   Agreements on DRX (36.321 CR covering agreements of RAN2 #61bis and RAN2#62   8.1.0   8.2.0						,		
UL HARQ agreements (R2-075432)   Agreements on semi-persistent scheduling (R2-075432, 36.300)   Agreements on BSR/SR triggers (R2-075432)   Agreements on BSR/SR triggers (R2-075432)   Agreements on BSR contents (R2-075432)   Agreements on BSR contents (R2-075432)   Agreements on DSR control (36.300)   Ag								
Agreements on semi-persistent scheduling (R2-075432, 36.300) Agreements on BSR/SR triggers (R2-075432) Agreements on BSR Contents (R2-075432) Agreements on DRX control (36.300) Agreements on								
Agreements on BSR/SR triggers (R2-075432)   Agreements on BSR contents (R2-075432)   Agreements on BSR contents (R2-075432)   Agreements on BSR contents (R2-075432)   Agreements on DRX control (36.300)   Agreements of DRX control (36.300)   Agreements of CRAN-38 for approval   1.3.0   2.0.0   8.								
Agreements on Timing Advance principles (36.300)   Agreements on DRX control (36.300)   Handling of P-BCH, D-BCH, PCH (R2-075246)								
Agreements on DRX control (36.300)						Agreements on BSR contents (R2-075432)		
Handling of P-BCH, D-BCH, PCH (R2-075246)   2007-11   RP-38   RP-070917   Clean version, presented at TSG RAN-38 for approval   1.3.0   2.0.0   2007-12   RP-38   -								
2007-11         RP-38         RP-070917         Clean version, presented at TSG RAN-38 for approval         1.3.0         2.0.0           2007-12         RP-38         -         Approved at TSG RAN-38 and placed under change control         2.0.0         8.0.0           2008-03         RP-39         RP-080162         0001         2         CR to 36.321 with E-UTRA MAC protocol specification update         8.0.0         8.1.0           2008-05         RP-40         RP-080410         0002         1         36.321 CR covering agreements of RAN2 #61bis and RAN2#62         8.1.0         8.2.0           2008-09         RP-41         RP-080690         0003         -         Clarification on data available for transmission for BSR triggering         8.2.0         8.3.0           RP-41         RP-080690         0004         -         CR to 36.321 on failure indication after maximum number of HARQ transmissions         8.2.0         8.3.0           RP-41         RP-080690         0006         -         CR to 36.321 on Buffer size levels for BSR         8.2.0         8.3.0           RP-41         RP-080690         0007         -         Clarifications on DRX         8.2.0         8.3.0           RP-41         RP-080690         0008         -         Clarification on UE behavior for DRX and configured measurement gaps								
2007-12         RP-38         -         Approved at TSG RAN-38 and placed under change control         2.0.0         8.0.0           2008-03         RP-39         RP-080162         0001         2         CR to 36.321 with E-UTRA MAC protocol specification update         8.0.0         8.1.0           2008-05         RP-40         RP-080690         0003         1         36.321 CR covering agreements of RAN2 #61bis and RAN2#62         8.1.0         8.2.0           2008-09         RP-41         RP-080690         0003         -         Clarification on data available for transmission for BSR triggering         8.2.0         8.3.0           RP-41         RP-080690         0004         -         CR to 36.321 on failure indication after maximum number of HARQ transmissions         8.2.0         8.3.0           RP-41         RP-080690         0005         4         Clarifications and Corrections of DL and UL Data Transfer (SCH, RACH and SR)         8.2.0         8.3.0           RP-41         RP-080690         0006         -         CR to 36.321 on Buffer size levels for BSR         8.2.0         8.3.0           RP-41         RP-080690         0007         -         Clarifications on DRX         8.2.0         8.3.0           RP-41         RP-080690         0009         3         Correction to MAC Padding BSR								
2008-03         RP-39         RP-080162         0001         2         CR to 36.321 with E-UTRA MAC protocol specification update         8.0.0         8.1.0           2008-05         RP-40         RP-080410         0002         1         36.321 CR covering agreements of RAN2 #61bis and RAN2#62         8.1.0         8.2.0           2008-09         RP-41         RP-080690         0003         -         Clarification on data available for transmission for BSR triggering         8.2.0         8.3.0           RP-41         RP-080690         0004         -         CR to 36.321 on failure indication after maximum number of HARQ transmissions         8.2.0         8.3.0           RP-41         RP-080690         0005         4         Clarifications and Corrections of DL and UL Data Transfer (SCH, RACH and SR)         8.2.0         8.3.0           RP-41         RP-080690         0006         -         CR to 36.321 on Buffer size levels for BSR         8.2.0         8.3.0           RP-41         RP-080690         0007         -         Clarifications on DRX         8.2.0         8.3.0           RP-41         RP-080690         0008         -         Clarification on UE behavior for DRX and configured measurement gaps         8.2.0         8.3.0           RP-41         RP-080690         0010         -			RP-070917					
2008-05         RP-40         RP-080410         0002         1         36.321 CR covering agreements of RAN2 #61bis and RAN2#62         8.1.0         8.2.0           2008-09         RP-41         RP-080690         0003         -         Clarification on data available for transmission for BSR triggering         8.2.0         8.3.0           RP-41         RP-080690         0004         -         CR to 36.321 on failure indication after maximum number of HARQ transmissions         8.2.0         8.3.0           RP-41         RP-080690         0005         4         Clarifications and Corrections of DL and UL Data Transfer (SCH, RACH and SR)         8.2.0         8.3.0           RP-41         RP-080690         0006         -         CR to 36.321 on Buffer size levels for BSR         8.2.0         8.3.0           RP-41         RP-080690         0007         -         Clarifications on DRX         8.2.0         8.3.0           RP-41         RP-080690         0008         -         Clarification on UE behavior for DRX and configured measurement gaps         8.2.0         8.3.0           RP-41         RP-080690         0010         -         Correction to MAC Padding BSR         8.2.0         8.3.0           RP-41         RP-080690         0011         -         Corrections on BSR         8.2.0			-	0004	_			
2008-09         RP-41         RP-080690         0003         -         Clarification on data available for transmission for BSR triggering         8.2.0         8.3.0           RP-41         RP-080690         0004         -         CR to 36.321 on failure indication after maximum number of HARQ transmissions         8.2.0         8.3.0           RP-41         RP-080690         0005         4         Clarifications and Corrections of DL and UL Data Transfer (SCH, RACH and SR)         8.2.0         8.3.0           RP-41         RP-080690         0006         -         CR to 36.321 on Buffer size levels for BSR         8.2.0         8.3.0           RP-41         RP-080690         0007         -         Clarifications on DRX         8.2.0         8.3.0           RP-41         RP-080690         0008         -         Clarification on UE behavior for DRX and configured measurement gaps         8.2.0         8.3.0           RP-41         RP-080690         0009         3         Correction to MAC Padding BSR         8.2.0         8.3.0           RP-41         RP-080690         0010         -         Corrections on BSR         8.2.0         8.3.0           RP-41         RP-080690         0011         -         Corrections on BSR         8.2.0         8.2.0         8.3.0								
RP-41         RP-080690         0004         -         CR to 36.321 on failure indication after maximum number of HARQ transmissions         8.2.0         8.3.0           RP-41         RP-080690         0005         4         Clarifications and Corrections of DL and UL Data Transfer (SCH, RACH and SR)         8.2.0         8.3.0           RP-41         RP-080690         0006         -         CR to 36.321 on Buffer size levels for BSR         8.2.0         8.3.0           RP-41         RP-080690         0007         -         Clarifications on DRX         8.2.0         8.3.0           RP-41         RP-080690         0008         -         Clarification on UE behavior for DRX and configured measurement gaps         8.2.0         8.3.0           RP-41         RP-080690         0009         3         Correction to MAC Padding BSR         8.2.0         8.3.0           RP-41         RP-080690         0010         -         Correction to UE transmission power headroom report for LTE         8.2.0         8.3.0           RP-41         RP-080690         0011         -         Corrections on BSR         8.2.0         8.3.0           RP-41         RP-080690         0012         -         CR to 36.321 REL-8 on Format of UL grant in Message 2         8.2.0         8.3.0           RP-41						ÜÜ		
transmissions           RP-41         RP-080690         0005         4         Clarifications and Corrections of DL and UL Data Transfer (SCH, RACH and SR)         8.2.0         8.3.0           RP-41         RP-080690         0006         -         CR to 36.321 on Buffer size levels for BSR         8.2.0         8.3.0           RP-41         RP-080690         0007         -         Clarifications on DRX         8.2.0         8.3.0           RP-41         RP-080690         0008         -         Clarification on UE behavior for DRX and configured measurement gaps         8.2.0         8.3.0           RP-41         RP-080690         0009         3         Correction to MAC Padding BSR         8.2.0         8.3.0           RP-41         RP-080690         0010         -         Correction to UE transmission power headroom report for LTE         8.2.0         8.3.0           RP-41         RP-080690         0011         -         Corrections on BSR         8.2.0         8.3.0           RP-41         RP-080690         0012         -         CR to 36.321 REL-8 on Format of UL grant in Message 2         8.2.0         8.3.0           RP-41         RP-080690         0015         -         CR to 36.321 REL-8 on PUSCH PUCCH Power Control RNTIs         8.2.0         8.3.0 <td>2006-09</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>	2006-09							
RACH and SR    RP-41   RP-080690   0006   CR to 36.321 on Buffer size levels for BSR   8.2.0   8.3.0		KP-41	KP-060690	0004	-		0.2.0	6.3.0
RP-41         RP-080690         0006         CR to 36.321 on Buffer size levels for BSR         8.2.0         8.3.0           RP-41         RP-080690         0007         Clarifications on DRX         8.2.0         8.3.0           RP-41         RP-080690         0008         Clarification on UE behavior for DRX and configured measurement gaps         8.2.0         8.3.0           RP-41         RP-080690         0009         3         Correction to MAC Padding BSR         8.2.0         8.3.0           RP-41         RP-080690         0010         Correction to UE transmission power headroom report for LTE         8.2.0         8.3.0           RP-41         RP-080690         0011         Corrections on BSR         8.2.0         8.3.0           RP-41         RP-080690         0012         CR to 36.321 REL-8 on Format of UL grant in Message 2         8.2.0         8.3.0           RP-41         RP-080690         0015         CR to 36.321 REL-8 on PUSCH PUCCH Power Control RNTIs         8.2.0         8.3.0           RP-41         RP-080690         0016         CR to 36.321 REL-8 on RACH uniform random backoff         8.2.0         8.3.0           RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-		RP-41	RP-080690	0005	4	Clarifications and Corrections of DL and UL Data Transfer (SCH,	8.2.0	8.3.0
RP-41         RP-080690         0007         Clarifications on DRX         8.2.0         8.3.0           RP-41         RP-080690         0008         Clarification on UE behavior for DRX and configured measurement gaps         8.2.0         8.3.0           RP-41         RP-080690         0009         3         Correction to MAC Padding BSR         8.2.0         8.3.0           RP-41         RP-080690         0010         -         Correction to UE transmission power headroom report for LTE         8.2.0         8.3.0           RP-41         RP-080690         0011         -         Corrections on BSR         8.2.0         8.3.0           RP-41         RP-080690         0012         -         CR to 36.321 REL-8 on Format of UL grant in Message 2         8.2.0         8.3.0           RP-41         RP-080690         0015         -         CR to 36.321 REL-8 on PUSCH PUCCH Power Control RNTIs         8.2.0         8.3.0           RP-41         RP-080690         0016         -         CR to 36.321 REL-8 on RACH uniform random backoff         8.2.0         8.3.0           RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-41         RP-080690         0020         -         TP for number		DD 44	DD 000000	0000			0.0.0	0.0.0
RP-41         RP-080690         0008         -         Clarification on UE behavior for DRX and configured measurement gaps         8.2.0         8.3.0           RP-41         RP-080690         0009         3         Correction to MAC Padding BSR         8.2.0         8.3.0           RP-41         RP-080690         0010         -         Correction to UE transmission power headroom report for LTE         8.2.0         8.3.0           RP-41         RP-080690         0011         -         Corrections on BSR         8.2.0         8.3.0           RP-41         RP-080690         0012         -         CR to 36.321 REL-8 on Format of UL grant in Message 2         8.2.0         8.3.0           RP-41         RP-080690         0015         -         CR to 36.321 REL-8 on PUSCH PUCCH Power Control RNTIs         8.2.0         8.3.0           RP-41         RP-080690         0016         -         CR to 36.321 REL-8 on RACH uniform random backoff         8.2.0         8.3.0           RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-41         RP-080690         0020         -         TP for number of HARQ processes and MIMO         8.2.0         8.3.0								
RP-41   RP-080690   0009   3   Correction to MAC Padding BSR   8.2.0   8.3.0								
RP-41         RP-080690         0009         3         Correction to MAC Padding BSR         8.2.0         8.3.0           RP-41         RP-080690         0010         -         Correction to UE transmission power headroom report for LTE         8.2.0         8.3.0           RP-41         RP-080690         0011         -         Corrections on BSR         8.2.0         8.3.0           RP-41         RP-080690         0012         -         CR to 36.321 REL-8 on Format of UL grant in Message 2         8.2.0         8.3.0           RP-41         RP-080690         0015         -         CR to 36.321 REL-8 on PUSCH PUCCH Power Control RNTIs         8.2.0         8.3.0           RP-41         RP-080690         0016         -         CR to 36.321 REL-8 on RACH uniform random backoff         8.2.0         8.3.0           RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-41         RP-080690         0020         -         TP for number of HARQ processes and MIMO         8.2.0         8.3.0		KP-41	KP-U8U690	0008	-		0.2.0	0.3.0
RP-41         RP-080690         0010         -         Correction to UE transmission power headroom report for LTE         8.2.0         8.3.0           RP-41         RP-080690         0011         -         Corrections on BSR         8.2.0         8.3.0           RP-41         RP-080690         0012         -         CR to 36.321 REL-8 on Format of UL grant in Message 2         8.2.0         8.3.0           RP-41         RP-080690         0015         -         CR to 36.321 REL-8 on PUSCH PUCCH Power Control RNTIs         8.2.0         8.3.0           RP-41         RP-080690         0016         -         CR to 36.321 REL-8 on RACH uniform random backoff         8.2.0         8.3.0           RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-41         RP-080690         0020         -         TP for number of HARQ processes and MIMO         8.2.0         8.3.0		RP-41	RP-080690	0009	3	Correction to MAC Padding BSR	8.2.0	8.3.0
RP-41         RP-080690         0011         -         Corrections on BSR         8.2.0         8.3.0           RP-41         RP-080690         0012         -         CR to 36.321 REL-8 on Format of UL grant in Message 2         8.2.0         8.3.0           RP-41         RP-080690         0015         -         CR to 36.321 REL-8 on PUSCH PUCCH Power Control RNTIs         8.2.0         8.3.0           RP-41         RP-080690         0016         -         CR to 36.321 REL-8 on RACH uniform random backoff         8.2.0         8.3.0           RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-41         RP-080690         0020         -         TP for number of HARQ processes and MIMO         8.2.0         8.3.0								
RP-41         RP-080690         0012         -         CR to 36.321 REL-8 on Format of UL grant in Message 2         8.2.0         8.3.0           RP-41         RP-080690         0015         -         CR to 36.321 REL-8 on PUSCH PUCCH Power Control RNTIs         8.2.0         8.3.0           RP-41         RP-080690         0016         -         CR to 36.321 REL-8 on RACH uniform random backoff         8.2.0         8.3.0           RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-41         RP-080690         0020         -         TP for number of HARQ processes and MIMO         8.2.0         8.3.0		RP-41	RP-080690	0011	-	Corrections on BSR	8.2.0	
RP-41         RP-080690         0015         -         CR to 36.321 REL-8 on PUSCH PUCCH Power Control RNTIs         8.2.0         8.3.0           RP-41         RP-080690         0016         -         CR to 36.321 REL-8 on RACH uniform random backoff         8.2.0         8.3.0           RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-41         RP-080690         0020         -         TP for number of HARQ processes and MIMO         8.2.0         8.3.0		RP-41				CR to 36.321 REL-8 on Format of UL grant in Message 2		
RP-41         RP-080690         0016         -         CR to 36.321 REL-8 on RACH uniform random backoff         8.2.0         8.3.0           RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-41         RP-080690         0020         -         TP for number of HARQ processes and MIMO         8.2.0         8.3.0								
RP-41         RP-080690         0017         1         E-UTRA MAC protocol specification update         8.2.0         8.3.0           RP-41         RP-080690         0020         -         TP for number of HARQ processes and MIMO         8.2.0         8.3.0		RP-41						
RP-41 RP-080690 0020 - TP for number of HARQ processes and MIMO 8.2.0 8.3.0		RP-41						
		RP-41					8.2.0	

	DD 44	IDD 000000	0007	1	Ithough a control of the control of	10.00	To o o
	RP-41	RP-080690			Handling of Semi-Persistent grants and assignments	8.2.0	8.3.0
	RP-41	RP-080690			Corrections relating to RACH	8.2.0	8.3.0
	RP-41	RP-080690			UL Channel Prioritisation	8.2.0	8.3.0
	RP-41	RP-080690			Corrections relating to RACH partitioning	8.2.0	8.3.0
	RP-41	RP-080690			Correction on Random Access Response reception behaviour	8.2.0	8.3.0
	RP-41	RP-080690			Upper limit of logical channel id	8.2.0	8.3.0
	RP-41	RP-080690	0104	-	Clarifications and Corrections for HARQ operation at TAT expiry and RACH contention resolution	8.2.0	8.3.0
2008-12	RP-42	RP-081018	0105	-	CR0105 to 36.321 [Rel-8] on PHR Periodic Timer Start	8.3.0	8.4.0
	RP-42	RP-081018			Proposed R1 of CR0106 to 36.321 [Rel-8] on PHR Reference	8.3.0	8.4.0
	RP-42	RP-081018	0107	1	CR 0107 to 36.321 Interactions between measurement gap and Msg3 transmission	8.3.0	8.4.0
	RP-42	RP-081018	0108	2	Proposed R1 of CR0108 to 36.321 [Rel-8] on PHR Reporting Values	8.3.0	8.4.0
	RP-42	RP-081018	0109	-	Correction relating to equal priorities	8.3.0	8.4.0
	RP-42	RP-081018			CR 0110 to 36.321 on Correction to PHR	8.3.0	8.4.0
	RP-42	RP-081018			CR0112r1 to 36.321 [Rel-8] Correction to BCCH Reception procedure	8.3.0	8.4.0
	RP-42	RP-081018	0113	_	Contention Resolution Timer	8.3.0	8.4.0
	RP-42	RP-081018			PCH reception	8.3.0	8.4.0
	RP-42	RP-081018			Correction to reception of assignments and grants	8.3.0	8.4.0
	RP-42	RP-081018			Correction on Contention Resolution	8.3.0	8.4.0
	RP-42	RP-081018			Proposed R1 of CR0117 to 36.321 [Rel-8] on on SR Clarifications and Repetitions	8.3.0	8.4.0
<b>-</b>	RP-42	RP-081078	0118	2	Clarification on Padding value	8.3.0	8.4.0
	RP-42	RP-081018			CR 0119 to 36.321 Correction and Clarification on TTI Bundling	8.3.0	8.4.0
-	RP-42	RP-081018			Clarification of DRX Active Time	8.3.0	8.4.0
	RP-42	RP-081018			Text Proposal for Dedicated Preamble Assignment	8.3.0	8.4.0
	RP-42	RP-081018			CR0122 to 36.321 [Rel-8] on Message 3 Definition	8.3.0	8.4.0
	RP-42	RP-081018			Correction to prevent wrong contention resolution by adaptive	8.3.0	8.4.0
	111 -42	1001010	0123	l'	retransmission command	0.5.0	0.4.0
	RP-42	RP-081018	0124	_	Bucket Size Parameter	8.3.0	8.4.0
	RP-42	RP-081018			CR0125r2 to 36.321 [Rel-8] Correction to Multiple BSR	8.3.0	8.4.0
	RP-42	RP-081018			CR0127 to 36.321 [Rel-8] RACH preambles labelling	8.3.0	8.4.0
	RP-42	RP-081018			CR0128r1 to 36.321 [Rel-8] merging CR0126r0 and CR0128r0	8.3.0	8.4.0
	RP-42	RP-081018			CR0129r1 to 36.321 [Rel-8] Correction to PDU Format	8.3.0	8.4.0
	RP-42	RP-081018			CQI/ SRS/PMI/RI transmission during active time	8.3.0	8.4.0
	RP-42	RP-081018			NDI and Msg4 Carrying Contention Resolution ID	8.3.0	8.4.0
	RP-42	RP-081018			CR0132 to 36.321 [Rel-8] on MAC BSR trigger	8.3.0	8.4.0
	RP-42	RP-081018			Clarification about Restarting the Periodic BSR Timer	8.3.0	8.4.0
	RP-42	RP-081018			Correction to RA procedure initiated by eNB PDCCH order	8.3.0	8.4.0
	RP-42	RP-081018			Correction on PHR triggering condition	8.3.0	8.4.0
	RP-42	RP-081018			CR 0136 to 36.321 on Correction to UL HARQ Process for the transmission of Msg3	8.3.0	8.4.0
	RP-42	RP-081018	0137	2	SPS occasions	8.3.0	8.4.0
	RP-42	RP-081018			Robustness of Buffer Status Reporting	8.3.0	8.4.0
	RP-42	RP-081018			Proposed CR to 36.321 [Rel-8] on UL HARQ and Measurement	8.3.0	8.4.0
	DD 40	DD 004040	04.40	4	Gaps	0.0.0	0.40
	RP-42	RP-081018			TAT and RACH procedure	8.3.0	8.4.0
	RP-42	RP-081018			SRS and CQI Resources Release upon TAT Expiry	8.3.0	8.4.0
	RP-42	RP-081018			Proposed CR to 36.321 Correction to RACH procedure	8.3.0	8.4.0
	RP-42	RP-081018			BSR format for reporting empty buffers	8.3.0	8.4.0
	RP-42	RP-081018			TTI Bundling Configuration	8.3.0	8.4.0
	RP-42	RP-081018			Corrections to semi-persistent scheduling	8.3.0	8.4.0
	RP-42	RP-081018			Priotitization of MAC control elements	8.3.0	8.4.0
	RP-42	RP-081018			Correction to starting of TA timer	8.3.0	8.4.0
	RP-42	RP-081018			Proposed CR to 36.321 SPS implicit release on UL	8.3.0	8.4.0
	RP-42	RP-081018			Proposed CR to 36.321 Measurement gaps and SPS	8.3.0	8.4.0
	RP-42	RP-081018			Proposed CR to 36.321 Setting reserved bits to zero	8.3.0	8.4.0
	RP-42	RP-081018			Proposed CR to 36.321 [Rel-8] MAC ResetReconfig Option 2	8.3.0	8.4.0
	RP-42	RP-081018			RV setting	8.3.0	8.4.0
	RP-42	RP-081018			Corrections to Random Access Procedure	8.3.0	8.4.0
	RP-42	RP-081018			Number of HARQ processes for MIMO	8.3.0	8.4.0
<u> </u>	RP-42	RP-081018			Corrections to power control and random access	8.3.0	8.4.0
<u> </u>	RP-42	RP-081018			Correction on the definition of the PDCCH-subframe	8.3.0	8.4.0
	RP-42	RP-081018			Correction to the coexist of SPS-RNTI and SI-RNTI or RA-RNTI	8.3.0	8.4.0
<u> </u>	RP-42	RP-081018			Explicit release of SPS	8.3.0	8.4.0
	RP-42	RP-081018			Linking HARQ process ID with the SPS resource	8.3.0	8.4.0
	RP-42	RP-081018			Bucket Parameter Update	8.3.0	8.4.0
	RP-42	RP-081018			Clarification on "PDCCH indicates a new transmission" for DRX	8.3.0	8.4.0
	RP-42	RP-081018			Editorial corrections to MAC	8.3.0	8.4.0
	RP-42	RP-081018	0236	-	RB suspension and BSR contents	8.3.0	8.4.0

RP-42		laa	IDD 001010			lav	1000	10.0
RP-42		RP-42				RV setting	8.3.0	8.4.0
RP-42								
RP-42					-			
2009-103   RP-43   RP-900128   0246   Entering of reserved RNT1s   8.4.0   8.5.0					-			
RP-43	0000 00				-			
RP-43	2009-03				-			
RP-43					2			
RP-43					-			
RP-43					-			
RP-43					-			
RP-43					1			
RP-43					-			
RP-43					-			
With TAT								
RP-43   RP-090128   0256   Corrections to redundancy version control for system information   8.40   8.5.0		KP-43	KP-090126	0254	ı	with TAT		
RP-43   RP-090128   0257   Mapping of the RNTIs to different transport channels   8.40   8.50		RP-43	RP-090128	0255	-	HARQ Feedback and Contention Resolution	8.4.0	8.5.0
RP-43   RP-090128   0258   DRX and UL Retramssissions   8.40   8.50		RP-43	RP-090128	0256	-	Corrections to redundancy version control for system information	8.4.0	8.5.0
RP-43		RP-43	RP-090128	0257	-	Mapping of the RNTIs to different transport channels	8.4.0	8.5.0
RP-43		RP-43	RP-090128	0258	-	DRX and UL Retransmissions	8.4.0	8.5.0
RP-43   RP-090128   0260   .		RP-43	RP-090128	0259	-	Definition of DRX Short Cycle Timer	8.4.0	8.5.0
RP-43 RP-090128 0262   Corrections to power control and random access   8.4.0   8.5.0		RP-43			-			
RP-43 RP-090128 0262   Corrections to power control and random access   8.4.0   8.5.0					-			
RP-43					-			
RP-43					-			
RP-43   RP-090128   0265   Sucket Parameter Update   8.40   8.50   RP-43   RP-090128   0265   Correction to Handling of triggered PHR   8.40   8.50   RP-43   RP-090128   0266   SPS resource release on D-SR failure   8.40   8.50   RP-43   RP-090128   0267   SPS resource release on D-SR failure   8.40   8.50   RP-43   RP-090128   0271   Error Handling when measurement gap and SPS occassion collide   8.40   8.50   RP-43   RP-090128   0271   Error Handling   RP-090128   0271   Error Handling   RP-090128   0272   Various clarifications/corrections to TS36.321   8.40   8.50   RP-43   RP-090128   0273   Disassembly, Demultiplexing and Multiplexing functions   8.40   8.50   RP-43   RP-090128   0274   Miscellaneous corrections to MAC   RP-090128   0274   Miscellaneous corrections to MAC   RP-090128   0276   TII Bundling   RP-090128   0280   Usage of RRC Parameters   RP-090128   0281   Correction to Release of SPS   RP-43   RP-090128   0281   Correction to RPR-090128   0281   Correction on MAC Timer status   RP-090128   0281   Correction on MAC PDU subheader description   RP-		RP-43			1			
RP-43   RP-090128   0266   2   Correction to Handling of triggered PHR			RP-090128	0265	-		8.4.0	
RP-43   RP-090128   0267   SPS resource release on D-SR failure		RP-43					8.4.0	
RP-43		RP-43			-	SPS resource release on D-SR failure		
RP-43   RP-090128   0270   - Correction relating to PDCCH order   8.4.0   8.5.0					2		8.4.0	
RP-43		RP-43						
RP-43					-			
RP-43					-			
RP-43					1			
RP-43								
RP-43   RP-090128   0276   TIT Bundling   RP-43   RP-090128   0279   Correction to BSR trigger at serving cell change   S.4.0   8.5.0   RP-43   RP-090128   0279   Correction to Release of SPS   S.4.0   8.5.0   RP-43   RP-090128   0280   Correction to Release of SPS   RP-43   RP-090128   0280   Correction to Release of SPS   S.4.0   8.5.0   RP-43   RP-090128   0281   Clarification of MAC Timer status   S.4.0   8.5.0   RP-43   RP-090128   0282   Correction on MAC PDU subheader description   S.4.0   8.5.0   RP-43   RP-090128   0283   LEFA								
RP-43   RP-090128   0278   1   Correction to BSR trigger at serving cell change   8.4.0   8.5.0								
RP-43								
RP-43         RP-090128   0280   2         Usage of RRC Parameters         8.4.0   8.5.0           RP-43         RP-090128   0281   Correction on MAC Timer status         8.4.0   8.5.0           RP-43         RP-090128   0283   Usage of RRC Parameters         8.4.0   8.5.0           RP-43         RP-090128   0283   Usage of RRC Parameters         8.4.0   8.5.0           RP-43         RP-090128   0285   Reporting During DRX         8.4.0   8.5.0           RP-43         RP-090128   0289   NDI handling after random access procedure         8.4.0   8.5.0           RP-43         RP-090128   0289   NDI handling after random access failure         8.4.0   8.5.0           RP-43         RP-090128   0292   Dedicated preamble handling after random access failure         8.4.0   8.5.0           RP-43         RP-090128   0293   Dedicated preamble handling after random access failure         8.4.0   8.5.0           RP-43         RP-090128   0293   Dedicated preamble handling after random access failure         8.4.0   8.5.0           RP-43         RP-090128   0393   Dedicated preamble handling after random access failure         8.4.0   8.5.0           RP-43         RP-090128   0393   Dedicated preamble handling after random access failure         8.4.0   8.5.0           RP-43         RP-090128   0303   Dedicated preamble handling after random access failure         8.4.0   8.5.0           RP-43         RP-090128   0305   D								
RP-43								
RP-43         RP-090128         0282         1         Correction on MAC PDU subheader description         8.4.0         8.5.0           RP-43         RP-090128         0283         1         UE behaviour at CURRENT_TX_NB reaches maximum value         8.4.0         8.5.0           RP-43         RP-090128         0289         - NDI handling after random access procedure         8.4.0         8.5.0           RP-43         RP-090128         0290         1         Dedicated preamble handling after random access failure         8.4.0         8.5.0           RP-43         RP-090128         0292         1         Dedicated preamble handling after random access failure         8.4.0         8.5.0           RP-43         RP-090128         0292         1         Dedicated preamble handling after random access failure         8.4.0         8.5.0           RP-43         RP-090128         0303         1         Correction to Msg3 definition and usage         8.4.0         8.5.0           RP-43         RP-090128         0300         1         Correction must use prach-ConfigurationIndex         8.4.0         8.5.0           RP-43         RP-090128         0305         - Clarification on RETX_BSR_TIMER         8.4.0         8.5.0           RP-43         RP-090128         0304         - Cl		RP-43			-			
RP-43         RP-090128         0283         1         UE behaviour at CURRENT_TX_NB reaches maximum value         8.4.0         8.5.0           RP-43         RP-090128         0285         -         Reporting During DRX         8.4.0         8.5.0           RP-43         RP-090128         0289         -         NDI handling after random access procedure         8.4.0         8.5.0           RP-43         RP-090128         0290         1         Dedicated preamble handling after random access failure         8.4.0         8.5.0           RP-43         RP-090128         0292         -         NDI and grant in Message 2         8.4.0         8.5.0           RP-43         RP-090128         0300         1         Corrections to Msg3 definition and usage         8.4.0         8.5.0           RP-43         RP-090128         0303         1         Corrections to Msg3 definition and usage         8.4.0         8.5.0           RP-43         RP-090128         0303         1         Corrections to Msg3 definition and usage         8.4.0         8.5.0           RP-43         RP-090128         0303         1         Clarification on RETX_BSR_TIMER         8.4.0         8.5.0           RP-43         RP-090128         0304         1         Clarification on Red					1			
RP-43						UE behaviour at CURRENT TX NB reaches maximum value		
RP-43					-			
RP-43         RP-090128 0290         1         Dedicated preamble handling after random access failure         8.4.0         8.5.0           RP-43         RP-090128 0292         NDI and grant in Message 2         8.4.0         8.5.0           RP-43         RP-090128 0293         1         Correction relating to BCCH HARQ         8.4.0         8.5.0           RP-43         RP-090128 0300         1         Corrections to Msg3 definition and usage         8.4.0         8.5.0           RP-43         RP-090128 0303         -         PRACH selection must use prach-ConfigurationIndex         8.4.0         8.5.0           RP-43         RP-090128 0305         -         Clarification on RETX_BSR_TIMER         8.4.0         8.5.0           RP-43         RP-090128 0307         3         MAC Structure in UE Side         8.4.0         8.5.0           RP-43         RP-090128 0308         -         Clarification on Random Access Procedure         8.4.0         8.5.0           RP-43         RP-090128 0314         -         Clarification on the CR timer         8.4.0         8.5.0           RP-43         RP-090128 0316         -         Correction on BSR         8.4.0         8.5.0           RP-43         RP-090128 0318         1         Clarification on MAC reconfiguration of timers and coun		DD 10			-	100		
RP-43         RP-090128 0292         NDI and grant in Message 2         8.4.0         8.5.0           RP-43         RP-090128 0303         1         Correction relating to BCCH HARQ         8.4.0         8.5.0           RP-43         RP-090128 0303         1         Corrections to Msg3 definition and usage         8.4.0         8.5.0           RP-43         RP-090128 0303         1         Corrections to Msg3 definition and usage         8.4.0         8.5.0           RP-43         RP-090128 0305         -         Clarification on RETX_BSR_TIMER         8.4.0         8.5.0           RP-43         RP-090128 0307         3         MAC Structure in UE Side         8.4.0         8.5.0           RP-43         RP-090128 0308 -         Clarification on Random Access Procedure         8.4.0         8.5.0           RP-43         RP-090128 0314 -         Clarification on the CR timer         8.4.0         8.5.0           RP-43         RP-090128 0316 -         Correction on BSR         8.4.0         8.5.0           RP-43         RP-090128 0318 1         Clarification on MAC reconfiguration of timers and counters         8.4.0         8.5.0           RP-43         RP-090128 0331 1         Clarification on the CR timer         8.4.0         8.5.0           RP-43         RP-090128								
RP-43         RP-090128         0293         1         Correction relating to BCCH HARQ         8.4.0         8.5.0           RP-43         RP-090128         0300         1         Corrections to Msg3 definition and usage         8.4.0         8.5.0           RP-43         RP-090128         0303         -         PRACH selection must use prach-ConfigurationIndex         8.4.0         8.5.0           RP-43         RP-090128         0305         -         Clarification on RETX_BSR_TIMER         8.4.0         8.5.0           RP-43         RP-090128         0307         3         MAC Structure in UE Side         8.4.0         8.5.0           RP-43         RP-090128         0308         -         Clarification on Random Access Procedure         8.4.0         8.5.0           RP-43         RP-090128         0316         -         Clarification on BSR         8.4.0         8.5.0           RP-43         RP-090128         0316         -         Correction on BSR         8.4.0         8.5.0           RP-43         RP-090128         0318         1         Clarification on MAC reconfiguration of timers and counters         8.4.0         8.5.0           RP-43         RP-090128         0320         -         HARQ feedback, CQI/PMI/RI and SRS transmissions and me								
RP-43         RP-090128         0300         1         Corrections to Msg3 definition and usage         8.4.0         8.5.0           RP-43         RP-090128         0303         -         PRACH selection must use prach-ConfigurationIndex         8.4.0         8.5.0           RP-43         RP-090128         0305         -         Clarification on RETX_BSR_TIMER         8.4.0         8.5.0           RP-43         RP-090128         0307         3         MAC Structure in UE Side         8.4.0         8.5.0           RP-43         RP-090128         0308         -         Clarification on Random Access Procedure         8.4.0         8.5.0           RP-43         RP-090128         0314         -         Clarification on the CR timer         8.4.0         8.5.0           RP-43         RP-090128         0316         -         Correction on BSR         8.4.0         8.5.0           RP-43         RP-090128         0318         1         Clarification on MAC reconfiguration of timers and counters         8.4.0         8.5.0           RP-43         RP-090128         0320         -         MAC PDU subheader corresponding to padding         8.4.0         8.5.0           RP-43         RP-090128         0334         3         TTI Bundling Operation								
RP-43         RP-090128         0303         -         PRACH selection must use prach-ConfigurationIndex         8.4.0         8.5.0           RP-43         RP-090128         0305         -         Clarification on RETX_BSR_TIMER         8.4.0         8.5.0           RP-43         RP-090128         0307         3         MAC Structure in UE Side         8.4.0         8.5.0           RP-43         RP-090128         0308         -         Clarification on Random Access Procedure         8.4.0         8.5.0           RP-43         RP-090128         0314         -         Clarification on the CR timer         8.4.0         8.5.0           RP-43         RP-090128         0316         -         Correction on BSR         8.4.0         8.5.0           RP-43         RP-090128         0318         1         Clarification on MAC reconfiguration of timers and counters         8.4.0         8.5.0           RP-43         RP-090128         0320         -         HARQ feedback, CQI/PMI/RI and SRS transmissions and measurement gaps         8.4.0         8.5.0           RP-43         RP-090128         0334         -         CR On Backoff table         8.4.0         8.5.0           RP-43         RP-090128         0334         3         TTI Bundling Operation								
RP-43         RP-090128 0305 -         Clarification on RETX_BSR_TIMER         8.4.0 8.5.0           RP-43         RP-090128 0307 3 MAC Structure in UE Side         8.4.0 8.5.0           RP-43         RP-090128 0308 -         Clarification on Random Access Procedure         8.4.0 8.5.0           RP-43         RP-090128 0314 -         Clarification on the CR timer         8.4.0 8.5.0           RP-43         RP-090128 0316 -         Correction on BSR         8.4.0 8.5.0           RP-43         RP-090128 0318 1 Clarification on MAC reconfiguration of timers and counters         8.4.0 8.5.0           RP-43         RP-090128 0320 -         HARQ feedback, CQI/PMI/RI and SRS transmissions and measurement gaps         8.4.0 8.5.0           RP-43         RP-090128 0332 -         MAC PDU subheader corresponding to padding         8.4.0 8.5.0           RP-43         RP-090128 0333 -         CR On Backoff table         8.4.0 8.5.0           RP-43         RP-090128 0334 3 TTI Bundling Operation         8.4.0 8.5.0           RP-43         RP-090128 0341 1 Enforcing new transmission after flushing HARQ process         8.4.0 8.5.0           RP-44         RP-090513 0342 -         Correction on HARQ feedback transmission         8.5.0 8.6.0           RP-44         RP-090513 0342 -         Correction on HARQ feedback transmission         8.5.0 8.6.0           RP-44 </td <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>								
RP-43         RP-090128         0307         3         MAC Structure in UE Side         8.4.0         8.5.0           RP-43         RP-090128         0308         -         Clarification on Random Access Procedure         8.4.0         8.5.0           RP-43         RP-090128         0314         -         Clarification on the CR timer         8.4.0         8.5.0           RP-43         RP-090128         0316         -         Correction on BSR         8.4.0         8.5.0           RP-43         RP-090128         0318         1         Clarification on MAC reconfiguration of timers and counters         8.4.0         8.5.0           RP-43         RP-090128         0320         -         HARQ feedback, CQI/PMI/RI and SRS transmissions and measurement gaps         8.4.0         8.5.0           RP-43         RP-090128         0324         -         MAC PDU subheader corresponding to padding         8.4.0         8.5.0           RP-43         RP-090128         0333         -         CR On Backoff table         8.4.0         8.5.0           RP-43         RP-090128         0334         3         TTI Bundling Operation         8.4.0         8.5.0           RP-43         RP-090128         0341         1         Enforcing new transmission after flushing HARQ								
RP-43								
RP-43         RP-090128 0314 -         Clarification on the CR timer         8.4.0 8.5.0           RP-43         RP-090128 0316 -         Correction on BSR         8.4.0 8.5.0           RP-43         RP-090128 0318 1 Clarification on MAC reconfiguration of timers and counters         8.4.0 8.5.0           RP-43         RP-090128 0320 - HARQ feedback, CQI/PMI/RI and SRS transmissions and measurement gaps         8.4.0 8.5.0           RP-43         RP-090128 0324 - MAC PDU subheader corresponding to padding         8.4.0 8.5.0           RP-43         RP-090128 0333 - CR On Backoff table         8.4.0 8.5.0           RP-43         RP-090128 0334 3 TTI Bundling Operation         8.4.0 8.5.0           RP-43         RP-090128 0341 1 Enforcing new transmission after flushing HARQ process         8.4.0 8.5.0           2009-06         RP-44         RP-090513 0342 - Correction on HARQ feedback transmission         8.5.0 8.6.0           RP-44         RP-090513 0343 1 Clarification on the DL assignment/UL grant reception in SPS         8.5.0 8.6.0           RP-44         RP-090513 0344 1 PHR timer handling after handover         8.5.0 8.6.0           RP-44         RP-090513 0344 2 MAC PDU for Msg2         8.5.0 8.6.0           RP-44         RP-090513 0346 2 MAC PDU for Msg2         8.5.0 8.6.0           RP-44         RP-090513 0348 - Correction on SR cancellation         8.5.0 8.6.0 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>								
RP-43         RP-090128   0316   -         Correction on BSR         8.4.0   8.5.0           RP-43         RP-090128   0318   1         Clarification on MAC reconfiguration of timers and counters         8.4.0   8.5.0           RP-43         RP-090128   0320   -         HARQ feedback, CQI/PMI/RI and SRS transmissions and measurement gaps         8.4.0   8.5.0           RP-43         RP-090128   0324   -         MAC PDU subheader corresponding to padding         8.4.0   8.5.0           RP-43         RP-090128   0333   -         CR On Backoff table         8.4.0   8.5.0           RP-43         RP-090128   0334   3         TTI Bundling Operation         8.4.0   8.5.0           RP-43         RP-090128   0341   1         Enforcing new transmission after flushing HARQ process         8.4.0   8.5.0           RP-43         RP-090513   0342   -         Correction on HARQ feedback transmission         8.5.0   8.6.0           RP-44         RP-090513   0343   1         Clarification on the DL assignment/UL grant reception in SPS         8.5.0   8.6.0           RP-44         RP-090513   0344   1         PHR timer handling after handover         8.5.0   8.6.0           RP-44         RP-090513   0346   2         MAC PDU for Msg2         8.5.0   8.6.0           RP-44         RP-090513   0348   -         Correction to RETX_BSR_TIMER         8.5.0   8.6.0           RP-44								
RP-43         RP-090128 0318 1         Clarification on MAC reconfiguration of timers and counters         8.4.0 8.5.0           RP-43         RP-090128 0320 -         HARQ feedback, CQI/PMI/RI and SRS transmissions and measurement gaps         8.4.0 8.5.0           RP-43         RP-090128 0324 -         MAC PDU subheader corresponding to padding         8.4.0 8.5.0           RP-43         RP-090128 0333 -         CR On Backoff table         8.4.0 8.5.0           RP-43         RP-090128 0334 3         TTI Bundling Operation         8.4.0 8.5.0           RP-43         RP-090128 0341 1         Enforcing new transmission after flushing HARQ process         8.4.0 8.5.0           RP-43         RP-090513 0342 -         Correction on HARQ feedback transmission         8.5.0 8.6.0           RP-44         RP-090513 0343 1         Clarification on the DL assignment/UL grant reception in SPS         8.5.0 8.6.0           RP-44         RP-090513 0344 1         PHR timer handling after handover         8.5.0 8.6.0           RP-44         RP-090513 0346 2         MAC PDU for Msg2         8.5.0 8.6.0           RP-44         RP-090513 0347 2         MAC Error handling         8.5.0 8.6.0           RP-44         RP-090513 0348 -         Correction to RETX_BSR_TIMER         8.5.0 8.6.0           RP-44         RP-090513 0349 1         Correction to RETX_BSR_TIMER <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>								
RP-43         RP-090128         0320         -         HARQ feedback, CQI/PMI/RI and SRS transmissions and measurement gaps         8.4.0         8.5.0           RP-43         RP-090128         0324         -         MAC PDU subheader corresponding to padding         8.4.0         8.5.0           RP-43         RP-090128         0333         -         CR On Backoff table         8.4.0         8.5.0           RP-43         RP-090128         0334         3         TTI Bundling Operation         8.4.0         8.5.0           RP-43         RP-090128         0341         1         Enforcing new transmission after flushing HARQ process         8.4.0         8.5.0           2009-06         RP-44         RP-090513         0342         -         Correction on HARQ feedback transmission         8.5.0         8.6.0           RP-44         RP-090513         0343         1         Clarification on the DL assignment/UL grant reception in SPS         8.5.0         8.6.0           RP-44         RP-090513         0344         1         PHR timer handling after handover         8.5.0         8.6.0           RP-44         RP-090513         0346         2         MAC PDU for Msg2         8.5.0         8.6.0           RP-44         RP-090513         0348         -								
RP-43         RP-090128 0324 - MAC PDU subheader corresponding to padding         8.4.0         8.5.0           RP-43         RP-090128 0333 - CR On Backoff table         8.4.0         8.5.0           RP-43         RP-090128 0334 3 TTI Bundling Operation         8.4.0         8.5.0           RP-43         RP-090128 0341 1 Enforcing new transmission after flushing HARQ process         8.4.0         8.5.0           2009-06         RP-44 RP-090513 0342 - Correction on HARQ feedback transmission         8.5.0         8.6.0           RP-44         RP-090513 0343 1 Clarification on the DL assignment/UL grant reception in SPS         8.5.0         8.6.0           RP-44 RP-090513 0344 1 PHR timer handling after handover         8.5.0         8.6.0           RP-44 RP-090513 0346 2 MAC PDU for Msg2         8.5.0         8.6.0           RP-44 RP-090513 0347 2 MAC Error handling         8.5.0         8.6.0           RP-44 RP-090513 0348 - Correction on SR cancellation         8.5.0         8.6.0           RP-44 RP-090513 0349 1 Correction to RETX_BSR_TIMER         8.5.0         8.6.0           RP-44 RP-090513 0350 1 CR to 36.321 on UL SPS Implicit Release         8.5.0         8.6.0						HARQ feedback, CQI/PMI/RI and SRS transmissions and		
RP-43         RP-090128 0324 -         MAC PDU subheader corresponding to padding         8.4.0 8.5.0           RP-43         RP-090128 0333 -         CR On Backoff table         8.4.0 8.5.0           RP-43         RP-090128 0334 3         TTI Bundling Operation         8.4.0 8.5.0           RP-43         RP-090128 0341 1         Enforcing new transmission after flushing HARQ process         8.4.0 8.5.0           2009-06         RP-44         RP-090513 0342 -         Correction on HARQ feedback transmission         8.5.0 8.6.0           RP-44         RP-090513 0343 1         Clarification on the DL assignment/UL grant reception in SPS         8.5.0 8.6.0           RP-44         RP-090513 0344 1         PHR timer handling after handover         8.5.0 8.6.0           RP-44         RP-090513 0346 2         MAC PDU for Msg2         8.5.0 8.6.0           RP-44         RP-090513 0347 2         MAC Error handling         8.5.0 8.6.0           RP-44         RP-090513 0348 -         Correction on SR cancellation         8.5.0 8.6.0           RP-44         RP-090513 0349 1         Correction to RETX_BSR_TIMER         8.5.0 8.6.0           RP-44         RP-090513 0350 1         CR to 36.321 on UL SPS Implicit Release         8.5.0 8.6.0		/0	555120	0020			0. 7.0	3.3.0
RP-43         RP-090128 0333   CR On Backoff table         8.4.0 8.5.0           RP-43         RP-090128 0334 3   TTI Bundling Operation         8.4.0 8.5.0           RP-43         RP-090128 0341 1   Enforcing new transmission after flushing HARQ process         8.4.0 8.5.0           2009-06         RP-44   RP-090513 0342   Correction on HARQ feedback transmission         8.5.0 8.6.0           RP-44   RP-090513 0343 1   Clarification on the DL assignment/UL grant reception in SPS         8.5.0 8.6.0           RP-44   RP-090513 0344 1   PHR timer handling after handover         8.5.0 8.6.0           RP-44   RP-090513 0346 2   MAC PDU for Msg2         8.5.0 8.6.0           RP-44   RP-090513 0347 2   MAC Error handling         8.5.0 8.6.0           RP-44   RP-090513 0348 - Correction on SR cancellation         8.5.0 8.6.0           RP-44   RP-090513 0349 1   Correction to RETX_BSR_TIMER         8.5.0 8.6.0           RP-44   RP-090513 0350 1   CR to 36.321 on UL SPS Implicit Release         8.5.0 8.6.0		RP-43	RP-090128	0324	-		8.4.0	8.5.0
RP-43         RP-090128         0334         3         TTI Bundling Operation         8.4.0         8.5.0           RP-43         RP-090128         0341         1         Enforcing new transmission after flushing HARQ process         8.4.0         8.5.0           2009-06         RP-44         RP-090513         0342         -         Correction on HARQ feedback transmission         8.5.0         8.6.0           RP-44         RP-090513         0343         1         Clarification on the DL assignment/UL grant reception in SPS         8.5.0         8.6.0           RP-44         RP-090513         0344         1         PHR timer handling after handover         8.5.0         8.6.0           RP-44         RP-090513         0346         2         MAC PDU for Msg2         8.5.0         8.6.0           RP-44         RP-090513         0347         2         MAC Error handling         8.5.0         8.6.0           RP-44         RP-090513         0348         -         Correction on SR cancellation         8.5.0         8.6.0           RP-44         RP-090513         0349         1         Correction to RETX_BSR_TIMER         8.5.0         8.6.0           RP-44         RP-090513         0350         1         CR to 36.321 on UL SPS Implicit Release </td <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>								
RP-43         RP-090128 0341         1         Enforcing new transmission after flushing HARQ process         8.4.0         8.5.0           2009-06         RP-44         RP-090513 0342         -         Correction on HARQ feedback transmission         8.5.0         8.6.0           RP-44         RP-090513 0343         1         Clarification on the DL assignment/UL grant reception in SPS         8.5.0         8.6.0           RP-44         RP-090513 0344         1         PHR timer handling after handover         8.5.0         8.6.0           RP-44         RP-090513 0346         2         MAC PDU for Msg2         8.5.0         8.6.0           RP-44         RP-090513 0347         2         MAC Error handling         8.5.0         8.6.0           RP-44         RP-090513 0348         -         Correction on SR cancellation         8.5.0         8.6.0           RP-44         RP-090513 0349         1         Correction to RETX_BSR_TIMER         8.5.0         8.6.0           RP-44         RP-090513 0350         1         CR to 36.321 on UL SPS Implicit Release         8.5.0         8.6.0								
2009-06         RP-44         RP-090513         0342         -         Correction on HARQ feedback transmission         8.5.0         8.6.0           RP-44         RP-090513         0343         1         Clarification on the DL assignment/UL grant reception in SPS         8.5.0         8.6.0           RP-44         RP-090513         0344         1         PHR timer handling after handover         8.5.0         8.6.0           RP-44         RP-090513         0346         2         MAC PDU for Msg2         8.5.0         8.6.0           RP-44         RP-090513         0347         2         MAC Error handling         8.5.0         8.6.0           RP-44         RP-090513         0348         -         Correction on SR cancellation         8.5.0         8.6.0           RP-44         RP-090513         0349         1         Correction to RETX_BSR_TIMER         8.5.0         8.6.0           RP-44         RP-090513         0350         1         CR to 36.321 on UL SPS Implicit Release         8.5.0         8.6.0								
RP-44       RP-090513       0343       1       Clarification on the DL assignment/UL grant reception in SPS       8.5.0       8.6.0         RP-44       RP-090513       0344       1       PHR timer handling after handover       8.5.0       8.6.0         RP-44       RP-090513       0346       2       MAC PDU for Msg2       8.5.0       8.6.0         RP-44       RP-090513       0347       2       MAC Error handling       8.5.0       8.6.0         RP-44       RP-090513       0348       -       Correction on SR cancellation       8.5.0       8.6.0         RP-44       RP-090513       0349       1       Correction to RETX_BSR_TIMER       8.5.0       8.6.0         RP-44       RP-090513       0350       1       CR to 36.321 on UL SPS Implicit Release       8.5.0       8.6.0	2009-06							
RP-44       RP-090513       0344       1       PHR timer handling after handover       8.5.0       8.6.0         RP-44       RP-090513       0346       2       MAC PDU for Msg2       8.5.0       8.6.0         RP-44       RP-090513       0347       2       MAC Error handling       8.5.0       8.6.0         RP-44       RP-090513       0348       -       Correction on SR cancellation       8.5.0       8.6.0         RP-44       RP-090513       0349       1       Correction to RETX_BSR_TIMER       8.5.0       8.6.0         RP-44       RP-090513       0350       1       CR to 36.321 on UL SPS Implicit Release       8.5.0       8.6.0								
RP-44       RP-090513       0346       2       MAC PDU for Msg2       8.5.0       8.6.0         RP-44       RP-090513       0347       2       MAC Error handling       8.5.0       8.6.0         RP-44       RP-090513       0348       -       Correction on SR cancellation       8.5.0       8.6.0         RP-44       RP-090513       0349       1       Correction to RETX_BSR_TIMER       8.5.0       8.6.0         RP-44       RP-090513       0350       1       CR to 36.321 on UL SPS Implicit Release       8.5.0       8.6.0								
RP-44         RP-090513         0347         2         MAC Error handling         8.5.0         8.6.0           RP-44         RP-090513         0348         -         Correction on SR cancellation         8.5.0         8.6.0           RP-44         RP-090513         0349         1         Correction to RETX_BSR_TIMER         8.5.0         8.6.0           RP-44         RP-090513         0350         1         CR to 36.321 on UL SPS Implicit Release         8.5.0         8.6.0								
RP-44         RP-090513         0348         -         Correction on SR cancellation         8.5.0         8.6.0           RP-44         RP-090513         0349         1         Correction to RETX_BSR_TIMER         8.5.0         8.6.0           RP-44         RP-090513         0350         1         CR to 36.321 on UL SPS Implicit Release         8.5.0         8.6.0								
RP-44         RP-090513         0349         1         Correction to RETX_BSR_TIMER         8.5.0         8.6.0           RP-44         RP-090513         0350         1         CR to 36.321 on UL SPS Implicit Release         8.5.0         8.6.0								
RP-44 RP-090513 0350 1 CR to 36.321 on UL SPS Implicit Release 8.5.0 8.6.0								
μινί ττι μινι ουουπομούτημε η ναιιούο συπτουίτου (νίπο μένα 10.5.0 μένα). Ιάδου		RP-44				Various correction to MAC	8.5.0	8.6.0

	DD 44	IDD 000540	0000		IO CONT	0.50	0.00
	RP-44	RP-090513			Correction to Uplink grant by temporary C-RNTI	8.5.0	8.6.0
	RP-44	RP-090513			Clarification on simultaneous reception of RA-RNTI and C-RNTI	8.5.0	8.6.0
	RP-44	RP-090513			Correction on timeAlignmentTimer validity in MAC	8.5.0	8.6.0
	RP-44	RP-090513		1	CR for MAC padding	8.5.0	8.6.0
	RP-44	RP-090513		-	Correction to duplicate reception of TA command (2nd method)	8.5.0	8.6.0
2009-09	RP-45	RP-090906		-	Correction to NDI semantics	8.6.0	8.7.0
	RP-45	RP-090906			Minor corrections to 36.321	8.6.0	8.7.0
	RP-45	RP-090906	0381	2	UE behaviour when MBSFN subframe and a configured downlink	8.6.0	8.7.0
					assignment collide		
	RP-45	RP-090906		-	Correction to HARQ process ID for DL SPS retransmissions	8.6.0	8.7.0
2009-09	RP-45	RP-090934			Improvement of cancellation of SR	8.7.0	9.0.0
	RP-45	RP-090934			Periodic CQI/PMI/RI masking	8.7.0	9.0.0
2009-12	RP-46	RP-091341			Capturing MBMS agreements in MAC	9.0.0	9.1.0
	RP-46	RP-091314		2	Clarification on BSR trigger	9.0.0	9.1.0
	RP-46	RP-091346	0404	-	Correction on HARQ Process ID for DL SPS and DRX	9.0.0	9.1.0
	RP-46	RP-091314	0406	-	RNTI for CCCH	9.0.0	9.1.0
	RP-46	RP-091346	0407	1	SR prohibit mechanism for UL SPS	9.0.0	9.1.0
	RP-46	RP-091346	0409	-	Clarification on monitoring of PDCCH	9.0.0	9.1.0
	RP-46	RP-091346	0410	-	Introduction of SR prohibit timer	9.0.0	9.1.0
2010-03	RP-47	RP-100305	0414	-	Correction to MBMS scheduling terminology	9.1.0	9.2.0
	RP-47	RP-100305	0415	-	Corrections to TS 36.321 on MBMS	9.1.0	9.2.0
	RP-47	RP-100305		1	Error handling for MBMS PDU	9.1.0	9.2.0
	RP-47	RP-100308		-	Renaming CR as consequence of ASN.1 review	9.1.0	9.2.0
2010-06	RP-48	RP-100536		-	Clarification on UE behaviour w.r.t DRX cycle change and	9.2.0	9.3.0
			'		onDurationTimer test (Procedural change)		
	RP-48	RP-100554	0425	1	Correction to MBMS description	9.2.0	9.3.0
	RP-48	RP-100556		-	Correction to PHR triggering	9.2.0	9.3.0
	RP-48	RP-100536		_	Processing of contention resolution message	9.2.0	9.3.0
2010-12	RP-50	RP-101226		2	Introduction of Carrier Aggregation	9.3.0	10.0.0
2010 12	RP-50	RP-101228			Introduction of relays in MAC	9.3.0	10.0.0
-	RP-50	RP-101225		_	HARQ operation for UL multiple antenna transmission	9.3.0	10.0.0
2011-03	RP-51	RP-110280			PHR Trigger for Power Reduction Due to Power Management		10.1.0
2011-03	RP-51	RP-110289		1	Power Headroom Reporting		10.1.0
-	RP-51	RP-110289		<u> </u>	Cancellation of BSR		10.1.0
-	RP-51	RP-110289		-			10.1.0
	KP-51	RP-110269	0453		Counterproposal to Corrections to the Carrier Aggregation functionality in MAC	10.0.0	10.1.0
	RP-51	RP-110280	0454		Adding a Power Management indication in PHR	10.00	10.1.0
-	RP-51			-			
-		RP-110289			CR on SCell Activation Unification of Extended PHR MAC CE formats		10.1.0
-	RP-51	RP-110289					
2044.00	RP-51	RP-110289 RP-110846		1	Clarification for CA and TTI bundling in MAC		10.1.0
2011-06	RP-52			-	CQI reporting and deactivation timer		
	RP-52	RP-110846			Miscellaneous Corrections		10.2.0
	RP-52	RP-110846		-	Pcmax,c reporting for type 2 PH		10.2.0
	RP-52	RP-110848		-	Type-1-triggered SRS transmission independent of DRX		10.2.0
	RP-52	RP-110839			UL transmissions when the timeAlignmentTimer is not running		10.2.0
ļ	RP-52	RP-110846		1	Clarifications to Ci field in MAC CE on CA		10.2.0
	RP-52	RP-110846		-	Clarification of padding BSR behaviour		10.2.0
	RP-52	RP-110834		-	SPS reception in MBSFN subframes		10.2.0
	RP-52	RP-110839		-	Power management related PHR triggering condition		10.2.0
	RP-52	RP-110839		-	Clarifications on PHR Power Management trigger		10.2.0
2011-09	RP-53	RP-111280		1	Clarifications on MCH reception and Stop MTCH		10.3.0
	RP-53	RP-111283		-	Configuration of extenededBSR-sizes		10.3.0
	RP-53	RP-111297		-	CR to 36.321 on Small correction of PHR parameter		10.3.0
	RP-53	RP-111283			Corrections to PCMAX,c field in Extended PHR		10.3.0
2011-12	RP-54	RP-111714		1	UE soft buffer handling in MAC		10.4.0
	RP-54	RP-111716		-	Correction on determining SPS occasions		10.4.0
	RP-54	RP-111605			CSI/SRS reporting at DRX state transitions		10.4.0
	RP-54	RP-111606			CSI/SRS reporting at unexpected Active Time stopping	10.3.0	10.4.0
2012-03	RP-55	RP-120321		<u> -</u>	Correction to multiplexing and assembly		10.5.0
2012-09	RP-57	RP-121395			P bit in Extended PHR MAC CE	10.5.0	10.6.0
	RP-57	RP-121395		1	Deadlock of PHR transmission		10.6.0
	RP-57	RP-121382	0558	-	Clarification on Measurement Gap		11.0.0
	RP-57	RP-121377		1	Introduction of CA Enhancements in MAC		11.0.0
	RP-57	RP-121382		-	Clarification of TA value maintenance at TA timer expiry		11.0.0
2012-12	RP-58	RP-121936		-	Clarification on DRX for Relay		11.1.0
	RP-58	RP-121936		-	Clarification on V field in Extended PHR MAC CE		11.1.0
	RP-58	RP-121951		1	Clarification related to CA enhancement in MAC		11.1.0
	RP-58	RP-121957		<u> </u>	Clarification of the Note in 5.2		11.1.0
	RP-58	RP-121951		l <u>-</u>	TAG Acronym		11.1.0
	RP-58	RP-121951		l <u>-</u>	Corrections for CA-enhancement in MAC		11.1.0
	RP-58	RP-121956		-	CR on MAC layer support of ePDCCH		11.1.0
L	00	121000	5555		1		

	RP-58	RP-121957	0624	2	CR to 36.321 on Annex for DRX Timers	11.0.0	11.1.0
2013-03	RP-59	RP-130248	0629	2	Removing optionality on CSI/SRS transmission during transient	11.1.0	11.2.0
					state		
	RP-59	RP-130245	0630	-	Clarification on the PDCCH-subframe for half-duplex TDD UE	11.1.0	11.2.0
	RP-59	RP-130248	0649	-	Draft CR to 36 321 for Clarification of PDCCH-subframe definition	11.1.0	11.2.0
					in Rel-11		
	RP-59	RP-130241	0659	-	Correction for TM10 unicast support in MBSFN subframes	11.1.0	11.2.0
	RP-59	RP-130291	0661	-	Clarification of DRX timers for TDD	11.1.0	11.2.0
2013-06	RP-60	RP-130805	0663	2	HARQ RTT Timer	11.2.0	11.3.0
	RP-60	RP-130808	0664	-	Clarification on the PDCCH-subframe definition for TDD UE	11.2.0	11.3.0
	RP-60	RP-130809	0665	-	Correction to the definition of drxRetransmissionTimer	11.2.0	11.3.0
	RP-60	RP-130809	0667	-	Further issues on removing optionality of CSI/SRS transmission	11.2.0	11.3.0
					during transient state		
	RP-60	RP-130804	0670	-	Rel-11 CR on SCell activation timing	11.2.0	11.3.0
2013-12	RP-62	RP-131989	0687	-	Clarification on the HARQ feedback for SCell	11.3.0	11.4.0
					activation/deactivation command MAC CE		
2014-03	RP-63	RP-140355	0706	-	BCCH reception for MBMS on any configured or configurable SCell	11.4.0	11.5.0

### History

	Document history							
V11.0.0	October 2012	Publication						
V11.1.0	February 2013	Publication						
V11.2.0	April 2013	Publication						
V11.3.0	July 2013	Publication						
V11.4.0	January 2014	Publication						
V11.5.0	March 2014	Publication						