


**Universal Mobile Telecommunications System (UMTS);  
User Equipment (UE) conformance specification;  
Part 3: Abstract test suites (ATSS)  
(3GPP TS 34.123-3 version 5.6.0 Release 5)**

---

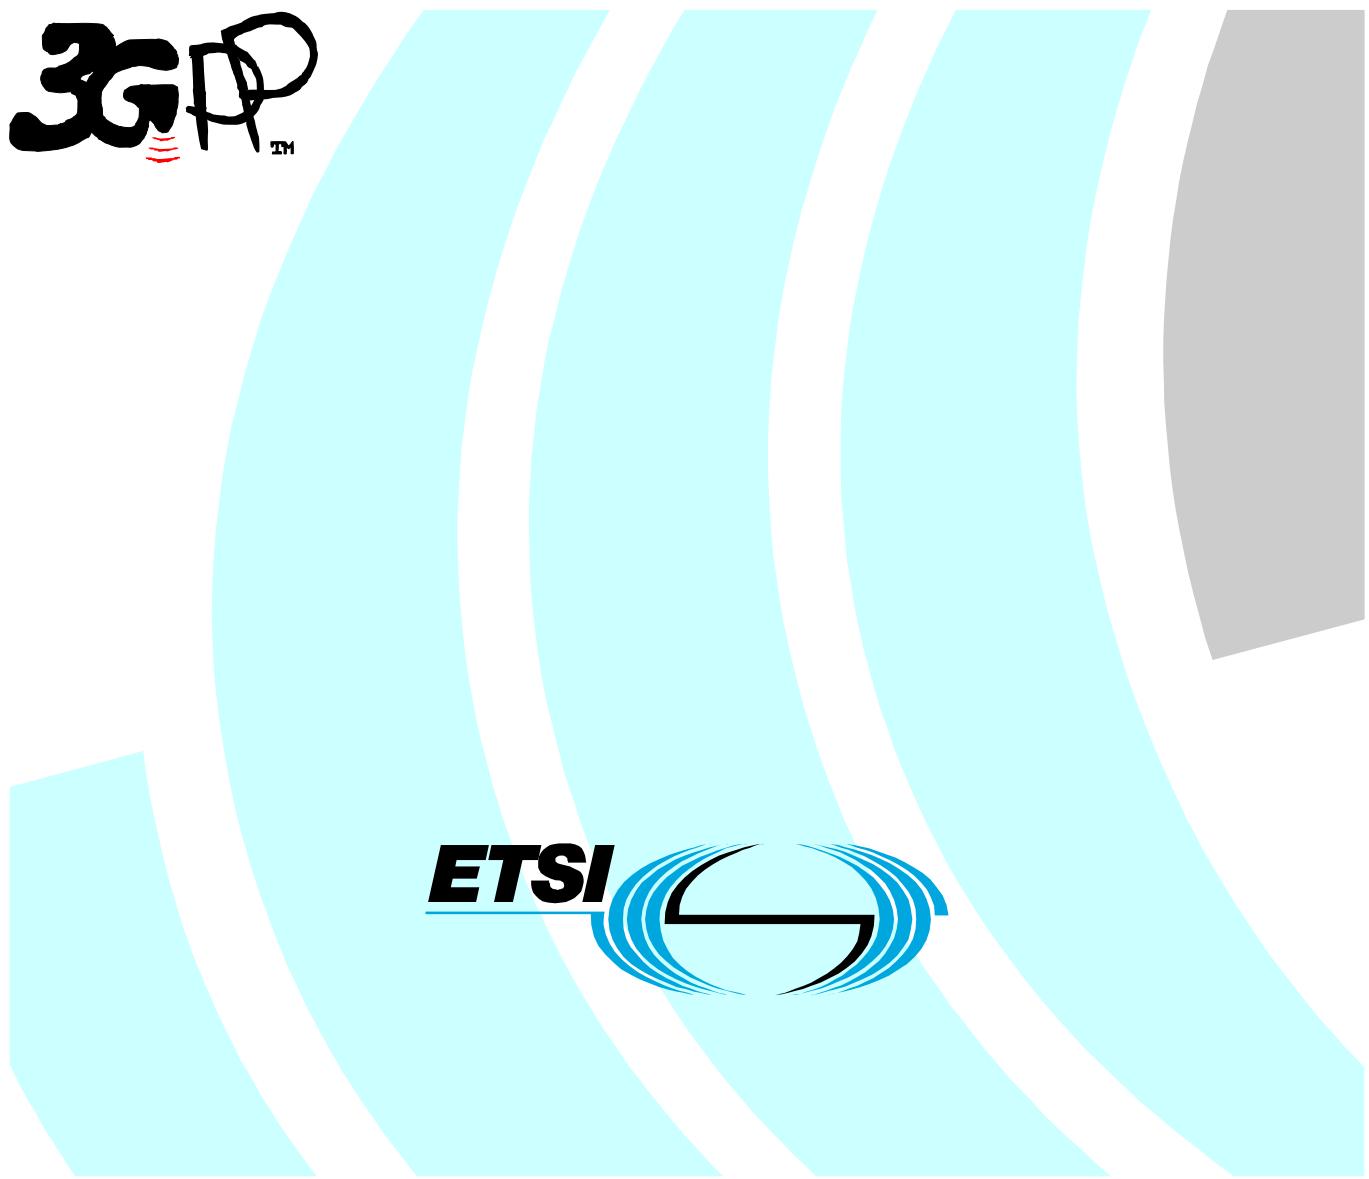

---

Reference

RTS/TSGR-0534123-3v560

---

Keywords

UMTS

***ETSI***

---

650 Route des Lucioles  
F-06921 Sophia Antipolis Cedex - FRANCE

Tel.: +33 4 92 94 42 00 Fax: +33 4 93 65 47 16

Siret N° 348 623 562 00017 - NAF 742 C  
Association à but non lucratif enregistrée à la  
Sous-Préfecture de Grasse (06) N° 7803/88

---

***Important notice***

Individual copies of the present document can be downloaded from:  
<http://www.etsi.org>

The present document may be made available in more than one electronic version or in print. In any case of existing or perceived difference in contents between such versions, the reference version is the Portable Document Format (PDF). In case of dispute, the reference shall be the printing on ETSI printers of the PDF version kept on a specific network drive within ETSI Secretariat.

Users of the present document should be aware that the document may be subject to revision or change of status.  
Information on the current status of this and other ETSI documents is available at  
<http://portal.etsi.org/tb/status/status.asp>

If you find errors in the present document, please send your comment to one of the following services:  
[http://portal.etsi.org/chaircor/ETSI\\_support.asp](http://portal.etsi.org/chaircor/ETSI_support.asp)

---

***Copyright Notification***

No part may be reproduced except as authorized by written permission.  
The copyright and the foregoing restriction extend to reproduction in all media.

© European Telecommunications Standards Institute 2006.  
All rights reserved.

**DECT™, PLUGTESTS™ and UMTS™** are Trade Marks of ETSI registered for the benefit of its Members.  
**TIPHON™** and the **TIPHON logo** are Trade Marks currently being registered by ETSI for the benefit of its Members.  
**3GPP™** is a Trade Mark of ETSI registered for the benefit of its Members and of the 3GPP Organizational Partners.

---

## Intellectual Property Rights

IPRs essential or potentially essential to the present document may have been declared to ETSI. The information pertaining to these essential IPRs, if any, is publicly available for **ETSI members and non-members**, and can be found in ETSI SR 000 314: *"Intellectual Property Rights (IPRs); Essential, or potentially Essential, IPRs notified to ETSI in respect of ETSI standards"*, which is available from the ETSI Secretariat. Latest updates are available on the ETSI Web server (<http://webapp.etsi.org/IPR/home.asp>).

Pursuant to the ETSI IPR Policy, no investigation, including IPR searches, has been carried out by ETSI. No guarantee can be given as to the existence of other IPRs not referenced in ETSI SR 000 314 (or the updates on the ETSI Web server) which are, or may be, or may become, essential to the present document.

---

## Foreword

This Technical Specification (TS) has been produced by ETSI 3rd Generation Partnership Project (3GPP).

The present document may refer to technical specifications or reports using their 3GPP identities, UMTS identities or GSM identities. These should be interpreted as being references to the corresponding ETSI deliverables.

The cross reference between GSM, UMTS, 3GPP and ETSI identities can be found under  
<http://webapp.etsi.org/key/queryform.asp>.

---

## Contents

|   |          |
|---|----------|
| Intellectual Property Rights .....                      | 2        |
| Foreword.....   | 2        |
| Foreword.....   | 4        |
| Introduction .....                                      | 4        |
| 1    Scope .....  | 5        |
| 2    References .....                                   | 5        |
| 3    Definitions and abbreviations.....                 | 6        |
| 4    Requirements on the TTCN development.....          | 6        |
| <b>Annex A (informative):      Change history .....</b> | <b>7</b> |
| History .....   | 34       |

---

## Foreword

This Technical Specification has been produced by the 3<sup>rd</sup> Generation Partnership Project (3GPP).

The contents of the present document are subject to continuing work within the TSG and may change following formal TSG approval. Should the TSG modify the contents of the present document, it will be re-released by the TSG with an identifying change of release date and an increase in version number as follows:

Version x.y.z

where:

- x the first digit:
  - 1 presented to TSG for information;
  - 2 presented to TSG for approval;
  - 3 or greater indicates TSG approved document under change control.
- y the second digit is incremented for all changes of substance, i.e. technical enhancements, corrections, updates, etc.
- z the third digit is incremented when editorial only changes have been incorporated in the document.

---

## Introduction

The present document is part 3 of a multi-part conformance test specification for UE. The specification contains a TTCN2 design frame work and the detailed test specifications in TTCN for UE at the Uu interface.

3GPP TS 34.123-1 [1]: "User Equipment (UE) conformance specification; Part 1: Protocol conformance specification".

3GPP TS 34.123-2 [2]: "User Equipment (UE) conformance specification; Part 2: Implementation Conformance Statement (ICS) proforma specification".

**3GPP TS 34.123-3: "Abstract Test Suite (ATS)". (the current document)**

---

## 1 Scope

The present document specifies the protocol conformance testing in TTCN for the 3GPP User Equipment (UE) at the Uu interface.

The present document is the 3<sup>rd</sup> part of a multi-part test specification, 3GPP TS 34.123. The following TTCN test specification and design considerations can be found in the present document:

- the overall test suite structure;
- the testing architecture;
- the test methods and PCO definitions;
- the test configurations;
- the design principles, assumptions, and used interfaces to the TTCN tester (System Simulator);
- TTCN styles and conventions;
- the partial PIXIT proforma;
- the TTCN.MP and TTCN.GR forms for the mentioned protocols tests.

The Abstract Test Suites designed in the document are based on the test cases specified in prose (3GPP TS 34.123-1 [1]).

The present document is valid for UE implemented according to 3GPP Release 1999, 3GPP Release 4 or 3GPP Release 5.

---

## 2 References

The following documents contain provisions, which, through reference in this text, constitute provisions of the present document.

- References are either specific (identified by date of publication, edition number, version number, etc.) or non-specific.
- For a specific reference, subsequent revisions do not apply.
- For a non-specific reference, the latest version applies. In the case of a reference to a 3GPP document (including a GSM document), a non-specific reference implicitly refers to the latest version of that document *in the same Release as the present document*.
  - For a Release 1999 UE, references to 3GPP documents are to version 3.x.y, when available.
  - For a Release 4 UE, references to 3GPP documents are to version 4.x.y, when available.
  - For a Release 5 UE, references to 3GPP documents are to version 5.x.y, when available.
  - For a Release 6 UE, references to 3GPP documents are to version 6.x.y, when available.

[1] 3GPP TS 34.123-1: "User Equipment (UE) conformance specification; Part 1: Protocol conformance specification".

[2] 3GPP TS 34.123-2: "User Equipment (UE) conformance specification; Part 2: Implementation Conformance Statement (ICS) proforma specification".

[3] 3GPP TS 34.123-3 (Release 6): "User Equipment (UE) conformance specification; Part 3: Abstract Test Suite (ATS)".

---

## 3 Definitions and abbreviations

(void)

---

## 4 Requirements on the TTCN development

The requirements of the present document are provided in 3GPP TS 34.123-3 Release 6 [**Error! Reference source not found.**].

## Annex A (informative): Change history

| Meet-ing | TSG doc   | CR  | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|-----|-----|--|-----|----------|----------|-----------|
| TP-18    | TP-020301 |     |     | Approval of the specification  |     | 2.0.0    | 3.0.0    |           |
| TP-19    | TP-030051 | 001 | -   | Change to test case 9.2.3 required for approval  | F   | 3.0.0    | 3.1.0    | T1-030120 |
| TP-19    | TP-030051 | 002 | -   | Change to test case 9.2.4 required for approval  | F   | 3.0.0    | 3.1.0    | T1-030121 |
| TP-19    | TP-030051 | 003 | -   | Change to test case 10.1.3.4.1 required for approval   | F   | 3.0.0    | 3.1.0    | T1-030122 |
| TP-19    | TP-030051 | 004 | -   | Inclusion of RLC test case 7.2.2.3 to RLC ATS V3.0.0   | F   | 3.0.0    | 3.1.0    | T1-030123 |
| TP-19    | TP-030051 | 005 | -   | Inclusion of RLC test case 7.2.2.4 to RLC ATS V3.0.0   | F   | 3.0.0    | 3.1.0    | T1-030124 |
| TP-19    | TP-030051 | 006 | -   | Inclusion of RLC test case 7.2.2.7 to RLC ATS V3.0.0   | F   | 3.0.0    | 3.1.0    | T1-030125 |
| TP-19    | TP-030051 | 007 | -   | Inclusion of RLC test case 7.2.3.4 to RLC ATS V3.0.0   | F   | 3.0.0    | 3.1.0    | T1-030126 |
| TP-19    | TP-030051 | 008 | -   | Inclusion of RLC test case 7.2.3.5 to RLC ATS V3.0.0   | F   | 3.0.0    | 3.1.0    | T1-030127 |
| TP-19    | TP-030051 | 009 | -   | Changes to TS34.123-3 V200 to introduce TC_8_1_1_4   | F   | 3.0.0    | 3.1.0    | T1-030128 |
| TP-19    | TP-030051 | 010 | -   | TTCN changes to the approved test cases in V300  | F   | 3.0.0    | 3.1.0    | T1-030129 |
| TP-19    | TP-030051 | 011 | 1   | CR 34.123-3, V300 as T1S030009rev1   | F   | 3.0.0    | 3.1.0    | T1-030260 |
| TP-19    | TP-030051 | 012 | -   | Introducing Test Case 8.1.2.7  | F   | 3.0.0    | 3.1.0    | T1-030245 |
| TP-19    | TP-030051 | 013 | -   | Introduction of Test Case 8.2.1.1  | F   | 3.0.0    | 3.1.0    | T1-030246 |
| TP-19    | TP-030051 | 014 | -   | Introduction of Test Case 8.2.3.1  | F   | 3.0.0    | 3.1.0    | T1-030247 |
| TP-19    | TP-030051 | 015 | -   | Addition of RRC test case 8.1.9 to RRC ATS V3.0.0<br>NOTE: There was a missing TTCN fix in TP-030051. In the TTCN line 6 of TC_8_1_2_1, replace +ts_SendDefSysInfo( tsc_CellA) with +ts_SendSysInfoWithSpecialSIB11( tsc_CellA, tcv_SIB11IntraFreqRepQuantiRACH). Otherwise, a good UE would be failed at the regression test. | F   | 3.0.0    | 3.1.0    | T1-030248 |
| TP-20    | TP-030104 | 016 | -   | Test Case 7.1.1.2  | F   | 3.1.0    | 3.2.0    | T1-030397 |
| TP-20    | TP-030104 | 017 | -   | Test Case 7.1.1.8  | F   | 3.1.0    | 3.2.0    | T1-030399 |
| TP-20    | TP-030104 | 018 | -   | Test Case 8.1.1.2  | F   | 3.1.0    | 3.2.0    | T1-030401 |
| TP-20    | TP-030104 | 019 | -   | Test Case 8.1.1.3  | F   | 3.1.0    | 3.2.0    | T1-030403 |
| TP-20    | TP-030104 | 020 | -   | Test Case 8.1.1.8  | F   | 3.1.0    | 3.2.0    | T1-030411 |
| TP-20    | TP-030104 | 021 | -   | Test Case 8.2.1.8  | F   | 3.1.0    | 3.2.0    | T1-030413 |
| TP-20    | TP-030104 | 022 | -   | Test Case 8.2.1.10   | F   | 3.1.0    | 3.2.0    | T1-030415 |
| TP-20    | TP-030104 | 023 | -   | Test Case 8.1.5.1  | F   | 3.1.0    | 3.2.0    | T1-030425 |
| TP-20    | TP-030104 | 024 | -   | Test Case 8.1.5.4  | F   | 3.1.0    | 3.2.0    | T1-030427 |
| TP-20    | TP-030104 | 025 | -   | Test Case 8.2.3.7  | F   | 3.1.0    | 3.2.0    | T1-030429 |
| TP-20    | TP-030104 | 026 | -   | Addition of RLC test case 7.2.3.6 to RLC ATS V3.1.0  | B   | 3.1.0    | 3.2.0    | T1-030438 |
| TP-20    | TP-030104 | 027 | -   | Addition of RLC test case 7.2.3.25 to RLC ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030440 |
| TP-20    | TP-030104 | 028 | -   | Addition of RLC test case 7.2.3.14 to RLC ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030442 |
| TP-20    | TP-030104 | 029 | -   | Addition of RLC test case 7.2.3.15 to RLC ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030444 |
| TP-20    | TP-030104 | 030 | -   | Addition of RLC test case 7.2.3.16 to RLC ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030446 |
| TP-20    | TP-030104 | 031 | -   | Addition of RLC test case 7.2.3.33 to RLC ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030448 |
| TP-20    | TP-030104 | 032 | -   | Addition of NAS test case 10.1.2.5.1 to NAS ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030450 |
| TP-20    | TP-030104 | 033 | -   | 7.1.1.1  | B   | 3.1.0    | 3.2.0    | T1-030452 |
| TP-20    | TP-030104 | 034 | -   | 7.1.1.3  | B   | 3.1.0    | 3.2.0    | T1-030454 |
| TP-20    | TP-030104 | 035 | -   | 7.1.1.4  | B   | 3.1.0    | 3.2.0    | T1-030456 |
| TP-20    | TP-030104 | 036 | -   | Introduction of Test Case 7.1.1.5  | B   | 3.1.0    | 3.2.0    | T1-030458 |
| TP-20    | TP-030104 | 037 | -   | Test Case 8.2.3.15   | F   | 3.1.0    | 3.2.0    | T1-030464 |
| TP-20    | TP-030104 | 038 | -   | Test Case 8.2.3.18   | F   | 3.1.0    | 3.2.0    | T1-030466 |
| TP-20    | TP-030104 | 039 | -   | Test Case 8.2.3.19   | F   | 3.1.0    | 3.2.0    | T1-030468 |
| TP-20    | TP-030104 | 040 | -   | Test Case 12.3.1.2   | F   | 3.1.0    | 3.2.0    | T1-030474 |
| TP-20    | TP-030104 | 041 | -   | Test Case 8.3.3.1  | F   | 3.1.0    | 3.2.0    | T1-030479 |
| TP-20    | TP-030104 | 042 | -   | Addition of RLC test case 7.2.3.13 to RLC ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030484 |
| TP-20    | TP-030104 | 043 | -   | Addition of RLC test case 7.2.3.18 to RLC ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030486 |
| TP-20    | TP-030104 | 044 | -   | Addition of RLC test case 7.2.2.5 to RLC ATS V3.0.0  | B   | 3.1.0    | 3.2.0    | T1-030490 |
| TP-20    | TP-030104 | 045 | -   | Addition of RLC test case 7.2.2.6 to RLC ATS V3.0.0  | B   | 3.1.0    | 3.2.0    | T1-030492 |
| TP-20    | TP-030104 | 046 | -   | Addition of RLC test case 7.2.3.17 to RLC ATS  | B   | 3.1.0    | 3.2.0    | T1-030495 |

| Meet-ing | TSG doc   | CR  | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|-----|-----|---|-----|----------|----------|-----------|
|          |           |     |     | V3.0.0  |     |          |          |           |
| TP-20    | TP-030104 | 047 | -   | Addition of RLC test case 7.2.3.20 to RLC ATS V3.0.0  | B   | 3.1.0    | 3.2.0    | T1-030496 |
| TP-20    | TP-030104 | 048 | -   | Addition of RLC test case 7.2.3.34 to RLC ATS V3.0.0  | B   | 3.1.0    | 3.2.0    | T1-030498 |
| TP-20    | TP-030104 | 049 | -   | Addition of SM test case 11.1.1.1 to NAS ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030500 |
| TP-20    | TP-030104 | 050 | -   | Addition of RLC test case 7.2.3.23 to RLC ATS V3.1.0  | B   | 3.1.0    | 3.2.0    | T1-030535 |
| TP-20    | TP-030104 | 051 | -   | Addition of RLC test case 7.2.3.24 to RLC ATS V3.1.0  | B   | 3.1.0    | 3.2.0    | T1-030537 |
| TP-20    | TP-030104 | 052 | -   | Addition of RLC test case 7.2.3.26 to RLC ATS V3.1.0  | B   | 3.1.0    | 3.2.0    | T1-030539 |
| TP-20    | TP-030104 | 053 | -   | Addition of RLC test case 7.2.3.27 to RLC ATS V3.1.0  | B   | 3.1.0    | 3.2.0    | T1-030541 |
| TP-20    | TP-030104 | 054 | -   | Addition of SM test case 11.3.1 to NAS ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030576 |
| TP-20    | TP-030104 | 055 | -   | Addition of SM test case 11.3.2 to NAS ATS V3.1.0   | B   | 3.1.0    | 3.2.0    | T1-030577 |
| TP-20    | TP-030104 | 056 | -   | Addition of GMM test case 12.3.1.5 to NAS ATS V3.1.0  | B   | 3.1.0    | 3.2.0    | T1-030578 |
| TP-20    | TP-030104 | 057 | -   | Addition of GMM test case 12.7 to NAS ATS V3.1.0  | B   | 3.1.0    | 3.2.0    | T1-030580 |
| TP-20    | TP-030104 | 058 | -   | Test Case 8.2.1.9   | F   | 3.1.0    | 3.2.0    | T1-030594 |
| TP-20    | TP-030104 | 059 | -   | Test Case 8.2.3.8   | F   | 3.1.0    | 3.2.0    | T1-030596 |
| TP-20    | TP-030104 | 060 | -   | Test Case 12.3.1.1  | F   | 3.1.0    | 3.2.0    | T1-030614 |
| TP-20    | TP-030104 | 062 | -   | Test Case 12.9.2  | F   | 3.1.0    | 3.2.0    | T1-030626 |
| TP-20    | TP-030104 | 063 | -   | Addition of GMM test case 12.3.2.1 to NAS ATS V3.1.0  | B   | 3.1.0    | 3.2.0    | T1-030638 |
| TP-20    | TP-030104 | 064 | -   | CR for correction of generic test step in RLC ATS V3.1.0  | F   | 3.1.0    | 3.2.0    | T1-030654 |
| TP-20    | TP-030104 | 065 | -   | ASP Enhancement   | F   | 3.1.0    | 3.2.0    | T1-030665 |
| TP-20    | TP-030104 | 066 | -   | Test Case 8.1.2.2   | F   | 3.1.0    | 3.2.0    | T1-030395 |
| TP-20    | TP-030104 | 067 | -   | Test Case 8.1.2.9   | F   | 3.1.0    | 3.2.0    | T1-030396 |
| TP-20    | TP-030110 | 068 | -   | Add new approved test cases in test case list in Annex A  | F   | 3.1.0    | 3.2.0    | --        |
| TP-20    | TP-030141 | 069 | -   | Test Case 8.1.3.3   | F   | 3.1.0    | 3.2.0    | T1-030460 |
| TP-20    | -         | -   | -   | Regeneration of RRC and RLC ATS   |     | 3.2.0    | 3.2.1    | -         |
| TP-21    | TP-030194 | 073 | -   | CR to 34.123-3 R99, Moving baseline from March 02 to March 03 and error corrections                                     | F   | 3.2.1    | 3.3.0    | T1-031242 |
| TP-21    | TP-030194 | 074 | -   | CR to 34.123-3, R99, Update and remove unnecessary PIXIT parameters, so they are aligned with the 3GPP conformance TTCN | F   | 3.2.1    | 3.3.0    | T1-031278 |
| TP-21    | TP-030199 | -   | -   | Add new approved TTCN test cases in test case list in Annex A   | F   | 3.2.1    | 3.3.0    | -         |
| TP-21    | TP-030194 | 070 | -   | Corrections to Package 1 test cases in RRC ATS v3.2.1 for PS mode   | F   | 3.2.1    | 3.3.0    | T1-031054 |
| TP-21    | TP-030194 | 071 | -   | Corrections to Package 1 test cases in RRC ATS v3.2.1 for Integrity   | F   | 3.2.1    | 3.3.0    | T1-031055 |
| TP-21    | TP-030194 | 072 | -   | Corrections to Package 1 test cases in RRC ATS v3.2.1 for configuration of Radio Bearer -3                              | F   | 3.2.1    | 3.3.0    | T1-031140 |
| TP-21    | TP-030194 | 079 | -   | Changes to TS34.123-3 V310 to introduce TC_8_1_1_5  | F   | 3.1.0    | 3.3.0    | T1-030405 |
| TP-21    | TP-030194 | 080 | -   | Changes to TS34.123-3 V310 to introduce TC_8_1_1_6  | F   | 3.1.0    | 3.3.0    | T1-030407 |
| TP-21    | TP-030194 | 084 | -   | Changes to TS34.123-3 V310 to introduce TC_12_2_1_1   | F   | 3.1.0    | 3.3.0    | T1-030423 |
| TP-21    | TP-030194 | 119 | -   | Changes to TS34.123-3 V310 to introduce TC_8_3_4_1  | F   | 3.1.0    | 3.3.0    | T1-030602 |
| TP-21    | TP-030194 | 120 | -   | Changes to TS34.123-3 V310 to introduce TC_8_3_4_2  | F   | 3.1.0    | 3.3.0    | T1-030604 |
| TP-21    | TP-030194 | 121 | -   | Changes to TS34.123-3 V310 to introduce TC_8_3_4_3  | F   | 3.1.0    | 3.3.0    | T1-030606 |
| TP-21    | TP-030194 | 122 | -   | Changes to TS34.123-3 V310 to introduce TC_8_4_1_1  | F   | 3.1.0    | 3.3.0    | T1-030608 |
| TP-21    | TP-030194 | 124 | -   | Changes to TS34.123-3 V310 to introduce TC_12_9_1   | F   | 3.1.0    | 3.3.0    | T1-030624 |
| TP-21    | TP-030194 | 127 | -   | CR to 34.123-3 V310 to introduce test case 7.2.3.19   | B   | 3.1.0    | 3.3.0    | T1-030657 |
| TP-21    | TP-030194 | 128 | -   | CR to 34.123-3 V320 to introduce test case 14.2.13.1  | B   | 3.2.0    | 3.3.0    | T1-030877 |
| TP-21    | TP-030194 | 129 | -   | CR to 34.123-3 V320 to introduce test case 7.2.2.2  | B   | 3.2.0    | 3.3.0    | T1-030879 |
| TP-21    | TP-030194 | 130 | -   | CR to 34.123-3 V320 to introduce test case 7.2.3.2  | B   | 3.2.0    | 3.3.0    | T1-030881 |
| TP-21    | TP-030194 | 131 | -   | Changes to TS34.123-3 V320 to introduce TC_8_2_3_9  | B   | 3.2.0    | 3.3.0    | T1-030896 |
| TP-21    | TP-030194 | 132 | -   | Changes to TS34.123-3 V320 to introduce TC_7_2_3_21   | F   | 3.2.0    | 3.3.0    | T1-030897 |
| TP-21    | TP-030194 | 133 | -   | Changes to TS34.123-3 V320 to introduce   | F   | 3.2.0    | 3.3.0    | T1-030898 |

| Meet-ing | TSG doc   | CR  | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|-----|-----|--|-----|----------|----------|-----------|
|          |           |     |     | TC_7_2_3_22  |     |          |          |           |
| TP-21    | TP-030194 | 134 | -   | CR to 34.123-3 V320 to introduce test case TC_8_2_6_20                             | F   | 3.2.1    | 3.3.0    | T1-030928 |
| TP-21    | TP-030194 | 135 | -   | CR to 34.123-3 V320 to introduce test case TC_9.2.1                                | B   | 3.2.1    | 3.3.0    | T1-031016 |
| TP-21    | TP-030194 | 136 | -   | CR to 34.123-3 V320 to introduce test case TC_9.3.1                                | B   | 3.2.1    | 3.3.0    | T1-031018 |
| TP-21    | TP-030194 | 137 | -   | CR to 34.123-3 V320 to introduce test case TC_9.4.5_2                              | B   | 3.2.1    | 3.3.0    | T1-031020 |
| TP-21    | TP-030194 | 138 | -   | CR to 34.123-3 V320 to introduce test case TC_9.5.2                                | B   | 3.2.1    | 3.3.0    | T1-031022 |
| TP-21    | TP-030194 | 139 | -   | Changes to TS34.123-3 V321 to introduce TC_8_1_1_7                                 | F   | 3.2.1    | 3.3.0    | T1-031141 |
| TP-21    | TP-030208 | 140 | -   | Addition of RRC test case 8.2.2.1 to 34.123-3                                      | F   | 3.2.1    | 3.3.0    | T1-031280 |
| TP-21    | TP-030208 | 141 | -   | Addition of RRC test case 8.2.2.11 to 34.123-3                                     | F   | 3.2.1    | 3.3.0    | T1-031281 |
| TP-21    | TP-030208 | 142 | -   | Addition of RRC test case 8.2.6.1 to 34.123-3                                      | F   | 3.2.1    | 3.3.0    | T1-031282 |
| TP-21    | TP-030208 | 143 | -   | Addition of RRC test case 8.2.2.17 to 34.123-3                                     | F   | 3.2.1    | 3.3.0    | T1-031283 |
| TP-21    | TP-030208 | 144 | -   | Addition of RRC test case 8.2.4.10 to 34.123-3                                     | F   | 3.2.1    | 3.3.0    | T1-031284 |
| TP-21    | TP-030208 | 145 | -   | Addition of RRC test case 8.2.6.7 to 34.123-3                                      | F   | 3.2.1    | 3.3.0    | T1-031285 |
| TP-21    | TP-030208 | 146 | -   | Addition of RRC test case 8.2.2.8 to 34.123-3                                      | F   | 3.2.1    | 3.3.0    | T1-031286 |
| TP-21    | TP-030208 | 147 | -   | Addition of RRC test case 8.2.2.10 to 34.123-3                                     | F   | 3.2.1    | 3.3.0    | T1-031287 |
| TP-21    | TP-030208 | 148 | -   | Test case 12.5   | F   | 3.2.1    | 3.3.0    | T1-031288 |
| TP-21    | TP-030209 | 149 | -   | CR to 34.123-3 V321 to introduce test case TC_8_2_2_23                             | F   | 3.2.1    | 3.3.0    | T1-031289 |
| TP-21    | TP-030209 | 156 | -   | CR to 34.123-3 V321 to introduce test case TC_8_2_6_19                             | F   | 3.2.1    | 3.3.0    | T1-031296 |
| TP-21    | TP-030209 | 157 | -   | CR to 34.123-3 V321 to introduce test case TC_8_2_2_7                              | F   | 3.2.1    | 3.3.0    | T1-031297 |
| TP-21    | TP-030209 | 158 | -   | CR to 34.123-3 V321 to introduce test case TC_8_2_2_9                              | F   | 3.2.1    | 3.3.0    | T1-031298 |
| TP-21    | TP-030209 | 159 | -   | CR to 34.123-3 V321 to introduce test case TC_8_3_1_11                             | F   | 3.2.1    | 3.3.0    | T1-031299 |
| TP-21    | TP-030209 | 160 | -   | CR to 34.123-3 V321 to introduce test case TC_8_2_6_8                              | F   | 3.2.1    | 3.3.0    | T1-031300 |
| TP-21    | TP-030209 | 161 | -   | CR to 34.123-3 V321 to introduce test case TC_8_4_1_16                             | F   | 3.2.1    | 3.3.0    | T1-031301 |
| TP-22    | TP-030284 | 142 | 2   | ASP changes and MMI string corrections   | F   | 3.3.0    | 3.4.0    | T1-031707 |
| TP-22    | TP-030284 | 252 | -   | Security ASP changes   | F   | 3.3.0    | 3.4.0    | T1-031732 |
| TP-22    | TP-030285 | 251 | -   | Updating Annex A   | F   | 3.3.0    | 3.4.0    | -         |
| TP-23    | TP-040042 | 151 | -   | GERAN ASP changes  | F   | 3.4.0    | 3.5.0    | T1-040412 |
| TP-23    | TP-040044 | -   | -   | Updating Annex A   | F   | 3.4.0    | 3.5.0    | -         |
| TP-23    | TP-040019 | 189 |     | Addition of RAB test case 14.2.29 to RAB ATS V3.4.0                                | B   | 3.4.0    | 3.5.0    | T1s040199 |
| TP-23    | TP-040019 | 190 |     | Addition of RAB test case 14.2.31.1 to RAB ATS V3.4.0                              | B   | 3.4.0    | 3.5.0    | T1s040198 |
| TP-23    | TP-040019 | 191 |     | Addition of RAB test case 14.2.32.1 to RAB ATS V3.4.0                              | B   | 3.4.0    | 3.5.0    | T1s040197 |
| TP-23    | TP-040019 | 193 |     | Addition of RAB test case 14.4.3 to RAB ATS V3.4.0                                 | B   | 3.4.0    | 3.5.0    | T1s040196 |
| TP-23    | TP-040043 | 232 |     | To add verified GCF package 1 RRC test case 8.3.1.3 to the approved RRC ATS V3.4.0 |     | 3.4.0    | 3.5.0    | T1-031926 |
| TP-23    | TP-040043 | 171 |     | Addition of RAB test case 14.2.26 to RAB ATS V3.4.0                                | B   | 3.4.0    | 3.5.0    | T1s040002 |
| TP-23    | TP-040043 | 172 |     | Addition of RAB test case 14.2.4 to TS 34.123-3, V3.4.0                            | B   | 3.4.0    | 3.5.0    | T1s040004 |
| TP-23    | TP-040043 | 205 |     | Addition of RRC test case 8.3.2.1 to RRC ATS V3.4.0                                | B   | 3.4.0    | 3.5.0    | T1-031823 |
| TP-23    | TP-040043 | 206 |     | Addition of RRC test case 8.3.2.4 to RRC ATS V3.4.0                                | B   | 3.3.0    | 3.5.0    | T1-031825 |
| TP-23    | TP-040043 | 224 |     | Addition of RRC test case 8.3.1.31 to RRC ATS V3.4.0                               | B   | 3.3.0    | 3.5.0    | T1-031909 |
| TP-23    | TP-040043 | 152 |     | Addition of NAS test case 9.1 to NAS ATS V3.4.0                                    | B   | 3.3.0    | 3.5.0    | T1-031755 |
| TP-23    | TP-040043 | 153 |     | Addition of NAS test case 9.2.2 to NAS ATS V3.4.0                                  | B   | 3.3.0    | 3.5.0    | T1-031757 |
| TP-23    | TP-040043 | 154 |     | Addition of NAS test case 9.4.1 to NAS ATS V3.4.0                                  | B   | 3.3.0    | 3.5.0    | T1-031759 |
| TP-23    | TP-040043 | 155 |     | Addition of NAS test case 9.4.2.1 to NAS ATS V3.4.0                                | B   | 3.3.0    | 3.5.0    | T1-031761 |
| TP-23    | TP-040043 | 156 |     | Addition of NAS test case 9.4.2.4.1 to NAS ATS V3.4.0                              | B   | 3.3.0    | 3.5.0    | T1-031763 |
| TP-23    | TP-040043 | 157 |     | Addition of NAS test case 9.4.4 to NAS ATS V3.4.0                                  | B   | 3.3.0    | 3.5.0    | T1-031765 |
| TP-23    | TP-040043 | 158 |     | Addition of NAS test case 9.4.5.3 to NAS ATS V3.4.0                                | B   | 3.3.0    | 3.5.0    | T1-031767 |
| TP-23    | TP-040043 | 159 |     | Addition of RRC test case 8.3.7.1 to RRC ATS V3.4.0                                | B   | 3.3.0    | 3.5.0    | T1-031771 |
| TP-23    | TP-040043 | 160 |     | Addition of RRC test case 8.3.7.2 to RRC ATS V3.4.0                                | F   | 3.4.0    | 3.5.0    | T1-031918 |
| TP-23    | TP-040043 | 161 |     | Addition of RRC test case 8.3.7.4 to RRC ATS V3.4.0                                | F   | 3.4.0    | 3.5.0    | T1-031772 |
| TP-23    | TP-040043 | 210 |     | Addition of NAS test case 12.2.2.1 to NAS ATS V3.4.0                               | F   | 3.4.0    | 3.5.0    | T1-031936 |
| TP-23    | TP-040043 | 211 |     | Addition of NAS test case 12.4.3.1 to NAS ATS V3.4.0                               | B   | 3.4.0    | 3.5.0    | T1-031937 |
| TP-23    | TP-040043 | 222 |     | Addition of NAS test case 12.2.1.3 to NAS ATS V3.4.0                               | B   | 3.4.0    | 3.5.0    | T1-031938 |
| TP-23    | TP-040043 | 221 |     | Addition of RRC test case 8.2.2.19 to RRC ATS V3.4.0                               | B   | 3.4.0    | 3.5.0    | T1-031939 |

| Meet-ing | TSG doc   | CR  | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|-----|-----|--|-----|----------|----------|-----------|
| TP-23    | TP-040043 | 220 |     | Addition of RRC test case 8.4.1.17 to RRC ATS V3.4.0   | B   | 3.4.0    | 3.5.0    | T1-031940 |
| TP-23    | TP-040043 | 162 |     | Addition of NAS test case 12.2.1.7 to NAS ATS V3.4.0   | B   | 3.4.0    | 3.5.0    | T1s040029 |
| TP-23    | TP-040043 | 163 |     | Addition of RAB test case 14.2.27 to RAB ATS V3.4.0  | B   | 3.4.0    | 3.5.0    | T1s040033 |
| TP-23    | TP-040043 | 164 |     | Introducing test case 12_6_1_1 to NASv330  | B   | 3.4.0    | 3.5.0    | T1-031745 |
| TP-23    | TP-040043 | 184 |     | Introducing test case 8.3.1.1 to RRCv340   | F   | 3.3.0    | 3.5.0    | T1-031733 |
| TP-23    | TP-040043 | 165 |     | Introducing test case 8.2.4.3 to RRCv330   | F   | 3.4.0    | 3.5.0    | T1-031747 |
| TP-23    | TP-040043 | 166 |     | Introducing test case 8.2.4.4 to RRCv330   | F   | 3.3.0    | 3.5.0    | T1-031749 |
| TP-23    | TP-040043 | 192 |     | Introducing test case 8.3.1.22 to RRCv340  | F   | 3.3.0    | 3.5.0    | T1-031797 |
| TP-23    | TP-040043 | 195 |     | Introducing test case 8.2.2.18 to RRCv340  | F   | 3.4.0    | 3.5.0    | T1-031932 |
| TP-23    | TP-040043 | 234 |     | Introducing test case 12_4_2_1 to NASv340  | F   | 3.4.0    | 3.5.0    | T1-031930 |
| TP-23    | TP-040043 | 233 |     | Introducing test case 8.3.1.4 to RRCv340   | F   | 3.4.0    | 3.5.0    | T1s040087 |
| TP-23    | TP-040043 | 216 |     | Revised CR for Changes to Introducing test case 8.2.6.9 required for approval of RRCv340   | F   | 3.4.0    | 3.5.0    | T1s040088 |
| TP-23    | TP-040043 | 167 |     | Introduction of Package 2 test case 8.3.1.21   | F   | 3.4.0    | 3.5.0    | T1s040049 |
| TP-23    | TP-040043 | 207 |     | Addition of RRC test case 8.3.2.7 to RRC ATS V3.4.0  | F   | 3.4.0    | 3.5.0    | T1-031827 |
| TP-23    | TP-040043 | 168 |     | Addition of NAS test case 9.4.2.2.1 to NAS ATS V3.4.0  | B   | 3.3.0    |          | T1s040025 |
| TP-23    | TP-040043 | 169 |     | Addition of NAS test case 9.4.2.2.2 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.5.0    | T1s040027 |
| TP-23    | TP-040043 | 170 |     | Addition of NAS test case 9.4.9 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.5.0    | T1s040014 |
| TP-23    | TP-040043 | 171 |     | Addition of NAS test case 9.4.2.5 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.5.0    | T1s040082 |
| TP-23    | TP-040043 | 172 |     | Correction to RRC Package 1 TC 8.2.1.8 and 8.2.1.9 for the mismatch between Radio Bearer setup and PDP context Activation Accept message | B   | 3.4.0    | 3.5.0    | T1s040071 |
| TP-23    | TP-040043 | 226 |     | Validation of TMSI status in ATTACH REQUEST message for tc 12.3.1.5  | F   | 3.4.0    | 3.5.0    | T1-031913 |
| TP-23    | TP-040043 | 227 |     | Validation of optional old PTMSI signature in ATTACH REQUEST message for tc 12.2.1.1   | F   | 3.3.0    | 3.5.0    | T1-031914 |
| TP-23    | TP-040043 | 173 |     | Incorrect timer poll value used for SS RLC transmit entity in tcs 8.2.1.8, 8.2.1.9 (Revision of T1-031782)                               | F   | 3.3.0    | 3.5.0    | T1-031842 |
| TP-23    | TP-040043 | 174 |     | Correction of Poll bit checking in tc 7.2.3.13 (Revision of T1-031839)   | F   | 3.3.0    | 3.5.0    | T1-031921 |
| TP-23    | TP-040043 | 230 |     | Validation of CS CKSN in paging response in tc 9.2.1   | F   | 3.3.0    | 3.5.0    | T1-031922 |
| TP-23    | TP-040043 | 175 |     | Modification to Radio Bearer Release message in tc 8.2.3.18 and 8.2.3.19   | F   | 3.3.0    | 3.5.0    | T1-031924 |
| TP-23    | TP-040043 | 176 |     | Maximum allowed UL TX power should not be present in tcs 8.2.2.8, 8.2.2.9 and 8.2.2.23   | F   | 3.3.0    | 3.5.0    | T1-031925 |
| TP-23    | TP-040043 | 177 |     | New C-RNTI should not be present in tc 8.2.6.20  | F   | 3.3.0    | 3.5.0    | T1-031787 |
| TP-23    | TP-040043 | 178 |     | Unnecessary waiting time for reconfiguration in tc 8.2.2.23  | F   | 3.3.0    | 3.5.0    | T1-031788 |
| TP-23    | TP-040043 | 179 |     | Modification to validate TI flag and TI value in TCs 11.3.1 and 11.3.2   | F   | 3.3.0    | 3.5.0    | T1-031795 |
| TP-23    | TP-040043 | 180 |     | Change U-RNTI and remove UTRAN DRX cycle length coefficient tc 8.3.3.1   | F   | 3.3.0    | 3.5.0    | T1-031841 |
| TP-23    | TP-040043 | 181 |     | Corrections of Status PDU checking in tc 7.2.3.34  | F   | 3.3.0    | 3.5.0    | T1-031786 |
| TP-23    | TP-040043 | 182 |     | Correction of number of negatively acknowledged PDUs in tc 7.2.3.16  | F   | 3.3.0    | 3.5.0    | T1-031789 |
| TP-23    | TP-040043 | 183 |     | Correction of sequence number checking and Verdict assessments in tc 7.2.3.17  | F   | 3.3.0    | 3.5.0    | T1-031790 |
| TP-23    | TP-040043 | 184 |     | Poll Bit and Status PDU content checking in tc 7.2.3.14  | F   | 3.3.0    | 3.5.0    | T1-031791 |
| TP-23    | TP-040043 | 185 |     | Additional verdicts assigned in tc 7.2.3.20  | F   | 3.3.0    | 3.5.0    | T1-031792 |
| TP-23    | TP-040043 | 186 |     | SERVICE ACCEPT message NOT to be sent to UE in GMM idle state in tc 11.3.1 and 11.3.2  | F   | 3.3.0    | 3.5.0    | T1-031794 |
| TP-23    | TP-040043 | 187 |     | Change to performing integrity protection in tc 12.2.1.1   | F   | 3.3.0    | 3.5.0    | T1-031778 |
| TP-23    | TP-040043 | 188 |     | Correction of Poll bit checking in tc 7.2.3.18   | F   | 3.3.0    | 3.5.0    | T1-031781 |
| TP-23    | -         | -   |     | Editorial clean-up by ETSI   |     | 3.5.0    | 3.5.1    | -         |
| TP-23    | -         | -   |     | Sections 8.3.28 - 8.3.31 were misplaced  |     | 3.5.1    | 3.5.2    | -         |
| TP-24    | TP-040117 | 233 |     | Clarification of Section 8.5.1 Authentication: Explicitly stating that Authentication after IDT is an optional/dependent procedure.      | F   | 3.5.2    | 3.6.0    | T1-040761 |
| TP-24    | TP-040117 | 234 |     | GERAN generic procedures and TTCN encoding rules for CSN.1 specific encoding   | F   | 3.5.2    | 3.6.0    | T1-040940 |
| TP-24    | TP-040123 | 359 |     | Updating Annex A   | F   | 3.5.2    | 3.6.0    | -         |
| TP-24    | TP-040118 | 255 |     | Addition of MAC test case 7.1.3.1 to MAC ATS V3.5.1  | B   | 3.5.1    | 3.6.0    | T1s040295 |
| TP-24    | TP-040118 | 256 |     | Addition of RAB test case 14.2.49.1 to RAB ATS V3.5.1  | B   | 3.5.1    | 3.6.0    | T1s040254 |
| TP-24    | TP-040118 | 257 |     | Addition of GCF P1 test case 8.4.1.2 to RRC ATS V3.5.1   | B   | 3.5.1    | 3.6.0    | T1s040252 |

| Meet-ing | TSG doc   | CR  | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|-----|-----|--|-----|----------|----------|-----------|
| TP-24    | TP-040118 | 260 |     | Addition of GCF P3 test case 8.4.1.31 to RRC ATS V3.5.1                        | B   | 3.5.1    | 3.6.0    | T1s040285 |
| TP-24    | TP-040118 | 261 |     | Revised CR for addition of GCF P2 test case 12.4.2.2 to NAS ATS V3.5.1         | B   | 3.5.1    | 3.6.0    | T1s040283 |
| TP-24    | TP-040118 | 262 |     | Addition of RRC test case 8.3.2.11 to RRC ATS V3.5.1                           | B   | 3.5.1    | 3.6.0    | T1s040262 |
| TP-24    | TP-040118 | 263 |     | Addition of RRC test case 8.4.1.30 to RRC ATS V3.5.1                           | B   | 3.5.1    | 3.6.0    | T1s040260 |
| TP-24    | TP-040118 | 264 |     | Addition of RRC test case 8.4.1.29 to RRC ATS V3.5.1                           | B   | 3.5.1    | 3.6.0    | T1s040258 |
| TP-24    | TP-040118 | 265 |     | Addition of RAB test case 14.2.7a to RAB ATS V3.5.1                            | B   | 3.5.1    | 3.6.0    | T1s040249 |
| TP-24    | TP-040118 | 266 |     | Addition of RAB test case 14.2.5a to RAB ATS V3.5.1                            | B   | 3.5.1    | 3.6.0    | T1s040247 |
| TP-24    | TP-040118 | 267 |     | Addition of RAB test case 14.2.4a to RAB ATS V3.5.1                            | B   | 3.5.1    | 3.6.0    | T1s040245 |
| TP-24    | TP-040118 | 268 |     | Addition of GCF P1 test case 12.4.1.1a to NAS ATS V3.5.1                       | B   | 3.5.1    | 3.6.0    | T1s040266 |
| TP-24    | TP-040118 | 269 |     | Test Case 13.2.1.1   | B   | 3.5.1    | 3.6.0    | T1s040237 |
| TP-24    | TP-040118 | 270 |     | Addition of GCF P3 test case 10.1.2.6.6 to NAS ATS V3.4.0                      | B   | 3.4.0    | 3.6.0    | T1s040234 |
| TP-24    | TP-040118 | 271 |     | Addition of GCF P3 test case 10.1.2.7.2 to NAS ATS V3.4.0                      | B   | 3.4.0    | 3.6.0    | T1s040233 |
| TP-24    | TP-040118 | 272 |     | Addition of GCF P3 test case 10.1.2.5.5 to NAS ATS V3.4.0                      | B   | 3.4.0    | 3.6.0    | T1s040231 |
| TP-24    | TP-040118 | 273 |     | Addition of GCF P3 test case 10.1.2.6.2 to NAS ATS V3.4.0                      | B   | 3.4.0    | 3.6.0    | T1s040232 |
| TP-24    | TP-040118 | 274 |     | Addition of GCF P3 test case 10.1.2.4.10 to NAS ATS V3.4.0                     | B   | 3.4.0    | 3.6.0    | T1s040230 |
| TP-24    | TP-040118 | 275 |     | Addition of GCF P3 test case 10.1.2.3.3 to NAS ATS V3.4.0                      | B   | 3.4.0    | 3.6.0    | T1s040229 |
| TP-24    | TP-040118 | 276 |     | Addition of NAS test case 8.3.1.2 to RRC ATS V3.4.0 (revision of T1-031735)    | B   | 3.4.0    | 3.6.0    | T1s040226 |
| TP-24    | TP-040118 | 277 |     | Addition of NAS test case 8.3.1.5 to RRC ATS V3.4.0 (revision of T1-031807)    | B   | 3.4.0    | 3.6.0    | T1s040227 |
| TP-24    | TP-040118 | 278 |     | Addition of NAS test case 8.3.1.6 to RRC ATS V3.4.0 (revision of T1-031809)    | B   | 3.4.0    | 3.6.0    | T1s040228 |
| TP-24    | TP-040118 | 279 |     | Addition of GCF P3 test case 14.2.12 to RAB ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040225 |
| TP-24    | TP-040118 | 280 |     | Addition of NAS test case 10.1.3.3.1 to NAS ATS V3.4.0 (Revision of T1s040170) | B   | 3.4.0    | 3.6.0    | T1s040222 |
| TP-24    | TP-040118 | 281 |     | Addition of RRC test case 8.1.10.1 to RRC ATS V3.4.0                           | B   | 3.4.0    | 3.6.0    | T1s040223 |
| TP-24    | TP-040118 | 282 |     | Addition of GCF P2 test case 8.4.1.18 to RRC ATS V3.4.0                        | B   | 3.4.0    | 3.6.0    | T1s040215 |
| TP-24    | TP-040118 | 283 |     | Addition of GCF P2 test case 8.4.1.19 to RRC ATS V3.4.0                        | B   | 3.4.0    | 3.6.0    | T1s040216 |
| TP-24    | TP-040118 | 284 |     | Addition of NAS test case 10.1.3.5.6 to NAS ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040213 |
| TP-24    | TP-040118 | 285 |     | Addition of NAS test case 10.1.2.2.2 to NAS ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040209 |
| TP-24    | TP-040118 | 286 |     | Addition of RRC test case 8.4.1.26 to RRC ATS V3.4.0                           | B   | 3.4.0    | 3.6.0    | T1s040207 |
| TP-24    | TP-040118 | 287 |     | Addition of GCF P1 test case 8.4.1.3 to RRC ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040205 |
| TP-24    | TP-040118 | 288 |     | Addition of RRC test case 8.3.7.3 to RRC ATS V3.4.0                            | B   | 3.4.0    | 3.6.0    | T1-040084 |
| TP-24    | TP-040118 | 289 |     | Introducing package 2 test case 8.3.1.10 to RRCv340 (revision of T1-031739)    | B   | 3.4.0    | 3.6.0    | T1s040204 |
| TP-24    | TP-040118 | 290 |     | Introducing package 2 test case 8.3.1.9 to RRCv340 (revision of T1-031737)     | B   | 3.4.0    | 3.6.0    | T1s040203 |
| TP-24    | TP-040118 | 291 |     | Addition of NAS test case 10.1.2.1.1 to NAS ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040178 |
| TP-24    | TP-040118 | 292 |     | Addition of NAS test case 10.1.3.3.2 to NAS ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040172 |
| TP-24    | TP-040118 | 293 |     | Addition of NAS test case 10.1.3.3.4 to NAS ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040174 |
| TP-24    | TP-040118 | 294 |     | Addition of NAS test case 10.1.2.7.3 to NAS ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040161 |
| TP-24    | TP-040118 | 295 |     | Addition of NAS test case 10.1.2.5.2 to NAS ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040149 |
| TP-24    | TP-040118 | 296 |     | Addition of RAB test case 14.2.23a.1 to RAB ATS V3.4.0                         | B   | 3.4.0    | 3.6.0    | T1s040065 |
| TP-24    | TP-040118 | 297 |     | Addition of RAB test case 14.2.23b to RAB ATS V3.4.0                           | B   | 3.4.0    | 3.6.0    | T1s040067 |
| TP-24    | TP-040118 | 298 |     | Addition of RAB test case 14.2.23c to RAB ATS V3.4.0                           | B   | 3.4.0    | 3.6.0    | T1s040069 |

| Meet-ing | TSG doc   | CR  | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|-----|-----|---|-----|----------|----------|-----------|
| TP-24    | TP-040118 | 299 |     | Addition of RAB test case 14.2.14.1 to RAB ATS V3.4.0   | B   | 3.4.0    | 3.6.0    | T1s040055 |
| TP-24    | TP-040118 | 300 |     | Addition of RAB test case 14.2.14.2 to RAB ATS V3.4.0   | B   | 3.4.0    | 3.6.0    | T1s040057 |
| TP-24    | TP-040118 | 301 |     | Addition of RAB test case 14.2.15 to RAB ATS V3.4.0   | B   | 3.4.0    | 3.6.0    | T1s040059 |
| TP-24    | TP-040118 | 302 |     | Addition of RAB test case 14.2.16 to RAB ATS V3.4.0   | B   | 3.4.0    | 3.6.0    | T1s040061 |
| TP-24    | TP-040118 | 303 |     | Addition of RAB test case 14.2.17 to RAB ATS V3.4.0   | B   | 3.4.0    | 3.6.0    | T1s040063 |
| TP-24    | TP-040118 | 304 |     | Addition of RAB test case 14.2.13.2 to RAB ATS V3.4.0   | B   | 3.4.0    | 3.6.0    | T1s040053 |
| TP-24    | TP-040118 | 305 |     | Addition of NAS test case 10.1.2.4.9 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040129 |
| TP-24    | TP-040118 | 306 |     | Addition of NAS test case 10.1.2.4.4 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040121 |
| TP-24    | TP-040118 | 307 |     | Addition of NAS test case 10.1.2.4.6 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040123 |
| TP-24    | TP-040118 | 308 |     | Addition of NAS test case 10.1.2.6.3 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040139 |
| TP-24    | TP-040118 | 309 |     | Addition of NAS test case 10.1.2.4.7 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040099 |
| TP-24    | TP-040118 | 310 |     | Addition of NAS test case 10.1.2.4.8 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040101 |
| TP-24    | TP-040118 | 311 |     | Addition of NAS test case 10.1.2.9.1 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040107 |
| TP-24    | TP-040118 | 312 |     | Addition of NAS test case 10.1.2.3.1 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040091 |
| TP-24    | TP-040118 | 313 |     | Addition of NAS test case 10.1.2.4.3 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040093 |
| TP-24    | TP-040118 | 314 |     | Addition of NAS test case 9.4.2.3 to NAS ATS V3.4.0   | B   | 3.4.0    | 3.6.0    | T1s040080 |
| TP-24    | TP-040118 | 315 |     | Addition of NAS test case 9.4.8 to NAS ATS V3.4.0   | B   | 3.4.0    | 3.6.0    | T1s040023 |
| TP-24    | TP-040118 | 316 |     | Addition of NAS test case 12.6.1.2 to NAS ATS V3.4.0  | B   | 3.4.0    | 3.6.0    | T1s040016 |
| TP-24    | TP-040118 | 258 |     | Revised CR for P3 NAS test case 13.2.2.1 to NAS ATS V3.5.1 (revision of T1-040239)  | B   | 3.5.1    | 3.6.0    | T1s040330 |
| TP-24    | TP-040118 | 259 |     | Revised CR for P3 NAS test case 13.2.2.2 to NAS ATS V3.5.1 (revision of T1-040241)  | B   | 3.5.1    | 3.6.0    | T1s040331 |
| TP-24    | TP-040119 | 357 |     | Corrections to RRC Package 1 TC 8.1.2.9 to modify timers and RRC Setup Request Constraints  | F   | 3.4.0    | 3.6.0    | T1s040077 |
| TP-24    | TP-040119 | 358 |     | Corrections to Package 1 test case tc_8_1_1_1   | F   | 3.4.0    | 3.6.0    | T1s040079 |
| TP-24    | TP-040119 | 355 |     | Correction to RRC Package 1 TC 8.2.1.8 and 8.2.1.9 for the mismatch between Radio Bearer setup and PDP context Activation Request message (Revision of T1s040071).                    | F   | 3.4.0    | 3.6.0    | T1s040163 |
| TP-24    | TP-040119 | 356 |     | Modification to ATT flag usage in TC 12.3.1.5. (Re-submission of T1-031923 on v3.4.0)   | F   | 3.4.0    | 3.6.0    | T1s040164 |
| TP-24    | TP-040119 | 354 |     | General correction to approved GCF P1 (Cell FACH) MAC test cases  | F   | 3.4.0    | 3.6.0    | T1s040185 |
| TP-24    | TP-040119 | 352 |     | Error correction lists to iWD-wk04 and iWD-wk07   | F   | 3.4.0    | 3.6.0    | T1s040188 |
| TP-24    | TP-040119 | 353 |     | TTCN corrections to Generic Setup Procedures  | F   | 3.4.0    | 3.6.0    | T1s040189 |
| TP-24    | TP-040119 | 349 |     | Correction to RRC Package 2 TC 8.2.2.7 for radio bearer messages with specified IEs and correction of default PS RAB and SRBs RLC configurations in RRC ATS. (Revision of T1s040165). | F   | 3.4.0    | 3.6.0    | T1s040219 |
| TP-24    | TP-040119 | 350 |     | Correction to NAS Package 1 TC 12.5 for selecting UE operation mode C only when mode A not supported and validating RRC connection establishment cause                                | F   | 3.4.0    | 3.6.0    | T1s040220 |
| TP-24    | TP-040119 | 351 |     | Correction to RRC Package 1 TC 8.1.2.1 modification to UE system specific capabilities (Revision of T1s040078).   | F   | 3.4.0    | 3.6.0    | T1s040221 |
| TP-24    | TP-040119 | 348 |     | Correction to Approved RRC Package 1 TC 8.3.4.1   | F   | 3.5.0    | 3.6.0    | T1s040224 |
| TP-24    | TP-040119 | 347 |     | Correction to Approved RRC Package 1 TC 8.3.4.2 and 8.3.4.3   | F   | 3.5.0    | 3.6.0    | T1s040235 |
| TP-24    | TP-040119 | 346 |     | Correction to GFC P3 RAB test cases 14.2.26 and 14.2.27   | F   | 3.5.1    | 3.6.0    | T1s040251 |
| TP-24    | TP-040119 | 345 |     | Correction to GFC P1 RAB test case 14.2.4   | F   | 3.5.1    | 3.6.0    | T1s040272 |
| TP-24    | TP-040119 | 344 |     | Correction to Package 2 MM TC 9.4.9 to handle situation when pc_PS is TRUE also.  | F   | 3.5.2    | 3.6.0    | T1s040273 |
| TP-24    | TP-040119 | 343 |     | Regression error corrections to wk12 and wk15.  | F   | 3.5.1    | 3.6.0    | T1s040274 |
| TP-24    | TP-040119 | 341 |     | Changes to the test step ts_CC_InitTCV_MO   | F   | 3.5.1    | 3.6.0    | T1s040277 |
| TP-24    | TP-040119 | 342 |     | Correction to Package 1 GMM test case 12.3.1.2 for P-TMSI signature check at Step 12.   | F   | 3.5.1    | 3.6.0    | T1s040278 |
| TP-24    | TP-040119 | 340 |     | Correction to Approved RRC Package 1 TC 8.4.1.1   | F   | 3.5.0    | 3.6.0    | T1s040279 |
| TP-24    | TP-040119 | 339 |     | Correction to package 2 TC 9.1 to handle PS attach  | F   | 3.5.2    | 3.6.0    | T1s040282 |

| Meet-ing | TSG doc   | CR  | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|-----|-----|---|-----|----------|----------|-----------|
|          |           |     |     | and detach.   |     |          |          |           |
| TP-24    | TP-040119 | 338 |     | Correction to Approved Package 1 TC 11.1.1.1  | F   | 3.5.0    | 3.6.0    | T1S040284 |
| TP-24    | TP-040119 | 337 |     | Correction to Package 1 SM TC 11.1.1.1, 11.3.1 and 11.3.2 to harmonize the timer handling and to account for T1-040514, T1s040243 and T1s040244 concerning RAB release and detaching. | F   | 3.5.1    | 3.6.0    | T1s040287 |
| TP-24    | TP-040119 | 333 |     | Correction to Package 3 NAS CC test case 10.1.2.7.3 for assigning FAIL verdict on receiving unexpected RELEASE message.   | F   | 3.5.1    | 3.6.0    | T1s040288 |
| TP-24    | TP-040119 | 322 |     | Correction to Package 2 GMM test case 12.2.1.3 for supporting USIM removal without power off  | F   | 3.5.2    | 3.6.0    | T1s040289 |
| TP-24    | TP-040119 | 334 |     | Correction to RRC TC 8.2.2.10 on contents of radio bearer reconfiguration message.  | F   | 3.5.1    | 3.6.0    | T1s040291 |
| TP-24    | TP-040119 | 335 |     | Correction to RRC Package 2 TC 8.4.1.16 and 8.4.1.17 for contents of SIB 11 and Measurement reporting Interval.   | F   | 3.5.1    | 3.6.0    | T1s040292 |
| TP-24    | TP-040119 | 336 |     | Correction to common test step "ts_SS_2_FACH_1_RACH_ModifyDCH_Cfg" of RRC ATS to release unused RLC entity, related to test cases 8.4.1.18 and 8.4.1.19                               | F   | 3.5.1    | 3.6.0    | T1s040293 |
| TP-24    | TP-040119 | 323 |     | Correction to Package 3 NAS CC test cases 10_1_2_5_5, 10_1_2_6_2 and 10_1_2_7_2 to validate the current TI value.   | F   | 3.5.1    | 3.6.0    | T1s040297 |
| TP-24    | TP-040119 | 324 |     | Correction to Package 3 NAS CC test cases 10.1.2.6.6; introducing PIXIT parameter for UE Call waiting support.  | F   | 3.5.1    | 3.6.0    | T1s040298 |
| TP-24    | TP-040119 | 325 |     | Correction to Package 1 SM test case 11.1.1.1 in handling Modify PDP Context procedure.   | F   | 3.5.1    | 3.6.0    | T1s040299 |
| TP-24    | TP-040119 | 326 |     | Correction to Radio Bearer setup message for Package 1 RAB test case 14.2.13.1 and package 2 RAB test case 14.2.15.   | F   | 3.5.1    | 3.6.0    | T1s040300 |
| TP-24    | TP-040119 | 327 |     | Correction to Package 3 RAB test case 14.2.14.1 Radio Bearer setup in the SS.   | F   | 3.5.1    | 3.6.0    | T1s040301 |
| TP-24    | TP-040119 | 328 |     | Correction to RRC TC 8.2.2.18 and 8.2.2.17 on contents of radio bearer reconfiguration message and comments in test steps of TC 8.2.2.18.   | F   | 3.5.1    | 3.6.0    | T1s040302 |
| TP-24    | TP-040119 | 329 |     | Correction to RRC Package 2 TC 8.3.1.3 to delete the Radio Bearer BCCH mapped to FACH(RB_BCCH_FACH) in the old cell before configuring in the new cell.                               | F   | 3.5.1    | 3.6.0    | T1s040303 |
| TP-24    | TP-040119 | 330 |     | Correction to Package 3 NAS MM test case 9.4.2.2.2 to disable cell C ATT flag   | F   | 3.5.1    | 3.6.0    | T1s040304 |
| TP-24    | TP-040119 | 331 |     | Correction to Package 2 NAS MM test case 9.4.9; introducing postamble to remove PLMN2 from USIM forbidden PLMN list.  | F   | 3.5.2    | 3.6.0    | T1s040305 |
| TP-24    | TP-040119 | 332 |     | Modification to RLC 7.2.3.33 TTCN to meet Test Procedure 'f' in Prose 34.123-1-571.   | F   | 3.5.1    | 3.6.0    | T1s040306 |
| TP-24    | TP-040119 | 317 |     | Quality of Service (QoS) initialisation when setting up a PS call   | F   | 3.5.1    | 3.6.0    | T1s040320 |
| TP-24    | TP-040119 | 321 |     | Correction to RRC Package 1 TC 8.1.1.2 and 8.1.1.3 to add delay before switching to CELL_PCH or URA_PCH   | F   | 3.5.1    | 3.6.0    | T1s040321 |
| TP-24    | TP-040119 | 318 |     | Correction to RRC Package 2 TC 8.3.1.4 to stop the timer t_WaitS after receiving expected UTRAN MOBILITY INFORMATION CONFIRM message from UE.   | F   | 3.5.1    | 3.6.0    | T1s040322 |
| TP-24    | TP-040119 | 319 |     | Corrections to RRC package 1 and 2 test cases from sections 8.1.x, 8.2.x and 8.3.x to add a delay before SS reconfigures MAC according to the new C-RNTI or U-RNTI assigned to UE.    | F   | 3.5.1    | 3.6.0    | T1s040323 |
| TP-24    | TP-040119 | 320 |     | Correction to RRC TC 8.3.1.3 on the contents of CELL UPDATE CONFIRM message   | F   | 3.5.1    | 3.6.0    | T1s040324 |
| TP-24    | -         |     |     | One correction performed in the NAS ATS part (the other ATS parts remain in v.3.6.0)  |     | 3.6.0    | 3.6.1    | -         |
| TP-25    | TP-040162 | 359 |     | ASP updating and other corrections  | F   | 3.6.1    | 3.7.0    | T1-041407 |
| TP-25    | TP-040149 | 360 | -   | Addition of GCF P3 test case 16.1.1 to SMS ATS V3.5.1   | B   | 3.5.1    | 3.7.0    | T1s040264 |
| TP-25    | TP-040149 | 361 | -   | Addition of GCF P3 test case 16.1.9.1 to SMS ATS V3.5.1   | B   | 3.5.1    | 3.7.0    | T1s040307 |
| TP-25    | TP-040149 | 362 | -   | Addition of GCF P3 test case 16.1.9.2 to SMS ATS V3.5.1   | B   | 3.6.1    | 3.7.0    | T1s040309 |
| TP-25    | TP-040149 | 363 | -   | Addition of GCF P3 test case 16.1.10 to SMS ATS V3.5.1  | B   | 3.6.1    | 3.7.0    | T1s040311 |

| Meet-ing | TSG doc   | CR  | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|-----|-----|---|-----|----------|----------|-----------|
| TP-25    | TP-040149 | 364 | -   | Addition of GCF P3 test case 16.2.1 to SMS ATS V3.6.1   | B   | 3.5.1    | 3.7.0    | T1s040313 |
| TP-25    | TP-040149 | 365 | -   | Addition of GCF P3 test case 16.2.2 to SMS ATS V3.5.1   | B   | 3.6.1    | 3.7.0    | T1s040315 |
| TP-25    | TP-040149 | 366 | -   | Addition of GCF P3 test case 16.2.10 to SMS ATS V3.5.1  | B   | 3.6.0    | 3.7.0    | T1s040317 |
| TP-25    | TP-040149 | 367 | -   | Addition of P2 NAS test case 9.4.2.4 proc 2 to NAS ATS V3.5.1 (revision of T1-040109)                                   | B   | 3.6.0    | 3.7.0    | T1s040329 |
| TP-25    | TP-040149 | 368 | -   | Addition of NAS test case 12.4.2.5a.2 to NAS ATS V3.5.1   | B   | 3.5.1    | 3.7.0    | T1s040337 |
| TP-25    | TP-040149 | 369 | -   | Revised CR for addition of GCF P3 test case 8.2.4.1a to RRC ATS V3.5.1  | B   | 3.5.1    | 3.7.0    | T1s040339 |
| TP-25    | TP-040149 | 370 | -   | Revised CR for Addition of P2 test case 6.2.1.1 to IR_U ATS v3.5.1 (Revision of T1s040325)                              | B   | 3.6.1    | 3.7.0    | T1s040345 |
| TP-25    | TP-040149 | 371 | -   | Revised CR for Addition of P2 test case 6.2.1.6 to IR_U ATS v3.5.1 (Revision of T1s040327)                              | B   | 3.5.1    | 3.7.0    | T1s040346 |
| TP-25    | TP-040149 | 372 | -   | Addition of RRC test case 8.4.1.40 to RRC ATS V3.5.1  | B   | 3.5.1    | 3.7.0    | T1s040352 |
| TP-25    | TP-040149 | 373 | -   | Addition of RRC Package 3 test case 8.4.1.33 to IR_U ATS V3.5.1   | B   | 3.5.1    | 3.7.0    | T1s040358 |
| TP-25    | TP-040149 | 374 | -   | Revised CR for addition of GCF P3 test case 16.1.2 to SMS ATS V3.5.1  | B   | 3.6.1    | 3.7.0    | T1s040360 |
| TP-25    | TP-040149 | 375 | -   | Revised CR for the addition of GCF P3 test case 8.4.1.35 to IR_U ATS V3.5.1   | B   | 3.6.1    | 3.7.0    | T1s040361 |
| TP-25    | TP-040149 | 376 | -   | CR for the addition of GCF P3 test case 8.4.1.36 to IR_U ATS V3.6.1   | B   | 3.6.1    | 3.7.0    | T1s040364 |
| TP-25    | TP-040149 | 377 | -   | Addition of GCF P3 test case 8.3.2.12 to RRC ATS V3.6.1   | B   | 3.6.1    | 3.7.0    | T1s040385 |
| TP-25    | TP-040149 | 378 | -   | Addition of RAB Package 3 test case 14.2.57 to RAB ATS V3.6.1   | B   | 3.6.1    | 3.7.0    | T1s040387 |
| TP-25    | TP-040149 | 379 | -   | Addition of GCF P3 test case 14.2.58 to RAB ATS V3.6.1  | B   | 3.6.1    | 3.7.0    | T1s040395 |
| TP-25    | TP-040149 | 380 | -   | Addition of GCF P1 test cases 8.1.7.1 to RRC ATS v3.6.1   | B   | 3.6.1    | 3.7.0    | T1s040398 |
| TP-25    | TP-040149 | 381 | -   | Addition of GCF P1 test case 8.1.7.2 to RRC ATS v3.6.1  | B   | 3.5.1    | 3.7.0    | T1s040400 |
| TP-25    | TP-040149 | 382 | -   | Addition of RAB Package 2 test case 14.4.2.1 to RAB ATS V3.6.1  | B   | 3.5.1    | 3.7.0    | T1s040430 |
| TP-25    | TP-040149 | 383 | -   | Addition of RAB Package 3 test case 14.2.38a to RAB ATS V3.6.1  | B   | 3.5.1    | 3.7.0    | T1s040432 |
| TP-25    | TP-040149 | 384 | -   | Addition of RAB Package 3 test case 14.2.38e to RAB ATS V3.6.1  | B   | 3.5.1    | 3.7.0    | T1s040433 |
| TP-25    | TP-040149 | 385 | -   | Addition of RAB Package 2 test case 14.4.2.2 to RAB ATS V3.6.1  | B   | 3.5.1    | 3.7.0    | T1s040462 |
| TP-25    | TP-040149 | 386 | -   | Addition of RAB Package 2 test case 14.4.2.3 to RAB ATS V3.6.1  | B   | 3.6.1    | 3.7.0    | T1s040464 |
| TP-25    | TP-040149 | 387 | -   | Addition of RAB test case 14.2.51.1 to RAB ATS V3.6.0   | B   | 3.6.0    | 3.7.0    | T1s040466 |
| TP-25    | TP-040149 | 388 | -   | Addition of RAB test case 14.2.51a.1 to RAB ATS V3.6.0  | B   | 3.6.0    | 3.7.0    | T1s040468 |
| TP-25    | TP-040149 | 389 | -   | Addition of P3 test case 8.4.1.27 to RRC ATS V3.6.1   | B   | 3.6.1    | 3.7.0    | T1s040470 |
| TP-25    | TP-040149 | 390 | -   | Revision CR to introduce GCF P3 Test Case 8.4.1.24 to ATS V3.6.0  | B   | 3.5.1    | 3.7.0    | T1s040482 |
| TP-25    | TP-040149 | 391 | -   | Revision CR to introduce GCF P3 Test Case 8.4.1.25 to ATS v3.6.0  | B   | 3.5.1    | 3.7.0    | T1s040483 |
| TP-25    | TP-040149 | 392 | -   | Addition of NAS test case 9.4.7 to NAS ATS V3.6.0   | B   | 3.6.1    | 3.7.0    | T1s040513 |
| TP-25    | TP-040149 | 393 | -   | Addition of GCF P3 test case 8.4.1.34 to IR_U ATS v3.6.1  | B   | 3.6.1    | 3.7.0    | T1s040479 |
| TP-25    | TP-040148 | 394 | -   | TTCN correction to P2 test case 8.1.10.1  | F   | 3.5.2    | 3.7.0    | T1s040236 |
| TP-25    | TP-040148 | 395 | -   | Correction to Approved RRC Package 1 TC 8.3.1.1   | F   | 3.5.1    | 3.7.0    | T1s040334 |
| TP-25    | TP-040148 | 396 | -   | Correction to Package 2 NAS MM test case 9.4.2.2.1 to validate of LOCATION UPDATE REQUEST message and disable ATT flag. | F   | 3.5.1    | 3.7.0    | T1s040335 |
| TP-25    | TP-040148 | 397 | -   | Correction to RRC Package 2 TC 8.4.1.18 and TC 8.4.1.19 for inconsistency in System Information Block 12.               | F   | 3.5.1    | 3.7.0    | T1s040336 |
| TP-25    | TP-040148 | 398 | -   | Correction to Approved Package 1 RRC TC 8.1.2.2   | F   | 3.5.1    | 3.7.0    | T1s040341 |
| TP-25    | TP-040148 | 399 | -   | Corrections to RRC test case 6.2.1.1  | F   | 3.5.1    | 3.7.0    | T1s040347 |
| TP-25    | TP-040148 | 400 | -   | Corrections to RRC test case 6.2.1.6  | F   | 3.5.1    | 3.7.0    | T1s040349 |
| TP-25    | TP-040148 | 401 | -   | Correction to Approved RRC Package 1 TC 8.3.4.2   | F   | 3.5.0    | 3.7.0    | T1s040351 |
| TP-25    | TP-040148 | 402 | -   | Correction to Approved RRC Package 2 TC 8.2.4.3   | F   | 3.5.0    | 3.7.0    | T1s040363 |
| TP-25    | TP-040148 | 403 | -   | Correction to Approved RRC Package 1 TC 8.3.4.3   | F   | 3.6.0    | 3.7.0    | T1s040366 |
| TP-25    | TP-040148 | 404 | -   | Regression error corrections to wk17, wk20 and  | F   | 3.6.1    | 3.7.0    | T1s040367 |

| Meet-ing | TSG doc   | CR  | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|-----|-----|---|-----|----------|----------|-----------|
|          |           |     |     | wk23.   |     |          |          |           |
| TP-25    | TP-040148 | 405 | -   | TTCN Correction to GCF P2 IR_U 8.3.7.1 & 8.3.7.4  | F   | 3.6.0    | 3.7.0    | T1s040374 |
| TP-25    | TP-040148 | 406 | -   | Correction to Package 2 NAS CCMM test cases 9.4.8; for removal of 'USIM removal possible while UE is powered' support.                                  | F   | 3.6.1    | 3.7.0    | T1s040375 |
| TP-25    | TP-040148 | 407 | -   | Correction to RRC TC 8.3.2.4 on value of the wait timer started for the UE to enter Idle mode.  | F   | 3.6.1    | 3.7.0    | T1s040376 |
| TP-25    | TP-040148 | 408 | -   | Correction to RRC Package 2 TC 8.2.1.9 to handle cell update before configuring radio bearer from DCH to FACH.  | F   | 3.6.1    | 3.7.0    | T1s040377 |
| TP-25    | TP-040148 | 409 | -   | Correction to RRC TC 8.2.6.19 and 8.2.6.20 to add delay before switching to CELL_PCH/URA_PCH  | F   | 3.6.1    | 3.7.0    | T1s040378 |
| TP-25    | TP-040148 | 410 | -   | Correction to Package 3 RAB test case 14.2.27, 14.2.29, 14.2.31.1 and 14.2.32.1 for the dl_TxPower in DL DPCH Info during Radio Bearer Setup at the SS. | F   | 3.6.1    | 3.7.0    | T1s040383 |
| TP-25    | TP-040148 | 411 | -   | Correction to Package 2 RAB test case 14.4.3  | F   | 3.6.1    | 3.7.0    | T1s040384 |
| TP-25    | TP-040148 | 412 | -   | Correction to test steps "ts_ReceiveFirstSDUs_RB10" and "ts_ReceiveFirstSDUs_RB13" of Package 3 RAB test case 14.2.49.1                                 | F   | 3.6.1    | 3.7.0    | T1s040389 |
| TP-25    | TP-040148 | 423 | -   | TTCN Correction to test case 8.4.1.1 to RRC ATS V3.6.0  | F   | 3.6.0    | 3.7.0    | T1s040390 |
| TP-25    | TP-040148 | 413 | -   | Correction to GMM Package 2 approved TC 12.6.1.2 in handling Attach procedure.  | F   | 3.6.1    | 3.7.0    | T1s040402 |
| TP-25    | TP-040148 | 414 | -   | Delay to ensure the proper transmission of Cell Update Confirm in 8.3.4.2.  | F   | 3.6.1    | 3.7.0    | T1s040403 |
| TP-25    | TP-040148 | 415 | -   | Guard timer setting if registration is made to a PLMN different from the normal one   | F   | 3.6.1    | 3.7.0    | T1s040420 |
| TP-25    | TP-040148 | 416 | -   | Correction to RRC Package 2 TC 8.3.1.31.  | F   | 3.6.1    | 3.7.0    | T1s040422 |
| TP-25    | TP-040148 | 417 | -   | Correction to Package 2 RAB test case 14.4.3 to assign tcv_CN_Domain.   | F   | 3.6.1    | 3.7.0    | T1s040423 |
| TP-25    | TP-040148 | 418 | -   | Addition of a delay after reception of an RRC Connection Release Complete Message   | F   | 3.6.1    | 3.7.0    | T1s040424 |
| TP-25    | TP-040148 | 419 | -   | General correction for test cases where UE is switched off Cell(s) released and reconfigured  | F   | 3.6.1    | 3.7.0    | T1s040425 |
| TP-25    | TP-040148 | 422 | -   | Correction to Approved RRC Package 2 TC 8.3.1.22  | F   | 3.6.0    | 3.7.0    | T1s040426 |
| TP-25    | TP-040148 | 420 | -   | Corrections to RRC Package 3 TC 8.4.1.29 and 8.4.1.30.  | F   | 3.6.1    | 3.7.0    | T1s040429 |
| TP-25    | TP-040148 | 421 | -   | Correction to RRC TC 8.2.3.8 in ts_RRC_ReceiveRB_SetupCmpl.   | F   | 3.6.1    | 3.7.0    | T1s040478 |
| TP-25    | TP-040167 | 424 | -   | Addition of NAS test case 9.4.3.5 to NAS ATS V3.6.0   | B   | 3.6.0    | 3.7.0    | T1s040460 |
| TP-25    | TP-040167 | 425 | -   | Addition of GCF P4 test case 10.1.2.2.1 ATS V3.6.0  | B   | 3.6.0    | 3.7.0    | T1s040410 |
| TP-25    | TP-040167 | 426 | -   | Addition of GCF P4 test case 9.5.5 ATS V3.6.0   | B   | 3.6.0    | 3.7.0    | T1s040408 |
| TP-25    | TP-040167 | 427 | -   | Addition of NAS test case 12.6.1.3.2 to NAS ATS V3.6.0  | B   | 3.6.0    | 3.7.0    | T1s040456 |
| TP-25    | TP-040167 | 428 | -   | Addition of NAS test case 12.9.14 to NAS ATS V3.6.0   | B   | 3.6.0    | 3.7.0    | T1s040458 |
| TP-25    | TP-040167 | 429 | -   | Addition of NAS test case 12.4.1.3 to NAS ATS V3.6.0  | B   | 3.6.0    | 3.7.0    | T1s040452 |
| TP-25    | TP-040167 | 430 | -   | Addition of NAS test case 12.9.3 to NAS ATS V3.6.0  | B   | 3.6.0    | 3.7.0    | T1s040519 |
| TP-25    | TP-040167 | 431 | -   | Addition of NAS test case 12.9.4 to NAS ATS V3.6.0  | B   | 3.6.0    | 3.7.0    | T1s040521 |
| TP-25    | TP-040167 | 432 | -   | Addition of RRC test case 8.2.2.4 to RRC ATS V3.6.0   | B   | 3.6.0    | 3.7.0    | T1s040515 |
| TP-25    | TP-040167 | 433 | -   | Addition of RRC test case 8.2.6.12 to RRC ATS V3.6.0  | B   | 3.6.0    | 3.7.0    | T1s040517 |
| TP-25    | TP-040167 | 434 | -   | Addition of RAB test case 14.2.38c to RAB ATS V3.6.0  | B   | 3.6.0    | 3.7.0    | T1s040527 |
| TP-25    | TP-040167 | 435 | -   | Addition of RAB test case 14.2.38f to RAB ATS V3.6.0  | B   | 3.6.0    | 3.7.0    | T1s040529 |
| TP-25    | TP-040167 | 436 | -   | Addition of RAB test case 14.2.40 to RAB ATS V3.6.0   | B   | 3.6.0    | 3.7.0    | T1s040523 |
| TP-25    | TP-040167 | 437 | -   | Addition of RAB test case 14.2.41 to RAB ATS V3.6.0   | B   | 3.6.0    | 3.7.0    | T1s040525 |
| TP-25    | TP-040167 | 438 | -   | Addition of RRC Package 4 test case 8.1.3.5 to RRC ATS V3.6.1   | B   | 3.6.1    | 3.7.0    | T1s040500 |
| TP-25    | TP-040167 | 439 | -   | Addition of RRC Package 4 test case 8.2.1.4 to RRC ATS V3.6.1   | B   | 3.6.1    | 3.7.0    | T1s040502 |
| TP-25    | TP-040167 | 440 | -   | Addition of RRC Package 4 test case 8.2.1.7 to RRC ATS V3.6.1   | B   | 3.6.1    | 3.7.0    | T1s040504 |
| TP-25    | TP-040167 | 441 | -   | Addition of RRC Package 4 test case 8.1.2.3 to RRC ATS V3.6.1   | B   | 3.6.1    | 3.7.0    | T1s040498 |
| TP-25    | TP-040167 | 442 | -   | Addition of P4 RRC test case 8.3.2.9  | B   | 3.6.1    | 3.7.0    | T1s040495 |
| TP-25    | TP-040167 | 443 | -   | Addition of P4 RRC test case 8.2.6.2  | B   | 3.6.1    | 3.7.0    | T1s040573 |
| TP-25    | TP-040167 | 444 | -   | Addition of P4 RRC test case 8.3.1.17   | B   | 3.6.1    | 3.7.0    | T1s040493 |
| TP-25    | TP-040167 | 445 | -   | Addition of P4 RRC test case 8.1.6.1  | B   | 3.6.1    | 3.7.0    | T1s040489 |
| TP-25    | TP-040167 | 446 | -   | Addition of GCF P4 test case 8.3.1.12 to RRC ATS V3.6.0   | B   | 3.6.0    | 3.7.0    | T1s040446 |

| Meet-ing | TSG doc   | CR   | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|--|-----|----------|----------|-----------|
| TP-25    | TP-040167 | 447  | -   | Addition of GCF P4 test case 8.2.6.11 to RRC ATS V3.6.0                            | B   | 3.6.0    | 3.7.0    | T1s040444 |
| TP-25    | TP-040167 | 448  | -   | Addition of GCF P4 test case 9.5.4 ATS V3.6.0                                      | B   | 3.6.0    | 3.7.0    | T1s040440 |
| TP-25    | TP-040167 | 449  | -   | Addition of P3 test case 8.4.1.37 to RRC ATS V3.6.1                                | B   | 3.6.1    | 3.7.0    | T1s040474 |
| TP-25    | TP-040167 | 450  | -   | Addition of P3 test case 8.4.1.38 to RRC ATS V3.6.1                                | B   | 3.6.1    | 3.7.0    | T1s040476 |
| TP-25    | TP-040167 | 451  | -   | Addition of GCF P4 test case 12.2.1.2 ATS V3.6.0                                   | B   | 3.6.0    | 3.7.0    | T1s040450 |
| TP-25    | TP-040167 | 452  | -   | Addition of RAB Package 3 test case 14.2.38b to RAB ATS V3.6.1                     | B   | 3.6.1    | 3.7.0    | T1s040533 |
| TP-25    | TP-040167 | 453  | -   | Modification to MAC Package 2 test case 7.1.3.1                                    | F   | 3.6.1    | 3.7.0    | T1s040531 |
| TP-25    | TP-040167 | 454  | -   | Correction to NAS test cases 9.4.2.3 (P2), 9.4.2.4 Proc 2 (P2), and 12.4.1.1a (P1) | F   | 3.6.1    | 3.7.0    | T1s040514 |
| TP-25    | TP-040167 | 455  | -   | Correction to Package 3 SMS test case 16.2.1.                                      | F   | 3.6.1    | 3.7.0    | T1s040497 |
| TP-25    | TP-040167 | 456  | -   | Correction to GCF P1 test case 8.3.1.1   | F   | 3.6.0    | 3.7.0    | T1s040484 |
| TP-25    | TP-040193 | 460  | -   | Updating Annex A   | F   | 3.6.1    | 3.7.0    | -         |
| TP-26    | TP-040237 | 463  | -   | ASP change for Radio Link Modification   | F   | 3.7.0    | 3.8.0    | T1-041694 |
| TP-26    | TP-040237 | 461  | -   | ASP update and other corrections   | F   | 3.7.0    | 3.8.0    | T1-041975 |
| TP-26    | TP-040237 | 462  | -   | Addition of AT command lists used in ATSS  | F   | 3.7.0    | 3.8.0    | T1-041976 |
| TP-26    | TP-040238 | 1185 | -   | Updating Annex A   | F   | 3.7.0    | 3.8.0    | -         |
| TP-26    | TP-040241 | 1050 | -   | Addition of GCF P4 test case 8.2.2.35 to RRC ATS V3.7.0                            | B   | 3.7.0    | 3.8.0    | T1s040743 |
| TP-26    | TP-040241 | 1051 | -   | Addition of RRC test case 8.3.1.18 to RRC ATS V3.7.0                               | B   | 3.7.0    | 3.8.0    | T1s040448 |
| TP-26    | TP-040241 | 1052 | -   | Addition of GCF P1 test case 8.4.1.5 to RRC ATS v3.7.0                             | B   | 3.7.0    | 3.8.0    | T1s040739 |
| TP-26    | TP-040241 | 1053 | -   | Addition of GCF P4 test case 8.1.7.1d to RRC ATS v3.7.0                            | B   | 3.7.0    | 3.8.0    | T1s040717 |
| TP-26    | TP-040241 | 1054 | -   | Addition of RRC Package 3 test case 6.1.1.5 to RRC ATS V3.7.0                      | B   | 3.7.0    | 3.8.0    | T1s040698 |
| TP-26    | TP-040241 | 1055 | -   | Addition of GCF P4 test case 12.2.1.4.1 ATS V3.7.0                                 | B   | 3.7.0    | 3.8.0    | T1s040690 |
| TP-26    | TP-040241 | 1056 | -   | Addition of GCF P4 test case 12.4.1.4a ATS V3.7.0                                  | B   | 3.7.0    | 3.8.0    | T1s040679 |
| TP-26    | TP-040241 | 1057 | -   | Addition of RRC test case 8.2.3.29 to RRC ATS V3.7.0 (Revision of T1s040688)       | B   | 3.7.0    | 3.8.0    | T1s040703 |
| TP-26    | TP-040241 | 1058 | -   | Changes to GCF package 2 IR_U test case 12.8 required for approval                 | B   | 3.7.0    | 3.8.0    | T1s040615 |
| TP-26    | TP-040241 | 1059 | -   | Addition of P4 test case 8.3.11.1 to IR_U ATS v3.7.0, (Revision of T1s040633).     | B   | 3.7.0    | 3.8.0    | T1s040684 |
| TP-26    | TP-040241 | 1060 | -   | Addition of GCF P4 test cases 8.1.7.1c to RRC ATS v3.7.0                           | B   | 3.7.0    | 3.8.0    | T1s040677 |
| TP-26    | TP-040241 | 1061 | -   | Correction to Package 4 test case 12.9.7b ATS V3.7.0                               | B   | 3.7.0    | 3.8.0    | T1s040674 |
| TP-26    | TP-040241 | 1062 | -   | Addition of GCF P4 test case 12.4.1.4b ATS V3.7.0                                  | B   | 3.7.0    | 3.8.0    | T1s040628 |
| TP-26    | TP-040241 | 1063 | -   | Correction to Package 4 GMM test case 12.4.1.1b (Revised CR T1s040467)             | B   | 3.7.0    | 3.8.0    | T1s040656 |
| TP-26    | TP-040241 | 1064 | -   | Addition of RRC test case 8.3.1.24 to RRC ATS V3.7.0                               | B   | 3.7.0    | 3.8.0    | T1s040671 |
| TP-26    | TP-040241 | 1065 | -   | Addition of RRC test case 8.3.2.2 to RRC ATS V3.7.0                                | B   | 3.7.0    | 3.8.0    | T1s040669 |
| TP-26    | TP-040241 | 1066 | -   | Addition of NAS test case 12.4.1.4c2 to NAS ATS V3.7.0                             | B   | 3.7.0    | 3.8.0    | T1s040664 |
| TP-26    | TP-040241 | 1067 | -   | Addition of RRC test case 8.3.1.25 to RRC ATS V3.7.0                               | B   | 3.7.0    | 3.8.0    | T1s040658 |
| TP-26    | TP-040241 | 1068 | -   | Addition of NAS test case 12.6.1.3.3 to NAS ATS V3.7.0                             | B   | 3.7.0    | 3.8.0    | T1s040651 |
| TP-26    | TP-040241 | 1069 | -   | Addition of RRC test case 8.3.2.13 to RRC ATS V3.7.0                               | B   | 3.7.0    | 3.8.0    | T1s040653 |
| TP-26    | TP-040241 | 1070 | -   | Addition of P4 test case 8.1.3.4 to the RRC ATS V3.7.0                             | B   | 3.7.0    | 3.8.0    | T1s040649 |
| TP-26    | TP-040241 | 1071 | -   | Addition of P4 test case 8.3.7.13 to IR_U ATS v3.7.0                               | B   | 3.7.0    | 3.8.0    | T1s040638 |
| TP-26    | TP-040241 | 1072 | -   | Addition of P4 test case 8.3.7.7 to IR_U ATS v3.7.0                                | B   | 3.7.0    | 3.8.0    | T1s040640 |
| TP-26    | TP-040241 | 1073 | -   | Addition of NAS test case 12.9.8 to NAS ATS V3.7.0                                 | B   | 3.7.0    | 3.8.0    | T1s040613 |
| TP-26    | TP-040241 | 1074 | -   | Addition of NAS test case 12.4.1.4d1 to NAS ATS V3.7.0                             | B   | 3.7.0    | 3.8.0    | T1s040635 |
| TP-26    | TP-040241 | 1075 | -   | Addition of P2 test case 6.2.1.9 to IR_U ATS v3.7.0                                | B   | 3.7.0    | 3.8.0    | T1s040604 |
| TP-26    | TP-040241 | 1076 | -   | Addition of GCF P4 test case 12.2.1.5b ATS V3.7.0                                  | B   | 3.7.0    | 3.8.0    | T1s040595 |
| TP-26    | TP-040241 | 1077 | -   | Addition of GCF P4 test case 12.9.7c ATS V3.7.0                                    | B   | 3.7.0    | 3.8.0    | T1s040587 |
| TP-26    | TP-040241 | 1078 | -   | Addition of GCF P4 test case 8.2.2.31 to RRC ATS V3.7.0                            | B   | 3.7.0    | 3.8.0    | T1s040485 |
| TP-26    | TP-040241 | 1079 | -   | Addition of RAB Package 4 test case 14.4.2a.3 to RAB ATS V3.7.0                    | B   | 3.7.0    | 3.8.0    | T1s040626 |
| TP-26    | TP-040241 | 1080 | -   | Addition of RAB Package 4 test case 14.4.2a.2 to RAB ATS V3.7.0                    | B   | 3.7.0    | 3.8.0    | T1s040624 |
| TP-26    | TP-040241 | 1081 | -   | Addition of RAB Package 4 test case 14.4.2a.1 to RAB ATS V3.7.0                    | B   | 3.7.0    | 3.8.0    | T1s040622 |

| Meet-ing | TSG doc   | CR   | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|--|-----|----------|----------|-----------|
| TP-26    | TP-040241 | 1082 | -   | Addition of RRC Package 4 test case 8.2.3.11 to RRC ATS V3.7.0   | B   | 3.7.0    | 3.8.0    | T1s040620 |
| TP-26    | TP-040241 | 1083 | -   | Addition of NAS test case 12.4.3.4 to NAS ATS V3.7.0   | B   | 3.7.0    | 3.8.0    | T1s040609 |
| TP-26    | TP-040241 | 1084 | -   | Addition of NAS test case 12.9.6 to NAS ATS V3.7.0   | B   | 3.7.0    | 3.8.0    | T1s040607 |
| TP-26    | TP-040241 | 1085 | -   | Changes to GCF package 4 IR_U test case 8.3.7.9 required for approval.   | B   | 3.7.0    | 3.8.0    | T1s040552 |
| TP-26    | TP-040241 | 1086 | -   | Changes to GCF package 4 IR_U test case 8.3.7.5 required for approval.   | B   | 3.7.0    | 3.8.0    | T1s040548 |
| TP-26    | TP-040241 | 1087 | -   | Addition of GCF P4 test case 12.4.1.2 ATS V3.6.0   | B   | 3.7.0    | 3.8.0    | T1s040585 |
| TP-26    | TP-040241 | 1088 | -   | Addition of GCF P4 test case 10.1.2.2.3 ATS V3.6.0   | B   | 3.7.0    | 3.8.0    | T1s040412 |
| TP-26    | TP-040241 | 1089 | -   | Addition of GCF P4 test case 9.5.7.1 ATS V3.6.0  | B   | 3.7.0    | 3.8.0    | T1s040404 |
| TP-26    | TP-040241 | 1090 | -   | Addition of GCF P4 test cases 8.1.12 to RRC ATS v3.6.1   | B   | 3.7.0    | 3.8.0    | T1s040602 |
| TP-26    | TP-040241 | 1091 | -   | Addition of GCF P4 test cases 8.1.7.1b to RRC ATS v3.6.1   | B   | 3.7.0    | 3.8.0    | T1s040600 |
| TP-26    | TP-040241 | 1092 | -   | Addition of GCF P4 test case 12.2.1.6.2 ATS V3.6.0   | B   | 3.7.0    | 3.8.0    | T1s040436 |
| TP-26    | TP-040241 | 1093 | -   | Addition of GCF P4 test case 12.2.1.5a.1 ATS V3.6.0  | B   | 3.7.0    | 3.8.0    | T1s040434 |
| TP-26    | TP-040241 | 1094 | -   | Addition of GCF P4 test case 8.3.1.15 to RRC ATS V3.6.0  | B   | 3.7.0    | 3.8.0    | T1s040487 |
| TP-26    | TP-040241 | 1095 | -   | Addition of GCF P4 test case 8.1.2.4 ATS V3.6.0  | B   | 3.7.0    | 3.8.0    | T1s040442 |
| TP-26    | TP-040241 | 1096 | -   | Addition of NAS test case 12.4.1.4d2 to NAS ATS V3.6.0   | B   | 3.7.0    | 3.8.0    | T1s040579 |
| TP-26    | TP-040241 | 1097 | -   | Addition of GCF P3 test case 6.1.1.7 ATS V3.6.0  | B   | 3.7.0    | 3.8.0    | T1s040427 |
| TP-26    | TP-040241 | 1098 | -   | Addition of GCF P3 test case 12.4.2.5a.1 ATS V3.6.0  | B   | 3.7.0    | 3.8.0    | T1s040472 |
| TP-26    | TP-040241 | 1099 | -   | Re-submission of GCF package 2 IR_U test case 6.2.2.1 for approval.  | B   | 3.7.0    | 3.8.0    | T1s040534 |
| TP-26    | TP-040241 | 1100 | -   | Addition of RAB test case 14.2.51b.1 to RAB ATS V3.6.0   | B   | 3.7.0    | 3.8.0    | T1s040570 |
| TP-26    | TP-040241 | 1101 | -   | Addition of RRC test case 10.1.2.3.7 to RRC ATS V3.6.1   | B   | 3.7.0    | 3.8.0    | T1s040508 |
| TP-26    | TP-040241 | 1102 | -   | Addition of RRC test case 10.1.2.7.1 to RRC ATS V3.6.1   | B   | 3.7.0    | 3.8.0    | T1s040510 |
| TP-26    | TP-040241 | 1103 | -   | Addition of RRC test case 10.1.2.3.2 to RRC ATS V3.6.1   | B   | 3.7.0    | 3.8.0    | T1s040506 |
| TP-26    | TP-040241 | 1104 | -   | Addition of NAS Package 4 test case 12.2.1.6 Proc1 to NAS ATS V3.6.1   | B   | 3.7.0    | 3.8.0    | T1s040565 |
| TP-26    | TP-040241 | 1105 | -   | Addition of NAS Package 4 test case 12.2.1.4 proc2 to NAS ATS V3.6.1   | B   | 3.7.0    | 3.8.0    | T1s040561 |
| TP-26    | TP-040241 | 1106 | -   | Addition of NAS Package 4 test case 12.2.1.5a Proc2 to NAS ATS V3.6.1  | B   | 3.7.0    | 3.8.0    | T1s040563 |
| TP-26    | TP-040241 | 1107 | -   | Addition of NAS Package 4 test case 12.2.1.10 to NAS ATS V3.6.1  | B   | 3.7.0    | 3.8.0    | T1s040559 |
| TP-26    | TP-040241 | 1108 | -   | Addition of RAB test case 14.2.23a2 to RAB ATS V3.6.0  | B   | 3.7.0    | 3.8.0    | T1s040556 |
| TP-26    | TP-040241 | 1109 | -   | Addition of NAS test case 12.6.1.3.1 to NAS ATS V3.6.0   | B   | 3.7.0    | 3.8.0    | T1s040454 |
| TP-26    | TP-040241 | 1110 | -   | Addition of GCF P2 RRC 8.4.1.7 - Revision of T1s040381   | B   | 3.7.0    | 3.8.0    | T1s040766 |
| TP-26    | TP-040242 | 1111 | -   | Correction to RRC P3 TC 8.4.1.37   | F   | 3.7.0    | 3.8.0    | T1s040735 |
| TP-26    | TP-040242 | 1112 | -   | Correction to RRC P2 TC 8.3.1.31 for the timer value before step 5.  | F   | 3.7.0    | 3.8.0    | T1s040736 |
| TP-26    | TP-040242 | 1113 | -   | Correction to approved GCF P4 test cases 8.1.7.1c  | F   | 3.7.0    | 3.8.0    | T1s040734 |
| TP-26    | TP-040242 | 1114 | -   | Correction to approved package 4 NAS Test case tc_12_6_1_3_2   | F   | 3.7.0    | 3.8.0    | T1s040737 |
| TP-26    | TP-040242 | 1115 | -   | Corrections to RRC Package 1 TC 8.4.1.1.   | F   | 3.7.0    | 3.8.0    | T1s040738 |
| TP-26    | TP-040242 | 1116 | -   | Correction to the RRC default message handler on Dc SAP for Deactivate PDP Context Request message in RRC ATS. | F   | 3.7.0    | 3.8.0    | T1s040731 |
| TP-26    | TP-040242 | 1117 | -   | Correction to TTCN for MultiRAB test cases.  | F   | 3.7.0    | 3.8.0    | T1s040732 |
| TP-26    | TP-040242 | 1118 | -   | Correction to approved package 4 NAS Test case tc_12_6_1_3_1   | F   | 3.7.0    | 3.8.0    | T1s040733 |
| TP-26    | TP-040242 | 1119 | -   | Summary of regression errors in the wk45 ATS.  | F   | 3.7.0    | 3.8.0    | T1s040723 |
| TP-26    | TP-040242 | 1120 | -   | Correction to RRC P4 TC 8.1.7.1b for comments in test steps.   | F   | 3.7.0    | 3.8.0    | T1s040711 |
| TP-26    | TP-040242 | 1121 | -   | Correction to GCF P3 NAS test Cases 13.2.1.1, 13.2.2.1 and 13.2.2.2  | F   | 3.7.0    | 3.8.0    | T1s040712 |
| TP-26    | TP-040242 | 1122 | -   | Correction to GCF P4 NAS test Case 12.2.1.6.2  | F   | 3.7.0    | 3.8.0    | T1s040713 |
| TP-26    | TP-040242 | 1123 | -   | Correction to RAB test case 14.4.2.3 and 14.4.2a.3.  | F   | 3.7.0    | 3.8.0    | T1s040714 |
| TP-26    | TP-040242 | 1124 | -   | Correction to RRC Package 2 TC 8.3.1.3.  | F   | 3.7.0    | 3.8.0    | T1s040722 |
| TP-26    | TP-040242 | 1125 | -   | Correction to AT Command used for GCF P1 NAS test Case 10.1.2.5.1  | F   | 3.7.0    | 3.8.0    | T1s040724 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
| TP-26    | TP-040242 | 1126 | -   | Correction in TTCN for execution of Opmode C UE.  | F   | 3.7.0    | 3.8.0    | T1s040725 |
| TP-26    | TP-040242 | 1127 | -   | Correction to RRC Package 4 TC 8.1.2.3  | F   | 3.7.0    | 3.8.0    | T1s040726 |
| TP-26    | TP-040242 | 1128 | -   | Correction to RRC test cases 8.1.2.1 and 8.1.2.7  | F   | 3.7.0    | 3.8.0    | T1s040727 |
| TP-26    | TP-040242 | 1130 | -   | Correction to RRC test cases 8.1.3.1, 8.1.3.3, 8.1.3.4 and 8.1.3.5  | F   | 3.7.0    | 3.8.0    | T1s040729 |
| TP-26    | TP-040242 | 1131 | -   | Correction to RRC Package 1 TC 8.1.2.9  | F   | 3.7.0    | 3.8.0    | T1s040730 |
| TP-26    | TP-040242 | 1132 | -   | Correction to Package 2 RRC test case 8.3.1.4   | F   | 3.7.0    | 3.8.0    | T1s040721 |
| TP-26    | TP-040242 | 1133 | -   | Correction to Package 3 RRC inter-RAT measurement test cases 8.4.1.31 + 8.4.1.33 + 8.4.1.34 + 8.4.1.35 + 8.4.1.36 + 8.4.1.40  | F   | 3.7.0    | 3.8.0    | T1s040715 |
| TP-26    | TP-040242 | 1134 | -   | Correction to approved NAS test case 12.9.4   | F   | 3.7.0    | 3.8.0    | T1s040716 |
| TP-26    | TP-040242 | 1135 | -   | Correction to Approved RRC Package 2 TC 8.3.7.2   | F   | 3.7.0    | 3.8.0    | T1s040709 |
| TP-26    | TP-040242 | 1136 | -   | Correction to Approved RRC Package 3 TC 8.2.4.1a  | F   | 3.7.0    | 3.8.0    | T1s040708 |
| TP-26    | TP-040242 | 1137 | -   | Correction to Approved RRC Package 3 TC 8.4.1.31  | F   | 3.7.0    | 3.8.0    | T1s040707 |
| TP-26    | TP-040242 | 1138 | -   | Correction to GCF P2 test cases 6.2.1.1, 6.2.1.6 and 6.2.1.9 to IR_U ATS v3.7.0 to check the displayed PLMN.                  | F   | 3.7.0    | 3.8.0    | T1s040693 |
| TP-26    | TP-040242 | 1139 | -   | Correction to Package 2 RAB test case 14.4.2.2 and 14.4.2.3.  | F   | 3.7.0    | 3.8.0    | T1s040697 |
| TP-26    | TP-040242 | 1140 | -   | Correction to GCF P4 NAS test Case 12.4.1.2 (Revision of T1-040673)   | F   | 3.7.0    | 3.8.0    | T1s040696 |
| TP-26    | TP-040242 | 1141 | -   | Correction of GCF P1 test case 7.2.3.23   | F   | 3.7.0    | 3.8.0    | T1s040694 |
| TP-26    | TP-040242 | 1142 | -   | Global correction of Structured Type Constraints containing wildcards violating coding convention E.3.7                       | F   | 3.7.0    | 3.8.0    | T1s040695 |
| TP-26    | TP-040242 | 1143 | -   | Correction to GCF P4 RRC test Case 8.3.1.15   | F   | 3.7.0    | 3.8.0    | T1s040675 |
| TP-26    | TP-040242 | 1144 | -   | Extension to Guard Timer for Approved NAS GMM Test Cases  | F   | 3.7.0    | 3.8.0    | T1s040692 |
| TP-26    | TP-040242 | 1145 | -   | Correction to RRC TC 8.1.12 for handling correct number of RRC Connection Release Complete message based on the value of N308 | F   | 3.7.0    | 3.8.0    | T1s040687 |
| TP-26    | TP-040242 | 1146 | -   | Corrections Required for the wk42 ATS   | F   | 3.7.0    | 3.8.0    | T1s040682 |
| TP-26    | TP-040242 | 1147 | -   | Corrections to release of SS resources for a cell during test case execution  | F   | 3.7.0    | 3.8.0    | T1s040681 |
| TP-26    | TP-040242 | 1148 | -   | Correction to approved RRC Package 1 8.3.1.1  | F   | 3.7.0    | 3.8.0    | T1s040668 |
| TP-26    | TP-040242 | 1149 | -   | Correction to approved RRC Package 4 TC 8.2.6.11  | F   | 3.7.0    | 3.8.0    | T1s040667 |
| TP-26    | TP-040242 | 1150 | -   | Regression test error corrections to TTCN deliveries of wk40  | F   | 3.7.0    | 3.8.0    | T1s040666 |
| TP-26    | TP-040242 | 1151 | -   | Correction of GCF P1 test case 7.2.3.14   | F   | 3.7.0    | 3.8.0    | T1s040660 |
| TP-26    | TP-040242 | 1152 | -   | Correction of GCF P1 test case 11.1.1.1   | F   | 3.7.0    | 3.8.0    | T1s040661 |
| TP-26    | TP-040242 | 1153 | -   | Correction of GCF P3 SMS test cases 16.1.1, 16.1.2, 16.1.9.1, 16.1.9.2, 16.1.10, 16.2.1, 16.2.2, 16.2.10                      | F   | 3.7.0    | 3.8.0    | T1s040662 |
| TP-26    | TP-040242 | 1154 | -   | Corrections Required for the wk40 ATS   | F   | 3.7.0    | 3.8.0    | T1s040663 |
| TP-26    | TP-040242 | 1155 | -   | Correction to Approved RRC Package 2 TC 8.2.4.3   | F   | 3.7.0    | 3.8.0    | T1s040655 |
| TP-26    | TP-040242 | 1156 | -   | Correction to Package 3 SMS test cases.   | F   | 3.7.0    | 3.8.0    | T1s040637 |
| TP-26    | TP-040242 | 1157 | -   | Correction to approved package 4 NAS Test case tc_12_4_1_4d2  | F   | 3.7.0    | 3.8.0    | T1s040648 |
| TP-26    | TP-040242 | 1158 | -   | Correction to Package 4 NAS test case 12.2.1.2 for increasing the guard timer.  | F   | 3.7.0    | 3.8.0    | T1s040630 |
| TP-26    | TP-040242 | 1159 | -   | Regression error corrections to TTCN deliveries of wk34 and wk37  | F   | 3.7.0    | 3.8.0    | T1s040636 |
| TP-26    | TP-040242 | 1160 | -   | Summary of regression errors in the wk37 ATS.   | F   | 3.7.0    | 3.8.0    | T1s040617 |
| TP-26    | TP-040242 | 1161 | -   | Correction to RRC Package 1 test cases 8.1.7.1 and 8.1.7.2 (Revision of T1s040532)  | F   | 3.7.0    | 3.8.0    | T1s040618 |
| TP-26    | TP-040242 | 1162 | -   | Corrections Required for the wk37 ATS (Revision of T1s040606)   | F   | 3.7.0    | 3.8.0    | T1s040619 |
| TP-26    | TP-040242 | 1163 | -   | Correction to Package 2 RRC test case 8.3.2.11 to increase the timer while waiting for URA Update.                            | F   | 3.7.0    | 3.8.0    | T1s040599 |
| TP-26    | TP-040242 | 1164 | -   | Correction to Approved RRC Package 1 TC 8.1.2.2   | F   | 3.7.0    | 3.8.0    | T1s040584 |
| TP-26    | TP-040242 | 1165 | -   | Radiolink removal and subsequent addition to align the TTCN with 34.123-1   | F   | 3.7.0    | 3.8.0    | T1s040583 |
| TP-26    | TP-040242 | 1166 | -   | TTCN Correction to Test Case 14.2.12 and 14.2.16  | F   | 3.7.0    | 3.8.0    | T1s040581 |
| TP-26    | TP-040242 | 1167 | -   | Correction to Approved RRC Package 2 TC 8.4.1.2   | F   | 3.7.0    | 3.8.0    | T1s040582 |
| TP-26    | TP-040242 | 1168 | -   | Corrections to GCF package 2 IR_U test case 6.2.1.1   | F   | 3.7.0    | 3.8.0    | T1s040536 |
| TP-26    | TP-040242 | 1169 | -   | Corrections to GCF package 2 IR_U test case 6.2.1.6   | F   | 3.7.0    | 3.8.0    | T1s040538 |
| TP-26    | TP-040242 | 1170 | -   | Correction of GCF package 2 IR_U test case 8.3.7.1.   | F   | 3.7.0    | 3.8.0    | T1s040540 |
| TP-26    | TP-040242 | 1171 | -   | Correction of GCF package 2 IR_U test case 8.3.7.2.   | F   | 3.7.0    | 3.8.0    | T1s040542 |
| TP-26    | TP-040242 | 1172 | -   | Correction of GCF package 2 IR_U test case 8.3.7.3.   | F   | 3.7.0    | 3.8.0    | T1s040544 |
| TP-26    | TP-040242 | 1173 | -   | Correction of GCF package 2 IR_U test case 8.3.7.4.   | F   | 3.7.0    | 3.8.0    | T1s040546 |
| TP-26    | TP-040242 | 1174 | -   | Correction of GCF package 2 IR_U test case 8.4.1.40.  | F   | 3.7.0    | 3.8.0    | T1s040554 |
| TP-26    | TP-040242 | 1175 | -   | TTCN changes to approved package 1 RRC testcase 8.4.1.3   | F   | 3.7.0    | 3.8.0    | T1s040576 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
| TP-26    | TP-040242 | 1176 | -   | Correction to MultiRAB test cases 14.2.38a, 14.2.38b and 14.2.38e   | F   | 3.7.0    | 3.8.0    | T1s040575 |
| TP-26    | TP-040242 | 1177 | -   | Correction to Approved RRC Package 2 TC 8.4.1.2   | F   | 3.7.0    | 3.8.0    | T1s040572 |
| TP-26    | TP-040242 | 1178 | -   | Addition of verdicts in RRC default message handler on Dc SAP for Deactivate PDP Context Request message in RRC ATS.(Revision of T1s040512) | F   | 3.7.0    | 3.8.0    | T1s040569 |
| TP-26    | TP-040242 | 1179 | -   | Regression error corrections to TTCN deliveries of wk26 and wk31  | F   | 3.7.0    | 3.8.0    | T1s040558 |
| TP-26    | TP-040242 | 1180 | -   | Modification to MAC Package 2 test case 7.1.3.1   | F   | 3.7.0    | 3.8.0    | T1s040531 |
| TP-26    | TP-040242 | 1181 | -   | Correction to NAS test cases 9.4.2.3 (P2), 9.4.2.4 Proc 2 (P2), and 12.4.1.1a (P1)  | F   | 3.7.0    | 3.8.0    | T1s040514 |
| TP-26    | TP-040242 | 1182 | -   | Correction to Package 3 SMS test case 16.2.1.   | F   | 3.7.0    | 3.8.0    | T1s040497 |
| TP-26    | TP-040242 | 1183 | -   | Correction to GCF P1 test case 8.3.1.1  | F   | 3.7.0    | 3.8.0    | T1s040484 |
| TP-26    | TP-040242 | 1184 | -   | Regression test error corrections to TTCN deliveries of wk42  | F   | 3.7.0    | 3.8.0    | T1s040699 |
| TP-27    | TP-050039 | 1185 |     | RRC Connection Establishment: Reject with InterRATInfo is set to GSM and selection to the designated system fails                           | B   | 3.8.0    | 5.0.0    | T1s050056 |
| TP-27    | TP-050039 | 1186 |     | RRC Connection Establishment: Reject with interRATInfo is set to GSM  | B   | 3.8.0    | 5.0.0    | T1s050054 |
| TP-27    | TP-050039 | 1187 |     | MM connection / abortion by the network / cause not equal to #6   | B   | 3.8.0    | 5.0.0    | T1s050044 |
| TP-27    | TP-050039 | 1188 |     | PS detach / rejected / PS services not allowed in this PLMN/ test1  | B   | 3.8.0    | 5.0.0    | T1s050046 |
| TP-27    | TP-050039 | 1189 |     | Routing area updating / abnormal cases / attempt counter check / miscellaneous reject causes  | B   | 3.8.0    | 5.0.0    | T1s050018 |
| TP-27    | TP-050039 | 1190 |     | RRC / Paging for Connection in connected mode (URA_PCH, multiple paging records)  | B   | 3.8.0    | 5.0.0    | T1s050038 |
| TP-27    | TP-050039 | 1191 |     | Combined routing area updating / abnormal cases / access barred due to access class control / test procedure 1                              | B   | 3.8.0    | 5.0.0    | T1s050036 |
| TP-27    | TP-050039 | 1192 |     | Combined routing area updating / abnormal cases / access barred due to access class control / test procedure 2                              | B   | 3.8.0    | 5.0.0    | T1s050034 |
| TP-27    | TP-050039 | 1193 |     | Interactive or background / UL:64 DL:384 kbps / PS RAB + UL:3.4 DL: 3.4 kbps SRBs for DCCH / 20 ms TTI                                      | B   | 3.8.0    | 5.0.0    | T1s050025 |
| TP-27    | TP-050039 | 1194 |     | Measurement Report on INITIAL DIRECT TRANSFER message and UPLINK DIRECT TRANSFER message  | B   | 3.8.0    | 5.0.0    | T1s050031 |
| TP-27    | TP-050039 | 1195 |     | Conversational / speech / UL:5.9 DL:5.9 kbps / CS RAB + UL:3.4 DL:3.4 kbps SRBs for DCCH  | B   | 3.8.0    | 5.0.0    | T1s050023 |
| TP-27    | TP-050039 | 1196 |     | Interactive or background / UL:384 DL:384 kbps / PS RAB + UL:3.4 DL:3.4 kbps SRBs for DCCH / 10 ms TTI                                      | B   | 3.8.0    | 5.0.0    | T1s050010 |
| TP-27    | TP-050039 | 1197 |     | Interactive or background / UL:128 DL:128 kbps / PS RAB + UL:3.4 DL:3.4 kbps SRBs for DCCH  | B   | 3.8.0    | 5.0.0    | T1s050008 |
| TP-27    | TP-050039 | 1198 |     | Cell change order from UTRAN/To GPRS/CELL_DCH/Failure (Physical channel & Reversion Failure)  | B   | 3.8.0    | 5.0.0    | T1s050001 |
| TP-27    | TP-050039 | 1199 |     | RRC Connection Release in CELL_DCH state (Network Authentication Failure): Success  | B   | 3.8.0    | 5.0.0    | T1s050006 |
| TP-27    | TP-050039 | 1200 |     | Inter system handover from UTRAN/To GSM/Speech/Failure (Physical channel Failure and Reversion Failure)                                     | B   | 3.8.0    | 5.0.0    | T1s040798 |
| TP-27    | TP-050039 | 1201 |     | Cell reselection using cell status and cell reservations  | B   | 3.8.0    | 5.0.0    | T1s040794 |
| TP-27    | TP-050039 | 1202 |     | RRC / Radio Bearer Establishment for transition from CELL_DCH to CELL_FACH (Frequency band modification): Success                           | B   | 3.8.0    | 5.0.0    | T1s040796 |
| TP-27    | TP-050039 | 1203 |     | Correct Selection of RACH parameters (FDD)  | B   | 3.8.0    | 5.0.0    | T1s040755 |
| TP-27    | TP-050039 | 1204 |     | Measurement Control and Report: Additional Measurements list  | B   | 3.8.0    | 5.0.0    | T1s040791 |
| TP-27    | TP-050039 | 1205 |     | PS attach / rejected / PS services not allowed in this PLMN   | B   | 3.8.0    | 5.0.0    | T1s040779 |
| TP-27    | TP-050039 | 1206 |     | Access Service class selection for RACH transmission  | B   | 3.8.0    | 5.0.0    | T1s040757 |
| TP-27    | TP-050039 | 1207 |     | Selection of RAT for UPLMN; Automatic mode  | B   | 3.8.0    | 5.0.0    | T1s040746 |
| TP-27    | TP-050039 | 1208 |     | Selection of RAT for OPLMN; Automatic mode  | B   | 3.8.0    | 5.0.0    | T1s040748 |
| TP-27    | TP-050039 | 1209 |     | Cell reselection if cell becomes barred or S<0; UTRAN to GPRS (CELL_FACH)   | B   | 3.8.0    | 5.0.0    | T1s040701 |
| TP-27    | TP-050039 | 1210 |     | Service Request / RAB re-establishment / UE initiated / multiple PDP contexts   | B   | 3.8.0    | 5.0.0    | T1s040719 |
| TP-27    | TP-050040 | 1211 |     | Summary of regression errors in the wk04 ATS  | F   | 3.8.0    | 5.0.0    | T1s050063 |

| Meet-ing | TSG doc   | CR   | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|--|-----|----------|----------|-----------|
| TP-27    | TP-050040 | 1212 |     | Summary of regression errors in the wk04 ATS.  | F   | 3.8.0    | 5.0.0    | T1s050062 |
| TP-27    | TP-050040 | 1213 |     | Correction to RRC P2 TC 8.4.1.7  | F   | 3.8.0    | 5.0.0    | T1s050040 |
| TP-27    | TP-050040 | 1214 |     | Summary of regression errors in the wk04 ATS.  | F   | 3.8.0    | 5.0.0    | T1s050061 |
| TP-27    | TP-050040 | 1215 |     | Summary of regression errors in the wk04 ATS.  | F   | 3.8.0    | 5.0.0    | T1s050058 |
| TP-27    | TP-050040 | 1216 |     | Correction to approved package 4 NAS Test case 12_6_1_3_3  | F   | 3.8.0    | 5.0.0    | T1s050052 |
| TP-27    | TP-050040 | 1217 |     | Correction to Approved RRC Package 3 TC 8.4.1.38   | F   | 3.8.0    | 5.0.0    | T1s050051 |
| TP-27    | TP-050040 | 1218 |     | Correction to Approved NAS Package 3 TC 9.4.7  | F   | 3.8.0    | 5.0.0    | T1s050053 |
| TP-27    | TP-050040 | 1219 |     | Correction to Approved RRC Package 2 TC 8.3.7.2 / 8.3.7.3  | F   | 3.8.0    | 5.0.0    | T1s050050 |
| TP-27    | TP-050040 | 1220 |     | Correction to Approved RRC Package 3 TC 8.4.1.36   | F   | 3.8.0    | 5.0.0    | T1s050048 |
| TP-27    | TP-050040 | 1221 |     | Correction to Approved IR_U Package 2 test case 6.2.2.1  | F   | 3.8.0    | 5.0.0    | T1s050042 |
| TP-27    | TP-050040 | 1222 |     | Correction to Approved IR_U Package 4 Test Case 8.3.7.12   | F   | 3.8.0    | 5.0.0    | T1s050043 |
| TP-27    | TP-050040 | 1223 |     | Correction to test step "ts_AT_TerminateCall".   | F   | 3.8.0    | 5.0.0    | T1s050041 |
| TP-27    | TP-050040 | 1224 |     | Wk51 regression error report on unapproved and approved Idlemode testcases 6.1.2.x   | F   | 3.8.0    | 5.0.0    | T1s050027 |
| TP-27    | TP-050040 | 1225 |     | Correction to approved package 3 NAS Test case 9_4_7   | F   | 3.8.0    | 5.0.0    | T1s050030 |
| TP-27    | TP-050040 | 1226 |     | Summary of regression errors in the wk51 ATS.  | F   | 3.8.0    | 5.0.0    | T1s050028 |
| TP-27    | TP-050040 | 1227 |     | Correction to RRC P1 TC 8.4.1.3  | F   | 3.8.0    | 5.0.0    | T1s050020 |
| TP-27    | TP-050040 | 1228 |     | Correction to RRC P2 TC 8.3.1.22 for removing check of "FOR" field value from ROUTING AREA UPDATING REQUEST message.   | F   | 3.8.0    | 5.0.0    | T1s050021 |
| TP-27    | TP-050040 | 1229 |     | Correction to Package 4 NAS test case 12.9.14  | F   | 3.8.0    | 5.0.0    | T1s050022 |
| TP-27    | TP-050040 | 1230 |     | Summary of regression errors in the wk51 ATS.  | F   | 3.8.0    | 5.0.0    | T1s050033 |
| TP-27    | TP-050040 | 1231 |     | Correction to 34.123-3, section 16, SMS test cases regarding Validity Period Formats   | F   | 3.8.0    | 5.0.0    | T1s050029 |
| TP-27    | TP-050040 | 1232 |     | Additional Corrections required for 14.4.2.2 test cases in the RAB ATS.  | F   | 3.8.0    | 5.0.0    | T1s050017 |
| TP-27    | TP-050040 | 1233 |     | Revised corrections to approved IR_U test cases 6_2_1_1, 6_2_1_7 and 6_2_1_8.  | F   | 3.8.0    | 5.0.0    | T1s050012 |
| TP-27    | TP-050040 | 1234 |     | Corrections required for "Combinations on SCCPCH" test cases in the RAB ATS.   | F   | 3.8.0    | 5.0.0    | T1s040801 |
| TP-27    | TP-050040 | 1235 |     | Correction to RRC P1 TC 8.4.1.5  | F   | 3.8.0    | 5.0.0    | T1s040797 |
| TP-27    | TP-050040 | 1236 |     | Additional Corrections Required for the wk47 ATS   | F   | 3.8.0    | 5.0.0    | T1s040765 |
| TP-27    | TP-050040 | 1237 |     | Correction to Package 4 NAS test case 12.2.1.5a Proc1  | F   | 3.8.0    | 5.0.0    | T1s040773 |
| TP-27    | TP-050040 | 1238 |     | Summary of regression errors in the wk49 ATS.  | F   | 3.8.0    | 5.0.0    | T1s040790 |
| TP-27    | TP-050040 | 1239 |     | Summary of regression errors in wk49 ATS.  | F   | 3.8.0    | 5.0.0    | T1s040789 |
| TP-27    | TP-050040 | 1240 |     | Correction to Approved RRC Package 4 TC 8.3.11.1   | F   | 3.8.0    | 5.0.0    | T1s040788 |
| TP-27    | TP-050040 | 1241 |     | Correction required to Package 4 NAS test case 12.9.13.  | F   | 3.8.0    | 5.0.0    | T1s040787 |
| TP-27    | TP-050040 | 1242 |     | Correction to approved GCF P4 NAS test case 12.9.8: improvement of incomplete implementation of T1-041930  | F   | 3.8.0    | 5.0.0    | T1s040786 |
| TP-27    | TP-050040 | 1243 |     | Correction to SIB1 contents for approved RRC Idle Mode and InterRAT test cases.  | F   | 3.8.0    | 5.0.0    | T1s040774 |
| TP-27    | TP-050040 | 1244 |     | Correction to Package 4 NAS test cases 12.4.3.4.   | F   | 3.8.0    | 5.0.0    | T1s040781 |
| TP-27    | TP-050040 | 1245 |     | Corrections to RRC Package 3 TC 8.4.1.26 to change the Downlink Power level settings of Cell A at Time Instant 'T1'.   | F   | 3.8.0    | 5.0.0    | T1s040782 |
| TP-27    | TP-050040 | 1246 |     | Correction to GMM Test cases for removing check of "FOR" field value from ATTACH REQUEST and ROUTING AREA UPDATING REQUEST messages. (Revision to TTCN CR T1s040763) | F   | 3.8.0    | 5.0.0    | T1s040783 |
| TP-27    | TP-050040 | 1247 |     | Correction to RRC P1 TC 8.4.1.5 (Revision of T1s040739)  | F   | 3.8.0    | 5.0.0    | T1s040770 |
| TP-27    | TP-050040 | 1248 |     | Corrections required to rlc_SizeIndex in the RAB ATS   | F   | 3.8.0    | 5.0.0    | T1s040772 |
| TP-27    | TP-050040 | 1249 |     | Corrections to RRC 8.3.2.x for Special LI  | F   | 3.8.0    | 5.0.0    | T1s040769 |
| TP-27    | TP-050040 | 1250 |     | Summary of regression errors in the wk47 ATS.  | F   | 3.8.0    | 5.0.0    | T1s040768 |
| TP-27    | TP-050040 | 1251 |     | Summary of regression errors in the wk47 ATS.  | F   | 3.8.0    | 5.0.0    | T1s040760 |
| TP-27    | TP-050040 | 1252 |     | Correction to Package 2 RRC test case 8.3.2.11 to increase the wait time while checking that UE does not send URA Update.  | F   | 3.8.0    | 5.0.0    | T1s040752 |
| TP-27    | TP-050040 | 1253 |     | Correction to RRC Test Case 8.3.1.22.  | F   | 3.8.0    | 5.0.0    | T1s040753 |
| TP-27    | TP-050040 | 1254 |     | Correction to approved package 2 NAS Test case 9.4.2.3   | F   | 3.8.0    | 5.0.0    | T1s040761 |
| TP-27    | TP-050040 | 1255 |     | Corrections to RRC Package 1 TC 8.3.1.1 to add a delay before SS reconfigures MAC according to the   | F   | 3.8.0    | 5.0.0    | T1s040762 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc      |
|----------|-----------|------|-----|---|-----|----------|----------|-------------|
|          |           |      |     | new C-RNTI or U-RNTI assigned to UE.  |     |          |          |             |
| TP-27    | TP-050040 | 1256 |     | Summary of regression errors in the wk47 ATS.   | F   | 3.8.0    | 5.0.0    | T1s040750   |
| TP-27    | TP-050040 | 1257 |     | Corrections Required for the wk47 ATS   | F   | 3.8.0    | 5.0.0    | T1s040758   |
| TP-27    | TP-050040 | 1258 |     | Summary of regression errors in IR_U wk47 ATS.  | F   | 3.8.0    | 5.0.0    | T1s040754   |
| TP-27    | TP-050040 | 1259 |     | Correction to package 1 test case 8.3.4.3.  | F   | 3.8.0    | 5.0.0    | T1s040742   |
| TP-27    | TP-050040 | 1260 |     | Correction to approved package 4 NAS Test cases 12.2.1.6 proc1, 12.2.1.6 proc2 and 12.9.8                 | F   | 3.8.0    | 5.0.0    | T1s040745   |
| TP-27    | TP-050036 | 1263 | -   | Corrections Required for "Combinations on SCCPCH" configurations.   | F   | 3.8.0    | 5.0.0    | T1-050201r3 |
| TP-27    | TP-050036 | 1264 | -   | Introduce ASP for HSDPA   | B   | 3.8.0    | 5.0.0    | T1-050036   |
| TP-27    | TP-050036 | 1265 | -   | Introduce ASP for LCR TDD   | B   | 3.8.0    | 5.0.0    | T1-050037   |
| TP-27    | TP-050036 | 1266 | -   | Replacement of 34.123-3 Release 99 by a pointer to the newly created Release 5 version                    | F   | 3.8.0    | 3.9.0    | T1-050250   |
| TP-27    | TP-050036 | 1267 | -   | Corrections of encoding rules and postambles  | F   | 3.8.0    | 5.0.0    | T1-050282   |
| TP-27    | TP-050036 | 1268 | -   | Introduce ASP for A-GPS   | B   | 3.8.0    | 5.0.0    | T1-050284   |
| TP-27    | TP-050037 | 1261 | -   | Add new verified TTCN test cases CR to 34.123-3 (prose) in Annex A  | F   | 3.8.0    | 5.0.0    | -           |
| RP-28    | RP-050278 | 1334 | -   | Correction to specification version references  | F   | 5.0.0    | 5.1.0    | R5-050639   |
| RP-28    | RP-050278 | 1335 | -   | Modifying AT Commands, ASPs, TSOs and PIXITs  | F   | 5.0.0    | 5.1.0    | R5-050955   |
| RP-28    | RP-050278 | 1336 | -   | HSDPA ASP Modification  | F   | 5.0.0    | 5.1.0    | R5-050975   |
| RP-28    | RP-050278 | 1337 | -   | Modifying G_L2_SYSINFO_REQ ASP  | F   | 5.0.0    | 5.1.0    | R5-050980   |
| RP-28    | RP-050278 | 1338 | -   | CR to 34.123-3 Rel-5: Addition of a new ASP required for test case tc_8_1_7_1d                            | F   | 5.0.0    | 5.1.0    | R5-050983   |
| RP-28    | RP-050281 | 1289 | -   | Summary of regression errors for IR_U_r3_wk17.  | F   | 5.0.0    | 5.1.0    | R5s050146   |
| RP-28    | RP-050281 | 1290 | -   | Correction to Approved RRC Package 4 TC 8.4.1.40  | F   | 5.0.0    | 5.1.0    | R5s050169   |
| RP-28    | RP-050281 | 1291 | -   | Correction of a missing LB entity in LB setup introduced in Rel-5 in the definition of CLOSE UE TEST LOOP | F   | 5.0.0    | 5.1.0    | R5s050168   |
| RP-28    | RP-050281 | 1292 | -   | Correction to approved testcase 8.2.2.4 and 8.2.4.4   | F   | 5.0.0    | 5.1.0    | R5s050165   |
| RP-28    | RP-050281 | 1293 | -   | Summary of additional regression errors in the wk17 ATS.  | F   | 5.0.0    | 5.1.0    | R5s050166   |
| RP-28    | RP-050281 | 1294 | -   | Correction to approved testcase 8.2.1.9   | F   | 5.0.0    | 5.1.0    | R5s050163   |
| RP-28    | RP-050281 | 1295 | -   | Correction in TTCN to support Band II UE for UE capability Information                                    | F   | 5.0.0    | 5.1.0    | R5s050167   |
| RP-28    | RP-050281 | 1296 | -   | Correction to value of periodic RA update timer IE in Attach Accept message                               | F   | 5.0.0    | 5.1.0    | R5s050152   |
| RP-28    | RP-050281 | 1297 | -   | Correction to Order of AT commands used for initiation of PS call   | F   | 5.0.0    | 5.1.0    | R5s050153   |
| RP-28    | RP-050281 | 1298 | -   | Correction to approved testcase 8.1.7.1b  | F   | 5.0.0    | 5.1.0    | R5s050154   |
| RP-28    | RP-050281 | 1299 | -   | Regression Error Report based on wk17ATS  | F   | 5.0.0    | 5.1.0    | R5s050164   |
| RP-28    | RP-050281 | 1300 | -   | Correction in TTCN to enable ciphering for 3G to 2G handover.   | F   | 5.0.0    | 5.1.0    | R5s050149   |
| RP-28    | RP-050281 | 1301 | -   | Correction to approved RRC testcases 8.1.3.3 and 8.1.3.4  | F   | 5.0.0    | 5.1.0    | R5s050148   |
| RP-28    | RP-050281 | 1302 | -   | Correction to GCF WI-10 test case 8.4.1.3   | F   | 5.0.0    | 5.1.0    | R5s050140   |
| RP-28    | RP-050281 | 1303 | -   | Corrections to WI-010 P3 RAB test cases 14.2.12, 14.2.16 & 14.2.17  | F   | 5.0.0    | 5.1.0    | R5s050127   |
| RP-28    | RP-050281 | 1304 | -   | Correction required for WI-010 P3 RAB Testcase 14.2.38c.  | F   | 5.0.0    | 5.1.0    | R5s050124   |
| RP-28    | RP-050281 | 1305 | -   | Correction to GCF Package 3 RRC test case 8.3.1.24  | F   | 5.0.0    | 5.1.0    | R5s050123   |
| RP-28    | RP-050281 | 1306 | -   | Summary of additional regression errors in the wk09 ATS.  | F   | 5.0.0    | 5.1.0    | R5s050116   |
| RP-28    | RP-050281 | 1307 | -   | Correction to approved RRC Package 4 TC 8.3.1.18  | F   | 5.0.0    | 5.1.0    | R5s050117   |
| RP-28    | RP-050281 | 1308 | -   | Correction to WI-12 Test Case 8.3.7.16  | F   | 5.0.0    | 5.1.0    | R5s050115   |
| RP-28    | RP-050282 | 1309 | -   | Correction to RRC P3 TC 8.3.2.13  | F   | 5.0.0    | 5.1.0    | R5s050113   |
| RP-28    | RP-050282 | 1310 | -   | Regression Error Report based on wk09 ATS   | F   | 5.0.0    | 5.1.0    | R5s050114   |
| RP-28    | RP-050282 | 1311 | -   | Summary of regression errors for IR_U_wk09.   | F   | 5.0.0    | 5.1.0    | R5s050110   |
| RP-28    | RP-050282 | 1312 | -   | Correction to RRC P2 TC 8.3.1.21  | F   | 5.0.0    | 5.1.0    | R5s050111   |
| RP-28    | RP-050282 | 1313 | -   | Correction to Approved NAS Package 4 TC 12.4.1.4a   | F   | 5.0.0    | 5.1.0    | R5s050109   |
| RP-28    | RP-050282 | 1315 | -   | Correction for the MM test step "ts_GMM_RAU_AcceptEPLMN"  | F   | 5.0.0    | 5.1.0    | R5s050105   |
| RP-28    | RP-050282 | 1316 | -   | Correction to SMS Test Suite for AT Commands  | F   | 5.0.0    | 5.1.0    | R5s050104   |
| RP-28    | RP-050282 | 1317 | -   | Changes required to support Release 5   | F   | 5.0.0    | 5.1.0    | R5s050095   |
| RP-28    | RP-050282 | 1318 | -   | Correction to approved package WI-12 NAS Test case 9_5_7_2  | F   | 5.0.0    | 5.1.0    | R5s050103   |
| RP-28    | RP-050282 | 1320 | -   | Handling of L2 Acknowledgement on GERAN side.   | F   | 5.0.0    | 5.1.0    | R5s050094   |
| RP-28    | RP-050282 | 1321 | -   | Correction to Approved RRC Package 4 TC 8.3.1.18  | F   | 5.0.0    | 5.1.0    | R5s050093   |
| RP-28    | RP-050282 | 1322 | -   | Correction to IR_U P4 Approved test case 8.3.11.4   | F   | 5.0.0    | 5.1.0    | R5s050091   |
| RP-28    | RP-050282 | 1323 | -   | Summary of iWD_07 regression test errors  | F   | 5.0.0    | 5.1.0    | R5s050078   |
| RP-28    | RP-050282 | 1324 | -   | Corrections to section 16 SMS test cases to improve AT command handling                                   | F   | 5.0.0    | 5.1.0    | R5s050090   |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
| RP-28    | RP-050282 | 1325 | -   | Correction to approved GCF P4 test cases 8.1.7.1c   | F   | 5.0.0    | 5.1.0    | R5s050086 |
| RP-28    | RP-050282 | 1326 | -   | Summary of regression errors in the wk07 ATS.   | F   | 5.0.0    | 5.1.0    | R5s050088 |
| RP-28    | RP-050282 | 1327 | -   | Correction to approved NAS WI 12 test case 12.4.1.5.  | F   | 5.0.0    | 5.1.0    | R5s050083 |
| RP-28    | RP-050282 | 1328 | -   | Correction to approved GCF P4 test cases 8.1.7.1d   | F   | 5.0.0    | 5.1.0    | R5s050087 |
| RP-28    | RP-050282 | 1329 | -   | Correction to approved package 2 NAS Test case 9_5_2  | F   | 5.0.0    | 5.1.0    | R5s050082 |
| RP-28    | RP-050282 | 1330 | -   | Correction to RRC P1 TC 8.4.1.1, 8.4.1.3 and P3 TC 8.4.1.29                                       | F   | 5.0.0    | 5.1.0    | R5s050065 |
| RP-28    | RP-050283 | 1314 | -   | Summary of regression errors in the wk09 ATS.   | F   | 5.0.0    | 5.1.0    | R5s050106 |
| RP-28    | RP-050283 | 1319 | -   | Correction to approved testcase 8.1.10.1  | F   | 5.0.0    | 5.1.0    | R5s050102 |
| RP-28    | RP-050365 | 1270 | -   | Addition of NAS WI 12 test case 12.3.2.7 to NAS ATS V5.0.0  | B   | 5.0.0    | 5.1.0    | R5s050128 |
| RP-28    | RP-050365 | 1271 | -   | Addition of WI-012 NAS test case 12.9.7a to NAS ATS V5.0.0  | B   | 5.0.0    | 5.1.0    | R5s050134 |
| RP-28    | RP-050365 | 1272 | -   | Addition of NAS WI 12 test case 12.9.9 to NAS ATS V3.8.0  | B   | 5.0.0    | 5.1.0    | R5s050080 |
| RP-28    | RP-050365 | 1273 | -   | Addition of WI-010 P3 RAB test case 14.2.43.1 to RAB ATS V5.0.0                                   | B   | 5.0.0    | 5.1.0    | R5s050100 |
| RP-28    | RP-050365 | 1274 | -   | Addition of WI-012 RAB test case 14.2.43.2 to RAB ATS V5.0.0                                      | B   | 5.0.0    | 5.1.0    | R5s050098 |
| RP-28    | RP-050365 | 1275 | -   | Addition of WI-012 RAB test case 14.2.58a to RAB ATS V5.0.0                                       | B   | 5.0.0    | 5.1.0    | R5s050096 |
| RP-28    | RP-050365 | 1276 | -   | Addition of WI-012 RLC test case 7.2.3.28 to RLC ATS V3.8.0                                       | B   | 5.0.0    | 5.1.0    | R5s050066 |
| RP-28    | RP-050365 | 1277 | -   | Addition of WI-012 RLC test case 7.2.3.32 to RLC ATS V3.8.0                                       | B   | 5.0.0    | 5.1.0    | R5s050068 |
| RP-28    | RP-050365 | 1278 | -   | Addition of WI-012 RLC test case 7.2.3.35 to RLC ATS V3.8.0                                       | B   | 5.0.0    | 5.1.0    | R5s050070 |
| RP-28    | RP-050365 | 1279 | -   | Addition of WI12 test case 8.1.1.9 to RRC ATS v5.0.0 (Revision of R5s050125)                      | B   | 5.0.0    | 5.1.0    | R5s050141 |
| RP-28    | RP-050365 | 1280 | -   | Addition of WI12 test cases 8.1.2.11 to RRC ATS v3.8.0  | B   | 5.0.0    | 5.1.0    | R5s050074 |
| RP-28    | RP-050365 | 1281 | -   | Addition of RRC WI-012 test case 8.3.1.30 to RRC ATS V5.0.0                                       | B   | 5.0.0    | 5.1.0    | R5s050138 |
| RP-28    | RP-050365 | 1282 | -   | Addition of WI-012 test case 8.3.7.16 to IR_U ATS 3.8.0   | B   | 5.0.0    | 5.1.0    | R5s050076 |
| RP-28    | RP-050365 | 1283 | -   | Regression changes on TC 8.3.9.5 - WK09   | B   | 5.0.0    | 5.1.0    | R5s050112 |
| RP-28    | RP-050365 | 1284 | -   | Addition of RRC WI-012 test case 8.4.1.6 to RRC ATS V5.0.0  | B   | 5.0.0    | 5.1.0    | R5s050132 |
| RP-28    | RP-050365 | 1285 | -   | Addition of WI-012 NAS test case 9.4.5.4.6 to NAS ATS V5.0.0                                      | B   | 5.0.0    | 5.1.0    | R5s050136 |
| RP-28    | RP-050365 | 1286 | -   | Addition of NAS P4 test case 12.4.1.4c Proc1 to NAS ATS V5.0.0                                    | B   | 5.0.0    | 5.1.0    | R5s050170 |
| RP-28    | RP-050365 | 1287 | -   | Revision and Addition of WI-10 (P2) test cases 6.2.2.2 to IR_U ATS v5.0.0                         | B   | 5.0.0    | 5.1.0    | R5s050173 |
| RP-28    | RP-050365 | 1331 | -   | Revision of RRC WI-14 test case 8.2.3.30 to RRC ATS v5.0.0  | B   | 5.0.0    | 5.1.0    | R5s050179 |
| RP-28    | RP-050365 | 1332 | -   | Addition of RRC WI-014 test case 8.2.4.36 to RRC ATS V5.0.0 (Revision of R5s050161)               | B   | 5.0.0    | 5.1.0    | R5s050199 |
| RP-28    | RP-050366 | 1333 | 1   | Add new verified and e-mail approved TTCN test cases in the TC lists in 34.123-3 (prose), Annex A | F   | 5.0.0    | 5.1.0    | -         |
| RP-29    | RP-050527 | 1334 | -   | Addition of WI-10 NAS test case 12.4.2.4 to NAS ATS V5.1.0  | B   | 5.1.0    | 5.2.0    | R5s050295 |
| RP-29    | RP-050527 | 1335 | -   | Addition of WI12 test case 8.2.1.24 to RRC ATS V5.1.0   | B   | 5.1.0    | 5.2.0    | R5s050259 |
| RP-29    | RP-050527 | 1336 | -   | Addition of WI12 test case 8.2.1.34 to RRC ATS V5.1.0   | B   | 5.1.0    | 5.2.0    | R5s050261 |
| RP-29    | RP-050527 | 1337 | -   | Addition of RRC WI-012 test case 8.2.1.33 to RRC ATS V5.1.0                                       | B   | 5.1.0    | 5.2.0    | R5s050242 |
| RP-29    | RP-050527 | 1338 | -   | Addition of NAS WI-012 test case 12.2.1.11 to NAS ATS V5.0.0                                      | B   | 5.1.0    | 5.2.0    | R5s050236 |
| RP-29    | RP-050527 | 1339 | -   | Addition of WI-10 RRC test case 8.4.1.14 to RRC ATS V5.0.0  | B   | 5.1.0    | 5.2.0    | R5s050228 |
| RP-29    | RP-050527 | 1340 | -   | Addition of RRC WI-14 test case 8.2.6.42 to RRC ATS v5.0.0  | B   | 5.1.0    | 5.2.0    | R5s050225 |
| RP-29    | RP-050527 | 1341 | -   | Addition of WI-010 (P4) test case 8.3.9.3 to IR_U ATS V5.0.0                                      | B   | 5.1.0    | 5.2.0    | R5s050219 |
| RP-29    | RP-050527 | 1342 | -   | Addition of RRC WI-010 (P2) test case 8.2.4.1 to RRC ATS V5.0.0                                   | B   | 5.1.0    | 5.2.0    | R5s050210 |
| RP-29    | RP-050527 | 1343 | -   | Addition of RRC WI-014 test case 8.3.1.32 to RRC ATS V5.0.0                                       | B   | 5.1.0    | 5.2.0    | R5s050217 |
| RP-29    | RP-050527 | 1344 | -   | Addition of RRC WI-014 test case 8.2.1.28 to RRC ATS V5.0.0                                       | B   | 5.1.0    | 5.2.0    | R5s050212 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
| RP-29    | RP-050527 | 1345 | -   | Addition of RRC WI-14 test case 8.2.1.32 to RRC ATS v5.0.0                                | B   | 5.1.0    | 5.2.0    | R5s050206 |
| RP-29    | RP-050527 | 1346 | -   | Addition of RRC WI-14 test case 8.2.1.31 to RRC ATS v5.0.0                                | B   | 5.1.0    | 5.2.0    | R5s050204 |
| RP-29    | RP-050527 | 1347 | -   | Addition of RRC WI-014 test case 8.2.2.38 to RRC ATS V5.0.0 (Revision of R5s050157)       | B   | 5.1.0    | 5.2.0    | R5s050197 |
| RP-29    | RP-050527 | 1348 | -   | Addition of WI-010 RRC test case 6.1.2.1 to RRC ATS V5.0.0                                | B   | 5.1.0    | 5.2.0    | R5s050189 |
| RP-29    | RP-050527 | 1349 | -   | Addition of RRC WI-14 test case 8.2.1.30 to RRC ATS v5.0.0                                | B   | 5.1.0    | 5.2.0    | R5s050184 |
| RP-29    | RP-050527 | 1350 | -   | Addition of RRC WI-10 test case 8.3.1.23 to RRC ATS V5.0.0                                | B   | 5.1.0    | 5.2.0    | R5s050175 |
| RP-29    | RP-050527 | 1351 | -   | Addition of RRC WI-14 test case 8.2.1.29 to RRC ATS v5.0.0                                | B   | 5.1.0    | 5.2.0    | R5s050182 |
| RP-29    | RP-050527 | 1352 | -   | Addition of WI-014 test case 8.3.1.34 to HS_ENH ATS V5.1.0                                | B   | 5.1.0    | 5.2.0    | R5s050347 |
| RP-29    | RP-050527 | 1353 | -   | Addition of WI14 test case 8.3.1.35 to HS_ENH ATS V5.1.0                                  | B   | 5.1.0    | 5.2.0    | R5s050321 |
| RP-29    | RP-050528 | 1354 | -   | Addition of WI14 test case 8.2.6.40 to HS_ENH ATS V5.1.0                                  | B   | 5.1.0    | 5.2.0    | R5s050323 |
| RP-29    | RP-050528 | 1355 | -   | Addition of WI-014 MAC test case 7.1.5.4 to HS_ENH ATS V5.1.0                             | B   | 5.1.0    | 5.2.0    | R5s050318 |
| RP-29    | RP-050528 | 1356 | -   | Addition of WI14 test case 7.1.5.3 to HS_ENH ATS V5.1.0                                   | B   | 5.1.0    | 5.2.0    | R5s050315 |
| RP-29    | RP-050528 | 1357 | -   | Revision (of R5s0500248) to introduce test case 8_2_2_40 based on wk31 ATS                | B   | 5.1.0    | 5.2.0    | R5s050339 |
| RP-29    | RP-050528 | 1358 | -   | Revision (of R5s050253) to introduce test case 8_3_1_33 based on wk31 ATS                 | B   | 5.1.0    | 5.2.0    | R5s050341 |
| RP-29    | RP-050528 | 1359 | -   | Revision (of R5s050250) to introduce test case 14_6_1 based on wk31 ATS                   | B   | 5.1.0    | 5.2.0    | R5s050345 |
| RP-29    | RP-050528 | 1360 | -   | Addition of WI14 test case 7.1.5.5 to HS_ENH ATS V5.1.0 (Revision of R5s050276)           | B   | 5.1.0    | 5.2.0    | R5s050313 |
| RP-29    | RP-050528 | 1361 | -   | Addition of WI14 test case 7.1.5.1 to HS_ENH ATS V5.1.0 (Revision of R5s050257)           | B   | 5.1.0    | 5.2.0    | R5s050311 |
| RP-29    | RP-050528 | 1362 | -   | Addition of WI-014 test case 8.2.1.27 to HS_ENH ATS V5.1.0 (Revision of CR R5s050263)     | B   | 5.1.0    | 5.2.0    | R5s050307 |
| RP-29    | RP-050528 | 1363 | -   | Addition of WI-014 test case 8.2.6.49 to HS_ENH ATS V5.1.0 (Revision of R5s050265)        | B   | 5.1.0    | 5.2.0    | R5s050309 |
| RP-29    | RP-050528 | 1364 | -   | Re-submission of WI-014 test case 8.3.11.9 to HS_ENH ATS V5.1.0. (Revision of R5s050150). | B   | 5.1.0    | 5.2.0    | R5s050349 |
| RP-29    | RP-050528 | 1365 | -   | Addition of WI-014 test case 8.2.2.36 to HS_ENH ATS V5.1.0 (Revision of CR R5s050267)     | B   | 5.1.0    | 5.2.0    | R5s050360 |
| RP-29    | RP-050529 | 1366 | -   | Correction required in HSDPA constraint cbr_108_RRC_ConnReq_r5                            | F   | 5.1.0    | 5.2.0    | R5s050351 |
| RP-29    | RP-050529 | 1367 | -   | Correction to approved WI-010 MM Test Cases 9_4_2_2_1 and 9_4_2_2_2                       | F   | 5.1.0    | 5.2.0    | R5s050337 |
| RP-29    | RP-050529 | 1368 | -   | Corrections to test step ts_C4_CheckCellPCH and ts_C4_CheckCellPCH_r5                     | F   | 5.1.0    | 5.2.0    | R5s050326 |
| RP-29    | RP-050529 | 1369 | -   | Correction to GCF P1(WI-10) approved RRC test case 8.1.1.2                                | F   | 5.1.0    | 5.2.0    | R5s050320 |
| RP-29    | RP-050529 | 1370 | -   | Correction required in HSDPA step ts_RRC_RAB_EstPS_MO_P25                                 | F   | 5.1.0    | 5.2.0    | R5s050317 |
| RP-29    | RP-050529 | 1371 | -   | Upgrade HSENH ATS to full R5  | F   | 5.1.0    | 5.2.0    | R5s050294 |
| RP-29    | RP-050529 | 1372 | -   | Correction to GCF approved RRC test case 8.3.1.18   | F   | 5.1.0    | 5.2.0    | R5s050293 |
| RP-29    | RP-050529 | 1373 | -   | Correction asn.1 calculated values.   | F   | 5.1.0    | 5.2.0    | R5s050255 |
| RP-29    | RP-050529 | 1374 | -   | Corrections to teststep ts_C5_CheckURA_PCH  | F   | 5.1.0    | 5.2.0    | R5s050280 |
| RP-29    | RP-050529 | 1375 | -   | Correction to approved testcases 8.3.1.5 and 8.3.1.6                                      | F   | 5.1.0    | 5.2.0    | R5s050287 |
| RP-29    | RP-050529 | 1376 | -   | Correction to Inter-RAT Test cases  | F   | 5.1.0    | 5.2.0    | R5s050288 |
| RP-29    | RP-050529 | 1377 | -   | Correction to the SMS Test Case 16.1.10 and 16.2.10                                       | F   | 5.1.0    | 5.2.0    | R5s050291 |
| RP-29    | RP-050529 | 1378 | -   | Summary of regression errors in the wk27 ATS.   | F   | 5.1.0    | 5.2.0    | R5s050292 |
| RP-29    | RP-050529 | 1379 | -   | Correction to test step ts_CRLC_DL_CipherCfgRB  | F   | 5.1.0    | 5.2.0    | R5s050290 |
| RP-29    | RP-050529 | 1380 | -   | Correction to GCF WI-12 approved NAS test case 9.4.5.4.6                                  | F   | 5.1.0    | 5.2.0    | R5s050281 |
| RP-29    | RP-050529 | 1381 | -   | Correction to GCF WI-10 approved IR_U test case 8.4.1.31                                  | F   | 5.1.0    | 5.2.0    | R5s050289 |
| RP-29    | RP-050529 | 1382 | -   | Corrections to Approved WI10 test case 9.4.5.2  | F   | 5.1.0    | 5.2.0    | R5s050282 |
| RP-29    | RP-050529 | 1383 | -   | Correction to GCF WI-10 test case 8.4.1.5   | F   | 5.1.0    | 5.2.0    | R5s050234 |
| RP-29    | RP-050529 | 1384 | -   | Correction to the RRC test case 8.4.1.14  | F   | 5.1.0    | 5.2.0    | R5s050278 |
| RP-29    | RP-050529 | 1385 | -   | Corrections to teststep ts_HO_SS_ReconfDCH_HS_ToFACH used for WI-14 Test Cases            | F   | 5.1.0    | 5.2.0    | R5s050279 |
| RP-29    | RP-050530 | 1386 | -   | Correction to 8_1_x series approved testcases   | F   | 5.1.0    | 5.2.0    | R5s050271 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
| RP-29    | RP-050530 | 1387 | -   | Correction to test step ts_RRC_ReceiveRB_SetupCmpl to handle IE 'Start' for the ciphering path  | F   | 5.1.0    | 5.2.0    | R5s050272 |
| RP-29    | RP-050530 | 1388 | -   | Correction to approved Inter-RAT IR_U testcase 8.3.7.13   | F   | 5.1.0    | 5.2.0    | R5s050273 |
| RP-29    | RP-050530 | 1389 | -   | Correction to approved testcase 8.2.4.1   | F   | 5.1.0    | 5.2.0    | R5s050274 |
| RP-29    | RP-050530 | 1390 | -   | Correction required for WI-010 P4 RRC Testcase 6.1.2.9.   | F   | 5.1.0    | 5.2.0    | R5s050275 |
| RP-29    | RP-050530 | 1391 | -   | Correction to GCF WI-12 approved RRC test case 8.3.1.30, 8.4.1.6 and NAS test case 12.3.2.7     | F   | 5.1.0    | 5.2.0    | R5s050270 |
| RP-29    | RP-050530 | 1392 | -   | Correction to Approved RRC Package 4 TC 8.4.1.33  | F   | 5.1.0    | 5.2.0    | R5s050269 |
| RP-29    | RP-050530 | 1393 | -   | Guard timer setting needs to be longer in test case 9.4.2.4 Procedure 2.                        | F   | 5.1.0    | 5.2.0    | R5s050252 |
| RP-29    | RP-050530 | 1394 | -   | Corrections to WI-012 approved testcases 8.2.2.9 & 8.2.6.12                                     | F   | 5.1.0    | 5.2.0    | R5s050246 |
| RP-29    | RP-050530 | 1395 | -   | Corrections to WI-014 approved testcases 8.2.1.28, 8.2.4.36 & 8.2.1.30                          | F   | 5.1.0    | 5.2.0    | R5s050247 |
| RP-29    | RP-050530 | 1396 | -   | Correction in Approved Test Case 12.2.2.1 of NAS wk07.mp in iWD-TVB2003-03_D05wk07.zip          | F   | 5.1.0    | 5.2.0    | R5s050245 |
| RP-29    | RP-050530 | 1397 | -   | Correction to GCF WI-12 approved RRC test case 8.1.6.3  | F   | 5.1.0    | 5.2.0    | R5s050233 |
| RP-29    | RP-050530 | 1398 | -   | Multiple PICs definitions   | F   | 5.1.0    | 5.2.0    | R5s050241 |
| RP-29    | RP-050530 | 1399 | -   | ASN.1 changes required for introduction of band V & band VI                                     | F   | 5.1.0    | 5.2.0    | R5s050215 |
| RP-29    | RP-050530 | 1400 | -   | Summary of regression errors in the wk21 IR_U and IR_G ATS.                                     | F   | 5.1.0    | 5.2.0    | R5s050240 |
| RP-29    | RP-050530 | 1401 | -   | Correction to GCF WI-10 and WI-12 IR_U and IR_G test cases                                      | F   | 5.1.0    | 5.2.0    | R5s050239 |
| RP-29    | RP-050530 | 1402 | -   | Correction to IdleMode P1 TC 6.1.2.1  | F   | 5.1.0    | 5.2.0    | R5s050238 |
| RP-29    | RP-050530 | 1403 | -   | Summary of regression errors in the wk21 IR_U ATS.  | F   | 5.1.0    | 5.2.0    | R5s050230 |
| RP-29    | RP-050530 | 1404 | -   | Correction to GCF WI-10 test case 8.3.1.1   | F   | 5.1.0    | 5.2.0    | R5s050224 |
| RP-29    | RP-050530 | 1405 | -   | Correction to approved WI-010 RRC Test case 6.1.2.1   | F   | 5.1.0    | 5.2.0    | R5s050221 |
| RP-29    | RP-050531 | 1406 | -   | Correction to approved WI-010 RRC Test case 6.1.2.9   | F   | 5.1.0    | 5.2.0    | R5s050227 |
| RP-29    | RP-050531 | 1407 | -   | Correction to GCF WI-10 test case 8.2.1.10, 8.3.4.1, 8.3.4.2, 12.4.2.5a Proc 2                  | F   | 5.1.0    | 5.2.0    | R5s050144 |
| RP-29    | RP-050531 | 1408 | -   | Correction to WI 12 approved testcase 8.3.1.30  | F   | 5.1.0    | 5.2.0    | R5s050222 |
| RP-29    | RP-050531 | 1409 | -   | Correction to approved testcase 8.2.6.19 and 8.2.6.20   | F   | 5.1.0    | 5.2.0    | R5s050223 |
| RP-29    | RP-050531 | 1410 | -   | Correction to GCF high priority MAC test case 7.1.2.4a  | F   | 5.1.0    | 5.2.0    | R5s050214 |
| RP-29    | RP-050531 | 1411 | -   | Correction to approved testcase 14.2.51b.1  | F   | 5.1.0    | 5.2.0    | R5s050209 |
| RP-29    | RP-050531 | 1412 | -   | Correction to approved testcase 8.3.7.12  | F   | 5.1.0    | 5.2.0    | R5s050203 |
| RP-29    | RP-050531 | 1413 | -   | Correction to GCF high priority NAS test case 12.4.1.4b   | F   | 5.1.0    | 5.2.0    | R5s050181 |
| RP-29    | RP-050531 | 1414 | -   | Regression Error Report based on wk19ATS  | F   | 5.1.0    | 5.2.0    | R5s050202 |
| RP-29    | RP-050531 | 1415 | -   | Summary of regression errors in the wk19 ATS.   | F   | 5.1.0    | 5.2.0    | R5s050196 |
| RP-29    | RP-050531 | 1416 | -   | Correction to approved testcase 14.2.58   | F   | 5.1.0    | 5.2.0    | R5s050194 |
| RP-29    | RP-050531 | 1417 | -   | Correction to WI-12 test case 12.9.7a   | F   | 5.1.0    | 5.2.0    | R5s050195 |
| RP-29    | RP-050531 | 1418 | -   | Summary of regression errors in the wk19 ATS.   | F   | 5.1.0    | 5.2.0    | R5s050186 |
| RP-29    | RP-050531 | 1419 | -   | Correction to IE 'radioPrioTOM8' in Attach Accept message.                                      | F   | 5.1.0    | 5.2.0    | R5s050193 |
| RP-29    | RP-050531 | 1420 | -   | Correction to softhandover test cases in RRC ATS v5.0.0   | F   | 5.1.0    | 5.2.0    | R5s050191 |
| RP-29    | RP-050531 | 1421 | -   | Correction to RRC and RAB ATS v5.0.0 – regression errors  | F   | 5.1.0    | 5.2.0    | R5s050192 |
| RP-29    | RP-050531 | 1422 | -   | Correction of syntax error in approved test cases   | F   | 5.1.0    | 5.2.0    | R5s050178 |
| RP-29    | RP-050531 | 1423 | -   | Correction to the approved IR_U test cases 8.4.1.33, 8.4.1.34, 8.4.1.35, 8.4.1.36 and 8.4.1.40. | F   | 5.1.0    | 5.2.0    | R5s050187 |
| RP-29    | RP-050531 | 1424 | -   | Correction to RRC Package 2 TC 8.4.1.23   | F   | 5.1.0    | 5.2.0    | R5s050188 |
| RP-29    | RP-050531 | 1425 | -   | Correction to RRC P4 TC 8.4.1.41  | F   | 5.1.0    | 5.2.0    | R5s050172 |
| RP-29    | RP-050532 | 1426 | -   | Correction to approved testcase 14.2.38c and 14.2.40  | F   | 5.1.0    | 5.2.0    | R5s050177 |
| RP-29    | RP-050532 | 1427 | -   | Summary of regression errors in the wk31 ATS.   | F   | 5.1.0    | 5.2.0    | R5s050354 |
| RP-29    | RP-050532 | 1428 | -   | Corrections to Approved Test case 8.2.1.29 based on wk31 ATS                                    | F   | 5.1.0    | 5.2.0    | R5s050327 |
| RP-29    | RP-050532 | 1429 | -   | Corrections to Approved test case 8.2.1.30 based on wk31 ATS                                    | F   | 5.1.0    | 5.2.0    | R5s050329 |
| RP-29    | RP-050532 | 1430 | -   | Corrections to Approved test case 8.2.1.31 based on wk31 ATS                                    | F   | 5.1.0    | 5.2.0    | R5s050331 |
| RP-29    | RP-050532 | 1431 | -   | Corrections to Approved test case 8.2.1.32 based on wk31 ATS                                    | F   | 5.1.0    | 5.2.0    | R5s050333 |
| RP-29    | RP-050532 | 1432 | -   | Corrections to Approved test case 8.2.6.42 based  | F   | 5.1.0    | 5.2.0    | R5s050335 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
|          |           |      |     | on wk31 ATS   |     |          |          |           |
| RP-29    | RP-050532 | 1433 | -   | Corrections to Approved test case 8_2_3_30 based on wk31 ATS  | F   | 5.1.0    | 5.2.0    | R5s050343 |
| RP-29    | RP-050532 | 1434 | -   | Corrections to Approved Testcase 8_2_1_28 based on wk31 ATS   | F   | 5.1.0    | 5.2.0    | R5s050297 |
| RP-29    | RP-050532 | 1435 | -   | Corrections to Approved Testcase 8_2_2_38 based on wk31 ATS   | F   | 5.1.0    | 5.2.0    | R5s050299 |
| RP-29    | RP-050532 | 1436 | -   | Corrections to Approved Testcase 8_2_3_30 based on wk31 ATS   | F   | 5.1.0    | 5.2.0    | R5s050301 |
| RP-29    | RP-050532 | 1437 | -   | Corrections to Approved Testcase 8_2_4_36 based on wk31 ATS   | F   | 5.1.0    | 5.2.0    | R5s050303 |
| RP-29    | RP-050532 | 1438 | -   | Corrections to Approved Testcase 8_3_1_32 based on wk31 ATS   | F   | 5.1.0    | 5.2.0    | R5s050305 |
| RP-29    | RP-050562 | 1439 | -   | Add new verified and e-mail agreed TTCN test cases in the TC lists in 34.123-3 (prose), Annex A.                | F   | 5.1.0    | 5.2.0    | -         |
| RP-29    | RP-050526 | 1440 | -   | Clarifying L2 Tests - Update TSOs and PIXITs – New configurations for WI-13/14 TCs                              | F   | 5.1.0    | 5.2.0    | R5-051510 |
| RP-30    | RP-050713 | 1441 | -   | CR to 34.123-3: Add new verified and e-mail agreed TTCN test cases in the TC lists in 34.123-3 (prose), Annex A | F   | 5.2.0    | 5.3.0    | -         |
| RP-30    | RP-050766 | 1442 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.7 to AGPS ATS V5.2.0   | B   | 5.2.0    | 5.3.0    | R5s050480 |
| RP-30    | RP-050766 | 1443 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.6 to AGPS ATS V5.2.0   | B   | 5.2.0    | 5.3.0    | R5s050478 |
| RP-30    | RP-050766 | 1444 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.10 to AGPS ATS V5.2.0  | B   | 5.2.0    | 5.3.0    | R5s050476 |
| RP-30    | RP-050766 | 1445 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.3 to RLC ATS V5.1.0  | B   | 5.2.0    | 5.3.0    | R5s050419 |
| RP-30    | RP-050766 | 1446 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.1 to RLC ATS V5.1.0  | B   | 5.2.0    | 5.3.0    | R5s050410 |
| RP-30    | RP-050768 | 1447 | -   | Addition of GCF WI-14/2 test case 8.2.3.32 to HS_ENH ATS V5.2.0 (Revision of R5s050451)                         | B   | 5.2.0    | 5.3.0    | R5s050495 |
| RP-30    | RP-050768 | 1448 | -   | Addition of GCF WI-14/2 test case 8.2.3.34 to HS_ENH ATS V5.2.0   | B   | 5.2.0    | 5.3.0    | R5s050449 |
| RP-30    | RP-050768 | 1449 | -   | Addition of GCF WI-014 test case 8.2.2.41 to HS_ENH ATS V5.2.0 (Revision of R5s050455)                          | B   | 5.2.0    | 5.3.0    | R5s050466 |
| RP-30    | RP-050768 | 1450 | -   | Addition of GCF WI-014 RAB test case 14.6.3a to HS_ENH ATS V5.2.0   | B   | 5.2.0    | 5.3.0    | R5s050464 |
| RP-30    | RP-050768 | 1451 | -   | Addition of GCF WI-014 RAB test case 14.6.3 to HS_ENH ATS V5.2.0  | B   | 5.2.0    | 5.3.0    | R5s050462 |
| RP-30    | RP-050768 | 1452 | -   | Addition of GCF WI-014 test case 8.3.4.9 to HS_ENH ATS V5.2.0   | B   | 5.2.0    | 5.3.0    | R5s050457 |
| RP-30    | RP-050768 | 1453 | -   | Addition of GCF WI-014 test case 8.2.3.31 to HS_ENH ATS V5.2.0  | B   | 5.2.0    | 5.3.0    | R5s050444 |
| RP-30    | RP-050768 | 1454 | -   | Addition of GCF WI-014 RAB test case 14.6.2 to HS_ENH ATS V5.1.0  | B   | 5.2.0    | 5.3.0    | R5s050424 |
| RP-30    | RP-050768 | 1455 | -   | Additional Changes to GCF WI-014 test case 8.3.1.37   | B   | 5.2.0    | 5.3.0    | R5s050421 |
| RP-30    | RP-050768 | 1456 | -   | Addition of GCF WI-014 test case 8.3.11.10 to RRC ATS V5.1.0  | B   | 5.2.0    | 5.3.0    | R5s050412 |
| RP-30    | RP-050768 | 1457 | -   | Addition of GCF WI-014 test case 8.2.3.35 to HS_ENH ATS V5.1.0  | B   | 5.2.0    | 5.3.0    | R5s050407 |
| RP-30    | RP-050768 | 1458 | -   | Addition of GCF WI-14/2 test case 8.2.6.46 to HS_ENH ATS V5.1.0   | B   | 5.2.0    | 5.3.0    | R5s050405 |
| RP-30    | RP-050768 | 1459 | -   | Addition of GCF WI-14/2 test case 8.2.6.41 to HS_ENH ATS V5.1.0   | B   | 5.2.0    | 5.3.0    | R5s050403 |
| RP-30    | RP-050768 | 1460 | -   | Addition of GCF WI-14/2 test case 8.3.1.36 to HS_ENH ATS V5.1.0   | B   | 5.2.0    | 5.3.0    | R5s050385 |
| RP-30    | RP-050768 | 1461 | -   | Addition of RRC GCF WI-14 test case 7.1.5.6 to RRC ATS v5.1.0   | B   | 5.2.0    | 5.3.0    | R5s050379 |
| RP-30    | RP-050775 | 1462 | -   | Addition of BMC GCF WI-10/3 test case 14.4.4 to RAB ATS V5.1.0  | B   | 5.2.0    | 5.3.0    | R5s050401 |
| RP-30    | RP-050775 | 1463 | -   | Revision of R5s050442 - Addition of GCF WI-10 Idle Mode Test Case 6.1.1.4 to RRC ATS 5.2.0                      | B   | 5.2.0    | 5.3.0    | R5s050453 |
| RP-30    | RP-050775 | 1464 | -   | Addition of NAS GCF WI-12 test case 9.4.3.3 to NAS ATS V5.1.0   | B   | 5.2.0    | 5.3.0    | R5s050416 |
| RP-30    | RP-050775 | 1465 | -   | Addition of Cell Broadcast GCF WI-12 test case 16.3 to SMS ATS V5.1.0   | B   | 5.2.0    | 5.3.0    | R5s050399 |
| RP-30    | RP-050775 | 1466 | -   | Addition of NAS GCF WI-10 P4 test case 12.9.12 to NAS ATS V5.1.0  | B   | 5.2.0    | 5.3.0    | R5s050395 |
| RP-30    | RP-050775 | 1467 | -   | Addition of NAS GCF WI-12 test case 9.4.2.4 proc 4 to NAS ATS V5.1.0  | B   | 5.2.0    | 5.3.0    | R5s050231 |
| RP-30    | RP-050778 | 1468 | -   | Addition of GCF WI-013 RRC test case 8.1.2.15 to HS_ENH ATS V5.2.0  | B   | 5.2.0    | 5.3.0    | R5s050473 |

| Meet-ing | TSG doc   | CR   | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|--|-----|----------|----------|-----------|
| RP-30    | RP-050778 | 1469 | -   | Addition of GCF WI-013 RRC test case 8.1.2.14 to HS_ENH ATS V5.2.0   | B   | 5.2.0    | 5.3.0    | R5s050471 |
| RP-30    | RP-050778 | 1470 | -   | Addition of GCF WI-013 test case 8.3.11.13 to HS_ENH_r5 ATS V5.2.0.  | B   | 5.2.0    | 5.3.0    | R5s050437 |
| RP-30    | RP-050778 | 1471 | -   | Addition of GCF WI-13 RRC test case 8.1.6.5 to HS_ENH ATS V5.2.0   | B   | 5.2.0    | 5.3.0    | R5s050497 |
| RP-30    | RP-050778 | 1472 | -   | Addition of GCF WI-013 RRC test case 8.3.1.40 to HS_ENH ATS V5.2.0   | B   | 5.2.0    | 5.3.0    | R5s050500 |
| RP-30    | RP-050768 | 1473 | -   | Removal of use of deprecated alternative value in RRC Connection Release message (Cell DCH) in HS_ENH suite                        | F   | 5.2.0    | 5.3.0    | R5s050487 |
| RP-30    | RP-050768 | 1474 | -   | Removal of use of deprecated alternative value in RRC Connection Setup message (Cell FACH) in HS_ENH suite                         | F   | 5.2.0    | 5.3.0    | R5s050489 |
| RP-30    | RP-050768 | 1475 | -   | Correction to GCF WI-14/2 HSDPA RRC test case 8.3.1.37   | F   | 5.2.0    | 5.3.0    | R5s050492 |
| RP-30    | RP-050768 | 1476 | -   | Additional changes required for addition of GCF WI-014 test case 8.3.11.10 to RRC ATS V5.2.0.                                      | F   | 5.2.0    | 5.3.0    | R5s050460 |
| RP-30    | RP-050768 | 1477 | -   | Correction to GCF WI-14/2 testcase 8.3.1.36  | F   | 5.2.0    | 5.3.0    | R5s050439 |
| RP-30    | RP-050768 | 1478 | -   | Corrections to GCF WI-014/1 test cases 8.3.1.34  | F   | 5.2.0    | 5.3.0    | R5s050427 |
| RP-30    | RP-050768 | 1479 | -   | Correction to RRC HSDPA testcase 8.2.2.40  | F   | 5.2.0    | 5.3.0    | R5s050431 |
| RP-30    | RP-050773 | 1480 | -   | Removal of use of deprecated alternative value in RRC Connection Release message (Cell DCH) in all GCF WI-10 and WI-12 test suites | F   | 5.2.0    | 5.3.0    | R5s050488 |
| RP-30    | RP-050773 | 1481 | -   | Correction to GCF WI-12 RRC test case 8.4.1.6  | F   | 5.2.0    | 5.3.0    | R5s050486 |
| RP-30    | RP-050773 | 1482 | -   | Corrections to RLC test cases to add check for the PIXIT_px_CipheringOnOff   | F   | 5.2.0    | 5.3.0    | R5s050485 |
| RP-30    | RP-050773 | 1483 | -   | Removal of use of deprecated alternative value in RRC Connection Setup message (Cell FACH) in all GCF WI-10 and WI-12 test suites  | F   | 5.2.0    | 5.3.0    | R5s050490 |
| RP-30    | RP-050773 | 1484 | -   | Correction to the GCF WI-10 NAS test case 12.2.1.2   | F   | 5.2.0    | 5.3.0    | R5s050491 |
| RP-30    | RP-050773 | 1485 | -   | Correction to GCF WI-10 MAC test case 7.1.2.3.1  | F   | 5.2.0    | 5.3.0    | R5s050494 |
| RP-30    | RP-050773 | 1486 | -   | Correction to GCF WI-10 Idle Mode Test Case 6.1.2.1  | F   | 5.2.0    | 5.3.0    | R5s050469 |
| RP-30    | RP-050773 | 1487 | -   | Corrections required to GCF WI-10 approved test case 8.3.1.18  | F   | 5.2.0    | 5.3.0    | R5s050448 |
| RP-30    | RP-050773 | 1488 | -   | Corrections required to GCF WI-14 approved HSDPA test cases  | F   | 5.2.0    | 5.3.0    | R5s050435 |
| RP-30    | RP-050773 | 1489 | -   | TTCN correction to RRC TC 8.2.4.1  | F   | 5.2.0    | 5.3.0    | R5s050436 |
| RP-30    | RP-050773 | 1490 | -   | Corrections required to GCF W-I10 approved test case 8.4.1.40  | F   | 5.2.0    | 5.3.0    | R5s050434 |
| RP-30    | RP-050773 | 1491 | -   | Correction to the NAS Test Case 12.9.7a  | F   | 5.2.0    | 5.3.0    | R5s050429 |
| RP-30    | RP-050773 | 1492 | -   | Correction to the IR_U Test Case 8.3.7.3   | F   | 5.2.0    | 5.3.0    | R5s050430 |
| RP-30    | RP-050773 | 1493 | -   | Correction to MultiRAB Test Cases  | F   | 5.2.0    | 5.3.0    | R5s050432 |
| RP-30    | RP-050773 | 1494 | -   | Correction to GCF WI-10/2 RRC test case 8.3.1.21   | F   | 5.2.0    | 5.3.0    | R5s050426 |
| RP-30    | RP-050773 | 1495 | -   | Summary of regression errors in the wk38 ATS   | F   | 5.2.0    | 5.3.0    | R5s050428 |
| RP-30    | RP-050773 | 1496 | -   | Summary of regression errors in wk38 of RRC ATS  | F   | 5.2.0    | 5.3.0    | R5s050414 |
| RP-30    | RP-050773 | 1497 | -   | Correction in TTCN for test case 7.2.3.19  | F   | 5.2.0    | 5.3.0    | R5s050415 |
| RP-30    | RP-050773 | 1498 | -   | Regression Error report based on wk36 ATS  | F   | 5.2.0    | 5.3.0    | R5s050409 |
| RP-30    | RP-050773 | 1499 | -   | Summary of regression results for wk36 version of IR_U ATS V5.1.0  | F   | 5.2.0    | 5.3.0    | R5s050384 |
| RP-30    | RP-050774 | 1500 | -   | Corrections required to GCF WI-10 approved test cases 6.2.1.7 and 6.2.1.8  | F   | 5.2.0    | 5.3.0    | R5s050394 |
| RP-30    | RP-050774 | 1501 | -   | Corrections required to GCF WI-10 approved test cases 8.3.7.5, 8.3.7.7 and 8.3.7.12  | F   | 5.2.0    | 5.3.0    | R5s050397 |
| RP-30    | RP-050774 | 1502 | -   | Correction to teststep ts_RRC_NAS_SessionActPS_MO_DCH_ToFACH.  | F   | 5.2.0    | 5.3.0    | R5s050390 |
| RP-30    | RP-050774 | 1503 | -   | Correction to GCF WI-10/4 RRC test case 8.1.3.9  | F   | 5.2.0    | 5.3.0    | R5s050378 |
| RP-30    | RP-050774 | 1504 | -   | Summary of regression errors in the wk36 ATS   | F   | 5.2.0    | 5.3.0    | R5s050391 |
| RP-30    | RP-050774 | 1505 | -   | Summary of regression errors in the wk36 IR_U ATS.   | F   | 5.2.0    | 5.3.0    | R5s050392 |
| RP-30    | RP-050774 | 1506 | -   | Correction to HS_ENH_wk36 – Regression errors  | F   | 5.2.0    | 5.3.0    | R5s050389 |
| RP-30    | RP-050774 | 1507 | -   | Correction to GCF WI-12 RRC test case 8.4.1.6  | F   | 5.2.0    | 5.3.0    | R5s050376 |
| RP-30    | RP-050774 | 1508 | -   | Correction to Inter-RAT IR_U test case 8.3.11.4  | F   | 5.2.0    | 5.3.0    | R5s050377 |
| RP-30    | RP-050774 | 1509 | -   | Correction to generic procedure C.1 (Idle mode check)  | F   | 5.2.0    | 5.3.0    | R5s050375 |
| RP-30    | RP-050774 | 1510 | -   | Summary of regression errors in the wk31 ATS   | F   | 5.2.0    | 5.3.0    | R5s050367 |
| RP-30    | RP-050774 | 1511 | -   | Correction to the test case 14.2.43.1  | F   | 5.2.0    | 5.3.0    | R5s050368 |
| RP-30    | RP-050774 | 1512 | -   | Correction to the NAS Test Case 12.9.13  | F   | 5.2.0    | 5.3.0    | R5s050374 |
| RP-30    | RP-050774 | 1513 | -   | Correction to all approved Test Cases using ciphering  | F   | 5.2.0    | 5.3.0    | R5s050373 |
| RP-30    | RP-050774 | 1514 | -   | Corrections required for approved GCF WI-10 RRC test cases 8.3.1.21 and 8.3.2.11   | F   | 5.2.0    | 5.3.0    | R5s050369 |
| RP-30    | RP-050774 | 1515 | -   | Corrections required for approved GCF WI-10 NAS test cases 9.4.2.3 and 9.4.2.5   | F   | 5.2.0    | 5.3.0    | R5s050370 |

| Meet-ing | TSG doc   | CR   | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|--|-----|----------|----------|-----------|
| RP-30    | RP-050774 | 1516 | -   | Summary of regression errors in the wk31 ATS Batch 2.                              | F   | 5.2.0    | 5.3.0    | R5s050372 |
| RP-30    | RP-050774 | 1517 | -   | Correction to GCF WI-010 test case 6.1.2.1 for manual attach UE                    | F   | 5.2.0    | 5.3.0    | R5s050366 |
| RP-30    | RP-050774 | 1518 | -   | Correction to agreed testcase 8.2.6.8  | F   | 5.2.0    | 5.3.0    | R5s050357 |
| RP-30    | RP-050774 | 1519 | -   | Correction to agreed IR_U_wk31 MRAT testcases 8.3.9.1 and 8.3.9.5                  | F   | 5.2.0    | 5.3.0    | R5s050358 |
| RP-30    | RP-050775 | 1520 | -   | Correction to P1 NAS Test Case 11.3.1 for AT command confirmation                  | F   | 5.2.0    | 5.3.0    | R5s050359 |
| RP-30    | RP-050775 | 1521 | -   | Correction of the NAS Test Case 12.9.14  | F   | 5.2.0    | 5.3.0    | R5s050362 |
| RP-30    | RP-050775 | 1522 | -   | Correction to the test step ts_RRC_ReceiveRB_RelCmpl                               | F   | 5.2.0    | 5.3.0    | R5s050363 |
| RP-30    | RP-050775 | 1523 | -   | Corrections required for QOS constraint in R99 ATS                                 | F   | 5.2.0    | 5.3.0    | R5s050364 |
| RP-30    | RP-050775 | 1524 | -   | Corrections required for QOS constraint in HSDPA/Rel-5 enhancement ATS             | F   | 5.2.0    | 5.3.0    | R5s050365 |
| RP-30    | RP-050775 | 1525 | -   | Summary of regression errors in the wk42 ATS.                                      | F   | 5.2.0    | 5.3.0    | R5s050499 |
| RP-30    | RP-050775 | 1526 | -   | Correction to Approved RRC TC 8.3.11.1   | F   | 5.2.0    | 5.3.0    | R5s050459 |
| RP-30    | RP-050769 | 1527 | -   | Update PIXIT and TSO, clarifications of a TSO and an AT / MMI commands in 34.123-3 | F   | 5.2.0    | 5.3.0    | R5-052110 |
| RP-30    | RP-050775 | 1528 | -   | Correction to iWD_wk38 IR_U ATS  | F   | 5.2.0    | 5.3.0    | R5s050470 |
| RP-31    | RP-060158 | 1529 | -   | Addition of GCF WI-015 AGPS test case 17.2.2.1 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050561 |
| RP-31    | RP-060158 | 1530 | -   | Addition of GCF WI-015 AGPS test case 17.2.2.2 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050563 |
| RP-31    | RP-060158 | 1531 | -   | Addition of GCF WI-015 AGPS test case 17.2.2.3 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050565 |
| RP-31    | RP-060158 | 1532 | -   | Addition of GCF WI-015 AGPS test case 17.2.2.4 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050587 |
| RP-31    | RP-060158 | 1533 | -   | Addition of GCF WI-015 AGPS test case 17.2.3.2 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050567 |
| RP-31    | RP-060158 | 1534 | -   | Addition of GCF WI-015 AGPS test case 17.2.3.3 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050589 |
| RP-31    | RP-060158 | 1535 | -   | Addition of GCF WI-015 AGPS test case 17.2.3.4 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050591 |
| RP-31    | RP-060158 | 1536 | -   | Addition of GCF WI-015 AGPS test case 17.2.3.8 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050593 |
| RP-31    | RP-060158 | 1537 | -   | Addition of GCF WI-015 AGPS test case 17.2.3.9 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050569 |
| RP-31    | RP-060158 | 1538 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.2 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050595 |
| RP-31    | RP-060158 | 1539 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.4 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050572 |
| RP-31    | RP-060158 | 1540 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.5 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050574 |
| RP-31    | RP-060158 | 1541 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.8 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050576 |
| RP-31    | RP-060158 | 1542 | -   | Addition of GCF WI-015 AGPS test case 17.2.4.9 to AGPS ATS V5.2.0                  | B   | 5.3.0    | 5.4.0    | R5s050578 |
| RP-31    | RP-060148 | 1543 | -   | Addition of GCF WI-014 RAB test case 14.6.4 to HS_ENH ATS V5.3.0                   | B   | 5.3.0    | 5.4.0    | R5s050604 |
| RP-31    | RP-060148 | 1544 | -   | Addition of GCF WI-014 RAB test case 14.6.4a to HS_ENH ATS V5.3.0                  | B   | 5.3.0    | 5.4.0    | R5s050606 |
| RP-31    | RP-060148 | 1545 | -   | Addition of GCF WI-014 RAB test case 14.6.5 to HS_ENH ATS V5.3.0                   | B   | 5.3.0    | 5.4.0    | R5s050608 |
| RP-31    | RP-060148 | 1546 | -   | Addition of GCF WI-014 RAB test case 14.6.5a to HS_ENH ATS V5.3.0                  | B   | 5.3.0    | 5.4.0    | R5s050610 |
| RP-31    | RP-060148 | 1547 | -   | Addition of GCF WI-014/1 test case 7.1.5.2 to HS_ENH ATS V5.2.0                    | B   | 5.3.0    | 5.4.0    | R5s050534 |
| RP-31    | RP-060148 | 1548 | -   | Addition of RRC GCF WI-14 test case 8.2.2.39 to RRC ATS v5.2.0                     | B   | 5.3.0    | 5.4.0    | R5s050510 |
| RP-31    | RP-060148 | 1549 | -   | Addition of GCF WI-014 test case 8.2.2.42 to HS_ENH ATS V5.2.0                     | B   | 5.3.0    | 5.4.0    | R5s050536 |
| RP-31    | RP-060148 | 1550 | -   | Addition of GCF WI-014/2 test case 8.2.3.33 to HS_ENH ATS V5.2.0                   | B   | 5.3.0    | 5.4.0    | R5s050540 |
| RP-31    | RP-060148 | 1551 | -   | Addition of GCF WI-014 RRC test case 8.2.6.39a to HS_ENH ATS V5.2.0                | B   | 5.3.0    | 5.4.0    | R5s050516 |
| RP-31    | RP-060148 | 1552 | -   | Addition of GCF WI-014 RRC test case 8.2.6.39b to HS_ENH ATS V5.3.0                | B   | 5.3.0    | 5.4.0    | R5s050598 |
| RP-31    | RP-060148 | 1553 | -   | Addition of GCF WI 14/2 test case 8.3.7.14 to HS_ENH ATS V5.3.0                    | B   | 5.3.0    | 5.4.0    | R5s050618 |
| RP-31    | RP-060148 | 1554 | -   | Addition of GCF WI-10/1 test case 6.1.2.2 to RRC ATS v5.2.0                        | B   | 5.3.0    | 5.4.0    | R5s050556 |
| RP-31    | RP-060148 | 1555 | -   | Addition of RRC GCF WI-10 test case 6.1.2.3 to RRC                                 | B   | 5.3.0    | 5.4.0    | R5s050614 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
|          |           |      |     | ATS v5.3.0  |     |          |          |           |
| RP-31    | RP-060158 | 1556 | -   | Addition of GCF WI-10 Idle Mode test case 6.1.2.5                                     | B   | 5.3.0    | 5.4.0    | R5s060017 |
| RP-31    | RP-060158 | 1557 | -   | Addition of GCF WI-10 RRC test case 6.1.2.6 to RRC ATS V5.2.0                         | B   | 5.3.0    | 5.4.0    | R5s050584 |
| RP-31    | RP-060158 | 1558 | -   | Addition of GCF WI-10/2 RRC test case 6.1.2.8 to RRC ATS V5.2.0                       | B   | 5.3.0    | 5.4.0    | R5s050547 |
| RP-31    | RP-060158 | 1559 | -   | Addition of GCF WI-010/2 test case 6.2.2.3 to IR_U ATS V5.2.0                         | B   | 5.3.0    | 5.4.0    | R5s050483 |
| RP-31    | RP-060158 | 1560 | -   | Addition of GCF WI-12 test case 8.4.1.48  | B   | 5.3.0    | 5.4.0    | R5s050612 |
| RP-31    | RP-060165 | 1561 | -   | Addition of GCF WI-13 test case 6.1.2.10  | B   | 5.3.0    | 5.4.0    | R5s060013 |
| RP-31    | RP-060165 | 1562 | -   | Addition of GCF WI-013 RRC test case 8.3.1.38 to HS_ENH ATS V5.3.0                    | B   | 5.3.0    | 5.4.0    | R5s050600 |
| RP-31    | RP-060165 | 1563 | -   | Addition of GCF WI-013 RRC test case 8.3.1.39 to HS_ENH ATS V5.3.0                    | B   | 5.3.0    | 5.4.0    | R5s050602 |
| RP-31    | RP-060149 | 1564 | -   | Summary of regression errors in the wk03 HSD_ENH ATS                                  | F   | 5.3.0    | 5.4.0    | R5s060011 |
| RP-31    | RP-060149 | 1565 | -   | Corrections to GCF WI-014 RAB testcases 14.6.4 and 14.6.4a                            | F   | 5.3.0    | 5.4.0    | R5s060038 |
| RP-31    | RP-060149 | 1566 | -   | Corrections to Approved GCF WI-014 RRC testcases 8.2.3.33                             | F   | 5.3.0    | 5.4.0    | R5s060035 |
| RP-31    | RP-060149 | 1567 | -   | Summary of regression errors in wk03 HSDPA ATS.                                       | F   | 5.3.0    | 5.4.0    | R5s060030 |
| RP-31    | RP-060149 | 1568 | -   | Wk49 regression errors in HS_ENH ATS  | F   | 5.3.0    | 5.4.0    | R5s050623 |
| RP-31    | RP-060149 | 1569 | -   | Summary of regression errors in the wk49 HS_ENH ATS                                   | F   | 5.3.0    | 5.4.0    | R5s050621 |
| RP-31    | RP-060149 | 1570 | -   | Summary of regression errors in the wk49 HS_ENH ATS                                   | F   | 5.3.0    | 5.4.0    | R5s050617 |
| RP-31    | RP-060149 | 1571 | -   | Correction to GCF WI14 test case 8.3.4.9  | F   | 5.3.0    | 5.4.0    | R5s050620 |
| RP-31    | RP-060149 | 1572 | -   | Summary of regression errors in the wk49 HS_ENH ATS                                   | F   | 5.3.0    | 5.4.0    | R5s050581 |
| RP-31    | RP-060149 | 1573 | -   | Correction to GCF WI14 test case 14.6.1 and 14.6.2                                    | F   | 5.3.0    | 5.4.0    | R5s050560 |
| RP-31    | RP-060149 | 1574 | -   | Summary of regression errors in the wk47 HS_ENH ATS                                   | F   | 5.3.0    | 5.4.0    | R5s050532 |
| RP-31    | RP-060149 | 1575 | -   | Summary of regression errors in the wk47 HSDPA ATS                                    | F   | 5.3.0    | 5.4.0    | R5s050550 |
| RP-31    | RP-060149 | 1576 | -   | Summary of regression errors in the HSENH_r5_wk42 ATS.                                | F   | 5.3.0    | 5.4.0    | R5s050529 |
| RP-31    | RP-060149 | 1577 | -   | Correction to GCF WI-014/2 test case 8.2.2.41   | F   | 5.3.0    | 5.4.0    | R5s050525 |
| RP-31    | RP-060149 | 1578 | -   | Summary of regression errors in the wk42 HS_ENH ATS                                   | F   | 5.3.0    | 5.4.0    | R5s050513 |
| RP-31    | RP-060149 | 1579 | -   | Corrections to Testcase 8.3.1.35  | F   | 5.3.0    | 5.4.0    | R5s050518 |
| RP-31    | RP-060149 | 1580 | -   | Update to HS_ENH_r5 ATS to allow 64k uplink data rate to be tested for RRC Testcases. | F   | 5.3.0    | 5.4.0    | R5s050519 |
| RP-31    | RP-060149 | 1581 | -   | Errors identified in RAB HSDPA testcases in wk42 ATS.                                 | F   | 5.3.0    | 5.4.0    | R5s050520 |
| RP-31    | RP-060149 | 1582 | -   | Summary of regression errors in the wk42 HSDPA ATS                                    | F   | 5.3.0    | 5.4.0    | R5s050503 |
| RP-31    | RP-060159 | 1583 | -   | Correction to GCF WI-10 test case 8.4.1.14  | F   | 5.3.0    | 5.4.0    | R5s050512 |
| RP-31    | RP-060159 | 1584 | -   | TTCN correction to Approved RRC TCs 8.3.4.1, 8.3.4.2 and 8.3.4.3                      | F   | 5.3.0    | 5.4.0    | R5s060044 |
| RP-31    | RP-060159 | 1585 | -   | Summary of regression errors in wk03 RRC and RAB ATS.                                 | F   | 5.3.0    | 5.4.0    | R5s060042 |
| RP-31    | RP-060159 | 1586 | -   | Correction of GCF WI-10 RRC test case 8.4.1.2, 8.4.1.24, 8.4.1.25                     | F   | 5.3.0    | 5.4.0    | R5s060043 |
| RP-31    | RP-060159 | 1587 | -   | Summary of regression errors in the wk03 GCF WI-10 and GCF WI-12 ATS                  | F   | 5.3.0    | 5.4.0    | R5s060010 |
| RP-31    | RP-060159 | 1588 | -   | Correction to GCF WI-10 RRC Test Case 6.1.1.4   | F   | 5.3.0    | 5.4.0    | R5s060024 |
| RP-31    | RP-060159 | 1589 | -   | Correction to GCF WI-12 Testcase 9.4.5.4.6  | F   | 5.3.0    | 5.4.0    | R5s060025 |
| RP-31    | RP-060159 | 1590 | -   | Correction to GCF WI-10 NAS Test Case 12.4.1.4a                                       | F   | 5.3.0    | 5.4.0    | R5s060040 |
| RP-31    | RP-060159 | 1591 | -   | Correction of GCF WI-10 RRC test case 8.1.7.1d  | F   | 5.3.0    | 5.4.0    | R5s060039 |
| RP-31    | RP-060159 | 1592 | -   | Corrections to approved GCF WI-12/1 Inter-RAT test case 8.4.1.48                      | F   | 5.3.0    | 5.4.0    | R5s060029 |
| RP-31    | RP-060159 | 1593 | -   | Corrections to approved GCF WI-10/3 InterRAT test case 8.4.1.31                       | F   | 5.3.0    | 5.4.0    | R5s060028 |
| RP-31    | RP-060159 | 1594 | -   | Corrections to GCF WI-012 GMM testcase 12.9.9   | F   | 5.3.0    | 5.4.0    | R5s060037 |
| RP-31    | RP-060159 | 1595 | -   | Corrections to Approved GCF WI-012 RRC testcases 8.2.1.24 & 8.2.1.34                  | F   | 5.3.0    | 5.4.0    | R5s060036 |
| RP-31    | RP-060159 | 1596 | -   | Correction of GCF WI-10 RRC test case 8.4.1.26  | F   | 5.3.0    | 5.4.0    | R5s060033 |
| RP-31    | RP-060159 | 1597 | -   | Correction of GCF WI-12 MM test case 9.4.3.3  | F   | 5.3.0    | 5.4.0    | R5s060032 |
| RP-31    | RP-060159 | 1598 | -   | Summary of regression errors in wk49 ATS.   | F   | 5.3.0    | 5.4.0    | R5s060009 |
| RP-31    | RP-060159 | 1599 | -   | Correction to GCF WI-12 RLC Test Case 7.2.3.35  | F   | 5.3.0    | 5.4.0    | R5s060008 |
| RP-31    | RP-060159 | 1600 | -   | Correction to GCF WI-10 test case 6.1.2.9   | F   | 5.3.0    | 5.4.0    | R5s060007 |
| RP-31    | RP-060159 | 1601 | -   | Correction to GCF WI-10 test case 8.1.3.9   | F   | 5.3.0    | 5.4.0    | R5s060003 |

| Meet-ing | TSG doc   | CR   | Rev | Subject  | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|--|-----|----------|----------|-----------|
| RP-31    | RP-060159 | 1602 | -   | Summary of regression errors in the wk49 IR_U ATS.   | F   | 5.3.0    | 5.4.0    | R5s060006 |
| RP-31    | RP-060160 | 1603 | -   | Summary of regression errors in the wk47 ATS.  | F   | 5.3.0    | 5.4.0    | R5s050551 |
| RP-31    | RP-060160 | 1604 | -   | TTCN correction to Approved GMM TC 12.4.2.4  | F   | 5.3.0    | 5.4.0    | R5s060004 |
| RP-31    | RP-060160 | 1605 | -   | Corrections to GCF WI-012 approved testcases 9.4.3.3   | F   | 5.3.0    | 5.4.0    | R5s060002 |
| RP-31    | RP-060160 | 1606 | -   | Correction to GCF WI-10 RRC Test Case 8.1.7.1c   | F   | 5.3.0    | 5.4.0    | R5s060001 |
| RP-31    | RP-060160 | 1607 | -   | TTCN Correction for GCF WI-10 RRC test case 6.1.2.8  | F   | 5.3.0    | 5.4.0    | R5s050586 |
| RP-31    | RP-060160 | 1608 | -   | TTCN correction to Approved IRAT TCs 8.3.7.1, 8.3.7.2, 8.3.7.3, 8.3.7.4, 8.3.7.13, 8.3.7.16 and 8.3.11.1 . | F   | 5.3.0    | 5.4.0    | R5s050622 |
| RP-31    | RP-060160 | 1609 | -   | Correction to approved RRC test cases 8.1.6.3, 8.4.1.1, 8.4.1.3 and 8.4.1.29 on Wk49 ATS                   | F   | 5.3.0    | 5.4.0    | R5s050571 |
| RP-31    | RP-060160 | 1610 | -   | Correction to GCF WI 10 RLC testcase 7.2.2.2   | F   | 5.3.0    | 5.4.0    | R5s050583 |
| RP-31    | RP-060160 | 1611 | -   | Summary of regression errors in the wk49 GCF WI-10 and GCF WI-12 ATS                                       | F   | 5.3.0    | 5.4.0    | R5s050580 |
| RP-31    | RP-060160 | 1612 | -   | Corrections to approved GCF WI-010 / GCF WI-012 test cases 14.2.51b.1 and 14.2.58a                         | F   | 5.3.0    | 5.4.0    | R5s050597 |
| RP-31    | RP-060160 | 1613 | -   | TTCN correction to Approved IRAT TC 8.3.7.16   | F   | 5.3.0    | 5.4.0    | R5s050552 |
| RP-31    | RP-060160 | 1614 | -   | Correction to GCF WI-10 approved RRC Test Case 8.1.7.1d  | F   | 5.3.0    | 5.4.0    | R5s050582 |
| RP-31    | RP-060160 | 1615 | -   | Correction to GCF Test Case 8.4.1.2, 8.4.1.24, 8.4.1.25, 8.4.1.6, 8.4.1.8 and HSDPA Test Cases             | F   | 5.3.0    | 5.4.0    | R5s050545 |
| RP-31    | RP-060160 | 1616 | -   | Summary of regression errors in the wk47 GCF WI-10 and GCF WI-12 ATS                                       | F   | 5.3.0    | 5.4.0    | R5s050533 |
| RP-31    | RP-060160 | 1617 | -   | Correction to the GCF WI 10 testcase 7.2.3.13  | F   | 5.3.0    | 5.4.0    | R5s050538 |
| RP-31    | RP-060160 | 1618 | -   | Correction to GCF WI 10 MAC test case 7.1.2.3.1  | F   | 5.3.0    | 5.4.0    | R5s050539 |
| RP-31    | RP-060160 | 1619 | -   | Correction to IR_U test cases 8.3.7.1, 8.3.7.2, 8.3.7.3, 8.3.7.12 and 8.3.7.16                             | F   | 5.3.0    | 5.4.0    | R5s050493 |
| RP-31    | RP-060160 | 1620 | -   | Correction to GCF WI 10 test case 7.1.2.4a   | F   | 5.3.0    | 5.4.0    | R5s050555 |
| RP-31    | RP-060160 | 1621 | -   | Corrections to GCF WI-012 approved test case 16.3  | F   | 5.3.0    | 5.4.0    | R5s050554 |
| RP-31    | RP-060160 | 1622 | -   | Correction to approved GCF WI-010 Test Case 16.1.1   | F   | 5.3.0    | 5.4.0    | R5s050549 |
| RP-31    | RP-060161 | 1623 | -   | TTCN correction to Approved RRC TC 8.1.2.7   | F   | 5.3.0    | 5.4.0    | R5s050553 |
| RP-31    | RP-060161 | 1624 | -   | Correction to GCF WI-10 RRC Test Case 8.3.1.18   | F   | 5.3.0    | 5.4.0    | R5s050543 |
| RP-31    | RP-060161 | 1625 | -   | Correction to GCF WI-10 RRC Test Case 8.1.1.9  | F   | 5.3.0    | 5.4.0    | R5s050544 |
| RP-31    | RP-060161 | 1626 | -   | Correction to GCF WI-12 test case 8.1.6.3  | F   | 5.3.0    | 5.4.0    | R5s050531 |
| RP-31    | RP-060161 | 1627 | -   | Summary of regression errors in the wk42 ATS.  | F   | 5.3.0    | 5.4.0    | R5s050528 |
| RP-31    | RP-060161 | 1628 | -   | Correction to GCF WI-10/3 Testcase 12.4.2.4  | F   | 5.3.0    | 5.4.0    | R5s050505 |
| RP-31    | RP-060161 | 1629 | -   | Correction to test step ts_Exit_Testcase used in MultiRAB test cases                                       | F   | 5.3.0    | 5.4.0    | R5s050514 |
| RP-31    | RP-060161 | 1630 | -   | Correction to GCF WI-010/1 test case 7.1.2.4a  | F   | 5.3.0    | 5.4.0    | R5s050524 |
| RP-31    | RP-060161 | 1631 | -   | Correction to the GCF WI 12 NAS Test Case 9.4.3.3  | F   | 5.3.0    | 5.4.0    | R5s050515 |
| RP-31    | RP-060161 | 1632 | -   | Correction to GCF WI 10 and GCF WI 12 ATS to support IPv6 format for PDP Context                           | F   | 5.3.0    | 5.4.0    | R5s050521 |
| RP-31    | RP-060161 | 1633 | -   | Summary of regression errors in the wk42 GCF WI-10 and GCF WI-12 ATS                                       | F   | 5.3.0    | 5.4.0    | R5s050482 |
| RP-31    | RP-060161 | 1634 | -   | Correction to GCF WI-13 test case 8.1.2.14   | F   | 5.3.0    | 5.4.0    | R5s050526 |
| RP-31    | RP-060161 | 1635 | -   | Correction to GCF WI-13 test case 8.1.2.15   | F   | 5.3.0    | 5.4.0    | R5s050527 |
| RP-31    | RP-060161 | 1636 | -   | Correction to GCF WI-12 test case 9.4.3.3  | F   | 5.3.0    | 5.4.0    | R5s050509 |
| RP-31    | RP-060161 | 1637 | -   | Correction to GCF WI-10 test case 8.1.3.9  | F   | 5.3.0    | 5.4.0    | R5s050507 |
| RP-31    | RP-060161 | 1638 | -   | Corrections of TC_16_2_1, TC_16_2_2, TC_16_1_9_1, TC_16_1_9_2  | F   | 5.3.0    | 5.4.0    | R5s050506 |
| RP-31    | RP-060161 | 1639 | -   | Correction to GCF WI-10 RAB Test Case 14.2.38c   | F   | 5.3.0    | 5.4.0    | R5s050504 |
| RP-31    | RP-060165 | 1640 | -   | Correction to GCF WI 13/1 RRC testcases 8.3.1.38 and 8.3.1.39  | F   | 5.3.0    | 5.4.0    | R5s060023 |
| RP-31    | RP-060165 | 1641 | -   | Corrections to Approved GCF WI-013 RRC testcase 8_1_2_14 & WI-014 RRC testcase 8_2_2_42                    | F   | 5.3.0    | 5.4.0    | R5s060034 |
| RP-31    | RP-060165 | 1642 | -   | Summary of regression errors in wk03 HSDPA ATS (GCF WI-13).  | F   | 5.3.0    | 5.4.0    | R5s060031 |
| RP-31    | RP-060165 | 1643 | -   | Corrections to GCF WI-013 test cases 8.1.6.5 and 8.3.1.40  | F   | 5.3.0    | 5.4.0    | R5s050523 |
| RP-31    | RP-060165 | 1644 | -   | Correction to Rel-5 (HSENH) ATS to support IPv6 format for PDP Context.                                    | F   | 5.3.0    | 5.4.0    | R5s050522 |
| RP-31    | RP-060162 | 1645 | -   | Add new verified and e-mail agreed TTCN test cases in the TC lists in 34.123-3 (prose), Annex A            | F   | 5.3.0    | 5.4.0    | -         |
| RP-31    | RP-060166 | 1646 | -   | Introduce ASP for HSUPA in 34.123-3  | B   | 5.3.0    | 5.4.0    | R5-060560 |
| RP-31    | RP-060147 | 1647 | -   | Introduce ASP for HSDPA of LCR TDD   | B   | 5.3.0    | 5.4.0    | R5-060317 |
| RP-31    | RP-060147 | 1648 | -   | Updating Information in section 8.2.4 (Table 35 )  | F   | 5.3.0    | 5.4.0    | R5-060287 |
| RP-31    | RP-060154 | 1649 | -   | Correction of default value for IXIT parameter "px_CipherAlg".   | F   | 5.3.0    | 5.4.0    | R5-060178 |
| RP-31    | RP-060154 | 1650 | -   | New ASP for DTM and other corrections in 34.123-3  | F   | 5.3.0    | 5.4.0    | R5-060505 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
|          |           |      |     | - Release 99  |     |          |          |           |
| RP-31    | RP-060164 | 1651 | -   | Update configurations, introduce frequency band indicator for SS in 34.123-3 - Release 5.                                     | F   | 5.3.0    | 5.4.0    | R5-060316 |
| RP-32    | RP-060338 | 1652 | -   | Update HSDPA test configuration   | F   | 5.4.0    | 5.5.0    | R5-061004 |
| RP-32    | RP-060338 | 1653 | -   | Change of ASP and IEs for LCR TDD   | F   | 5.4.0    | 5.5.0    | R5-061300 |
| RP-32    | RP-060333 | 1654 | -   | Update E-DCH test model and ASP (CR to 34.123-3)  | F   | 5.4.0    | 5.5.0    | R5-061285 |
| RP-32    | RP-060324 | 1655 | -   | Update PIXIT  | F   | 5.4.0    | 5.5.0    | R5-061003 |
| RP-32    | RP-060324 | 1656 | -   | Correction to ASP CPHY_TFCI_Detected_IND  | F   | 5.4.0    | 5.5.0    | R5-061377 |
| RP-32    | RP-060321 | 1657 | -   | CR to 34.123-3: Add new verified and e-mail agreed TTCN test cases in the TC lists in 34.123-3 (prose), Annex A               | F   | 5.4.0    | 5.5.0    | -         |
| RP-32    | RP-060339 | 1658 | -   | Addition of GCF WI14 test case 8.2.6.48 to HSD_ENH ATS V5.4.0   | B   | 5.4.0    | 5.5.0    | R5s060139 |
| RP-32    | RP-060327 | 1659 | -   | Addition of GCF WI-12 test case 8.3.4.8   | B   | 5.4.0    | 5.5.0    | R5s060019 |
| RP-32    | RP-060327 | 1660 | -   | Addition of GCF WI12 RRC test case 8.2.2.43 to RRC ATS v5.3.0   | B   | 5.4.0    | 5.5.0    | R5s060084 |
| RP-32    | RP-060327 | 1661 | -   | Addition of GCF WI12 RRC test case 8.2.6.39 to RRC ATS v5.4.0 (Revision of R5s060076)   | B   | 5.4.0    | 5.5.0    | R5s060080 |
| RP-32    | RP-060327 | 1662 | -   | Addition of GCF WI12 RRC test case 8.2.6.44 to RRC ATS v5.4.0 (Revision of R5s060078)   | B   | 5.4.0    | 5.5.0    | R5s060082 |
| RP-32    | RP-060327 | 1663 | -   | Addition of GCF WI-10 MM test case 9.4.5.4.1  | B   | 5.4.0    | 5.5.0    | R5s060066 |
| RP-32    | RP-060330 | 1664 | -   | Addition of GCF WI-13 RRC test case 8.4.1.47 to HSD_ENH ATS v5.3.0  | B   | 5.4.0    | 5.5.0    | R5s060070 |
| RP-32    | RP-060330 | 1665 | -   | Addition of GCF WI13 Inter-RAT cell change order from UTRAN test case 8.3.11.12 to HSD_ENH ATS v5.4.0 (Revision of R5s060092) | B   | 5.4.0    | 5.5.0    | R5s060094 |
| RP-32    | RP-060339 | 1666 | -   | Correction to GCF WI14 RAB test case 14_6_1, 14_6_2, 14_6_3, 14_6_3a, 14_6_4, 14_6_4a, 14_6_5, 14_6_5a                        | F   | 5.4.0    | 5.5.0    | R5s060059 |
| RP-32    | RP-060339 | 1667 | -   | Correction to GCF WI14 test case 8_3_1_34 and 8_3_1_36  | F   | 5.4.0    | 5.5.0    | R5s060061 |
| RP-32    | RP-060339 | 1668 | -   | Change of the relative channel powers for HS-PDSCH and HS-SCCH  | F   | 5.4.0    | 5.5.0    | R5s060074 |
| RP-32    | RP-060339 | 1669 | -   | Corrections to RAB testcase 14.6.3a   | F   | 5.4.0    | 5.5.0    | R5s060121 |
| RP-32    | RP-060339 | 1670 | -   | Correction to teststep ts_RRC_MultiCallEstPS_MO_HSDPA, ts_RRC_NAS_SessionActPS_MO_P9_P10_HS                                   | F   | 5.4.0    | 5.5.0    | R5s060114 |
| RP-32    | RP-060339 | 1671 | -   | Corrections to GCF WI 14 RRC test case 8.2.3.34   | F   | 5.4.0    | 5.5.0    | R5s060115 |
| RP-32    | RP-060330 | 1672 | -   | Revised summary of regression errors in IR_U and HSD_ENH_R5_ATS (wk03, 2006)  | F   | 5.4.0    | 5.5.0    | R5s060088 |
| RP-32    | RP-060330 | 1673 | -   | Correction to GCF WI13 test case 6.1.2.10   | F   | 5.4.0    | 5.5.0    | R5s060075 |
| RP-32    | RP-060330 | 1674 | -   | Correction to GCF WI-13 Idle Mode test case 6.1.2.10  | F   | 5.4.0    | 5.5.0    | R5s060089 |
| RP-32    | RP-060330 | 1675 | -   | Corrections to Approved GCF WI-013 RRC testcases 8.4.1.47   | F   | 5.4.0    | 5.5.0    | R5s060135 |
| RP-32    | RP-060330 | 1676 | -   | Additional CR for agreed TC 8.3.11.12 (8.3.11.13 implicitly affected)   | F   | 5.4.0    | 5.5.0    | R5s060118 |
| RP-32    | RP-060325 | 1677 | -   | Correction to GCF WI-10 RRC Test Case 6.2.2.2   | F   | 5.4.0    | 5.5.0    | R5s060050 |
| RP-32    | RP-060325 | 1678 | -   | Correction of GCF WI-10 test case 8.4.1.5   | F   | 5.4.0    | 5.5.0    | R5s060049 |
| RP-32    | RP-060325 | 1679 | -   | Summary of regression errors in the wk06 ATS.   | F   | 5.4.0    | 5.5.0    | R5s060056 |
| RP-32    | RP-060325 | 1680 | -   | Corrections to Security procedure to make UL SRB3 ciphering preconfiguration optional   | F   | 5.4.0    | 5.5.0    | R5s060057 |
| RP-32    | RP-060325 | 1681 | -   | Summary of regression errors in the wk06 GCF WI-10 and GCF WI-12 ATS  | F   | 5.4.0    | 5.5.0    | R5s060047 |
| RP-32    | RP-060325 | 1682 | -   | Correction to the test step ts_DownlinkTBFEstablishment   | F   | 5.4.0    | 5.5.0    | R5s060060 |
| RP-32    | RP-060325 | 1683 | -   | Change to expected value of Qos 'DeliveryOrder' IE.   | F   | 5.4.0    | 5.5.0    | R5s060058 |
| RP-32    | RP-060325 | 1684 | -   | Clarification of the usage of 4 PICS parameters   | F   | 5.4.0    | 5.5.0    | R5s060053 |
| RP-32    | RP-060325 | 1685 | -   | Correction to approved GCF WI-10/2 InterRAT test case 6.2.2.2   | F   | 5.4.0    | 5.5.0    | R5s060055 |
| RP-32    | RP-060325 | 1686 | -   | Correction to approved GCF WI-10/2 InterRAT test case 6.2.2.1   | F   | 5.4.0    | 5.5.0    | R5s060054 |
| RP-32    | RP-060325 | 1687 | -   | Corrections to IRU Measurement test cases for handling of UL only and DL only compressed mode branches                        | F   | 5.4.0    | 5.5.0    | R5s060051 |
| RP-32    | RP-060325 | 1688 | -   | Generic correction to test step "ts_MM_IMSI_Detach"   | F   | 5.4.0    | 5.5.0    | R5s060069 |
| RP-32    | RP-060325 | 1689 | -   | Correction to GCF WI-12 RAB Test Case 14.2.9  | F   | 5.4.0    | 5.5.0    | R5s060068 |
| RP-32    | RP-060325 | 1690 | -   | Summary of regression errors in the wk09 GCF WI-10 and GCF WI-12 ATS  | F   | 5.4.0    | 5.5.0    | R5s060073 |
| RP-32    | RP-060325 | 1691 | -   | Corrections to GCF WI-10 IR_U test case 6.2.1.7 and 6.2.1.8   | F   | 5.4.0    | 5.5.0    | R5s060072 |
| RP-32    | RP-060325 | 1692 | -   | Correction to RRC test cases 8.1.1.1 and 8.1.1.9  | F   | 5.4.0    | 5.5.0    | R5s060086 |
| RP-32    | RP-060325 | 1693 | -   | Correction to WI10 Idle Mode test case 6.1.2.6  | F   | 5.4.0    | 5.5.0    | R5s060087 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
| RP-32    | RP-060325 | 1694 | -   | Correction to the IR_U test case 6.2.2.3  | F   | 5.4.0    | 5.5.0    | R5s060091 |
| RP-32    | RP-060325 | 1695 | -   | Correction to SM GCF WI 10 test case 11.3.1   | F   | 5.4.0    | 5.5.0    | R5s060090 |
| RP-32    | RP-060325 | 1696 | -   | Correction to GCF WI-12 Testcase 9.4.3.3  | F   | 5.4.0    | 5.5.0    | R5s060101 |
| RP-32    | RP-060326 | 1697 | -   | Correction to GCF WI-12 Testcase 9.4.5.4.6  | F   | 5.4.0    | 5.5.0    | R5s060102 |
| RP-32    | RP-060326 | 1698 | -   | Correction to GCF WI-10 Testcase 8.1.7.1c   | F   | 5.4.0    | 5.5.0    | R5s060103 |
| RP-32    | RP-060326 | 1699 | -   | Correction to GCF WI-15 Test Cases  | F   | 5.4.0    | 5.5.0    | R5s060104 |
| RP-32    | RP-060326 | 1700 | -   | TTCN correction to Approved RRC TCs 8.3.4.1, 8.3.4.2 and 8.3.4.3  | F   | 5.4.0    | 5.5.0    | R5s060096 |
| RP-32    | RP-060326 | 1701 | -   | TTCN correction to Approved RRC TC 8.4.1.14   | F   | 5.4.0    | 5.5.0    | R5s060095 |
| RP-32    | RP-060326 | 1702 | -   | Correction of approved IR_U test case 8.3.11.1.   | F   | 5.4.0    | 5.5.0    | R5s060097 |
| RP-32    | RP-060326 | 1703 | -   | Correction of approved HSD_ENH_R5 test cases 8.3.11.9, 8.3.11.13 and of 8.3.11.12 (under approval).   | F   | 5.4.0    | 5.5.0    | R5s060098 |
| RP-32    | RP-060326 | 1704 | -   | Correction to GCF WI-10 GMM test case 12.4.2.4  | F   | 5.4.0    | 5.5.0    | R5s060110 |
| RP-32    | RP-060326 | 1705 | -   | Correction in TTCN for RLC Test cases 7.2.3.21, 7.2.3.22 and 7.2.3.24   | F   | 5.4.0    | 5.5.0    | R5s060109 |
| RP-32    | RP-060326 | 1706 | -   | Correction to RRC GCF WI 12 test case 8.3.1.30  | F   | 5.4.0    | 5.5.0    | R5s060106 |
| RP-32    | RP-060326 | 1707 | -   | Corrections to RAB testcase 14.2.41   | F   | 5.4.0    | 5.5.0    | R5s060120 |
| RP-32    | RP-060326 | 1708 | -   | Correction to GCF WI-10 RRC Test Case 8.1.1.9   | F   | 5.4.0    | 5.5.0    | R5s060119 |
| RP-32    | RP-060326 | 1709 | -   | Correction to the constraints used for the Radio Bearer Reconfiguration Message   | F   | 5.4.0    | 5.5.0    | R5s060113 |
| RP-32    | RP-060326 | 1710 | -   | Correction to RRC test cases 8.3.1.21 and 8.3.2.11  | F   | 5.4.0    | 5.5.0    | R5s060112 |
| RP-32    | RP-060326 | 1711 | -   | Summary of regression errors in the wk11 ATS.   | F   | 5.4.0    | 5.5.0    | R5s060111 |
| RP-32    | RP-060326 | 1712 | -   | Corrections to TTCN test cases due to the review of 34.123-2 and, related, the implementation of test case selection expressions in the TTCN. | F   | 5.4.0    | 5.5.0    | R5s060116 |
| RP-32    | RP-060326 | 1713 | -   | Empty all PCOs when TC begins   | F   | 5.4.0    | 5.5.0    | R5s060064 |
| RP-32    | RP-060326 | 1714 | -   | Correction to QOS parameters for UMTS only mobiles  | F   | 5.4.0    | 5.5.0    | R5s060041 |
| RP-32    | RP-060326 | 1715 | -   | Correction to GCF Test Case 8.4.1.25  | F   | 5.4.0    | 5.5.0    | R5s060141 |
| RP-32    | RP-060326 | 1716 | -   | Correction to GCF WI-10 Testcase 7.2.3.21   | F   | 5.4.0    | 5.5.0    | R5s060126 |
| RP-32    | RP-060327 | 1717 | -   | Correction to GCF WI-12 Testcase 9.4.3.3  | F   | 5.4.0    | 5.5.0    | R5s060127 |
| RP-32    | RP-060327 | 1718 | -   | Correction to GCF WI-10 IR-U Test Case 6.2.2.3  | F   | 5.4.0    | 5.5.0    | R5s060128 |
| RP-32    | RP-060327 | 1719 | -   | Correction to the RRC test case 6.1.2.8   | F   | 5.4.0    | 5.5.0    | R5s060123 |
| RP-32    | RP-060327 | 1720 | -   | Correction to GCF WI-12 NAS Test Case 9.4.3.3   | F   | 5.4.0    | 5.5.0    | R5s060122 |
| RP-32    | RP-060327 | 1721 | -   | Correction to GCF WI-10 SMS Test Case 16.x  | F   | 5.4.0    | 5.5.0    | R5s060136 |
| RP-32    | RP-060327 | 1722 | -   | Correction to the IR_U test case 8.3.11.1   | F   | 5.4.0    | 5.5.0    | R5s060130 |
| RP-32    | RP-060327 | 1723 | -   | Correction to the approved IR_U test cases 8.3.7.1 and 8.3.7.3  | F   | 5.4.0    | 5.5.0    | R5s060131 |
| RP-32    | RP-060327 | 1724 | -   | Correction to the GCF WI-12 test case 8.4.1.48  | F   | 5.4.0    | 5.5.0    | R5s060134 |
| RP-32    | RP-060327 | 1725 | -   | Correction to the common security teststeps to add the default test step  | F   | 5.4.0    | 5.5.0    | R5s060133 |
| RP-32    | RP-060327 | 1726 | -   | Correction to Cell Broadcast test case 16.3   | F   | 5.4.0    | 5.5.0    | R5s060125 |
| RP-32    | RP-060327 | 1727 | -   | Correction to the RRC test case 8.1.1.9   | F   | 5.4.0    | 5.5.0    | R5s060124 |
| RP-32    | RP-060327 | 1728 | -   | Correction to the RRC compressed mode testcases   | F   | 5.4.0    | 5.5.0    | R5s060132 |
| RP-32    | RP-060327 | 1729 | -   | Correction of erroneous determination of OP-Mode in multiple ATSS   | F   | 5.4.0    | 5.5.0    | R5s060117 |
| RP-33    | RP-060548 | 1730 | -   | CR to 34.123-3: Add new verified and e-mail agreed TTCN test cases in the TC lists in 34.123-3 (prose), Annex A                               | F   | 5.5.0    | 5.6.0    | -         |
| RP-33    | RP-060555 | 1731 | -   | Correction to the RRC testcase 8.4.1.23   | F   | 5.5.0    | 5.6.0    | R5s060225 |
| RP-33    | RP-060555 | 1732 | -   | Correction to the RRC testcase 8.4.1.25   | F   | 5.5.0    | 5.6.0    | R5s060226 |
| RP-33    | RP-060555 | 1733 | -   | Correction to the GMM test case 12.9.7b   | F   | 5.5.0    | 5.6.0    | R5s060223 |
| RP-33    | RP-060555 | 1734 | -   | Correction of Inter RAT testcase 12.8   | F   | 5.5.0    | 5.6.0    | R5s060222 |
| RP-33    | RP-060555 | 1735 | -   | Summary of regression errors in wk29 GCF WI-10 ATS  | F   | 5.5.0    | 5.6.0    | R5s060227 |
| RP-33    | RP-060555 | 1736 | -   | Correction to GCF WI-010/1 approved test case 7.2.3.27  | F   | 5.5.0    | 5.6.0    | R5s060230 |
| RP-33    | RP-060555 | 1737 | -   | Correction to GCF WI-12/1 approved test case 8.2.2.43   | F   | 5.5.0    | 5.6.0    | R5s060231 |
| RP-33    | RP-060569 | 1738 | -   | Correction to test cases 14.6.4   | F   | 5.5.0    | 5.6.0    | R5s060229 |
| RP-33    | RP-060555 | 1739 | -   | Correction to test cases 8.2.2.35 & tcv_BcapMmedia  | F   | 5.5.0    | 5.6.0    | R5s060232 |
| RP-33    | RP-060555 | 1740 | -   | Correction to GCF WI10 RRC Test Case 8.4.1.5  | F   | 5.5.0    | 5.6.0    | R5s060218 |
| RP-33    | RP-060555 | 1741 | -   | Correction to approved GCF WI-12 RAB test case 14.2.58a   | F   | 5.5.0    | 5.6.0    | R5s060221 |
| RP-33    | RP-060555 | 1742 | -   | Correction to approved GCF WI-12 RRC test cases 8.2.6.39 and 8.2.6.44   | F   | 5.5.0    | 5.6.0    | R5s060220 |
| RP-33    | RP-060555 | 1743 | -   | Correction to approved GCF WI-10 RLC test case 7.2.3.17   | F   | 5.5.0    | 5.6.0    | R5s060219 |
| RP-33    | RP-060555 | 1744 | -   | Summary of Regression Errors in NAS wk29 ATS  | F   | 5.5.0    | 5.6.0    | R5s060217 |
| RP-33    | RP-060569 | 1745 | -   | Correction GCF WI-14 HSDPA Test Case 8.2.1.27   | F   | 5.5.0    | 5.6.0    | R5s060214 |
| RP-33    | RP-060569 | 1746 | -   | Correction to test cases 14.6.6   | F   | 5.5.0    | 5.6.0    | R5s060215 |
| RP-33    | RP-060555 | 1747 | -   | Summary of Regression Errors in WK29 ATS  | F   | 5.5.0    | 5.6.0    | R5s060212 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
| RP-33    | RP-060555 | 1748 | -   | ASP enhancement for HSUPA testing                                     | F   | 5.5.0    | 5.6.0    | R5s060196 |
| RP-33    | RP-060569 | 1749 | -   | Summary of regression errors in the wk27 HSD Suite                    | F   | 5.5.0    | 5.6.0    | R5s060209 |
| RP-33    | RP-060555 | 1750 | -   | Summary of regression errors in the wk27 RLC ATS                      | F   | 5.5.0    | 5.6.0    | R5s060210 |
| RP-33    | RP-060555 | 1751 | -   | Corrections to GCF WI-12/1 approved test case 7.1.3.2                 | F   | 5.5.0    | 5.6.0    | R5s060208 |
| RP-33    | RP-060554 | 1752 | -   | Addition of GCF WI10 RRC test case 8.4.1.8 to RRC ATS v5.5.0          | B   | 5.5.0    | 5.6.0    | R5s060201 |
| RP-33    | RP-060555 | 1753 | -   | Corrections to GCF WI-12/1 approved test case 12.9.7a.                | F   | 5.5.0    | 5.6.0    | R5s060206 |
| RP-33    | RP-060569 | 1754 | -   | Summary of Regression Errors in HSDPA ATS                             | F   | 5.5.0    | 5.6.0    | R5s060207 |
| RP-33    | RP-060555 | 1755 | -   | Summary of regression errors in the wk27 GCF WI-10 and GCF WI-12 ATS  | F   | 5.5.0    | 5.6.0    | R5s060205 |
| RP-33    | RP-060555 | 1756 | -   | Correction to GCF WI-10 Idle Mode test case 6.1.2.5                   | F   | 5.5.0    | 5.6.0    | R5s060203 |
| RP-33    | RP-060556 | 1757 | -   | Correction to GCF WI-10 RRC test case 8.3.4.3                         | F   | 5.5.0    | 5.6.0    | R5s060204 |
| RP-33    | RP-060556 | 1758 | -   | Regression Error report for RRC & MAC ATS                             | F   | 5.5.0    | 5.6.0    | R5s060199 |
| RP-33    | RP-060559 | 1759 | -   | Regression Error report for HSD_ENH_r5 ATS                            | F   | 5.5.0    | 5.6.0    | R5s060200 |
| RP-33    | RP-060559 | 1760 | -   | Correction of CC procedure for multimedia calls                       | F   | 5.5.0    | 5.6.0    | R5s060063 |
| RP-33    | RP-060556 | 1761 | -   | Corrections to GCF WI-10 RRC Test Case 8.4.1.24 and 8.4.1.25          | F   | 5.5.0    | 5.6.0    | R5s060198 |
| RP-33    | RP-060554 | 1762 | -   | Addition of GCF WI-015 AGPS test case 17.2.3.7 to AGPS ATS V5.5.0     | B   | 5.5.0    | 5.6.0    | R5s060193 |
| RP-33    | RP-060554 | 1763 | -   | Addition of GCF WI-015 AGPS test case 17.2.3.6 to AGPS ATS V5.5.0     | B   | 5.5.0    | 5.6.0    | R5s060192 |
| RP-33    | RP-060556 | 1764 | -   | Correction to GCF WI-12 NAS Test Case 12.9.9                          | F   | 5.5.0    | 5.6.0    | R5s060197 |
| RP-33    | RP-060556 | 1765 | -   | Correction to the RRC testcase 8.2.3.8                                | F   | 5.5.0    | 5.6.0    | R5s060190 |
| RP-33    | RP-060556 | 1766 | -   | Correction to the RRC testcase 8.2.4.1                                | F   | 5.5.0    | 5.6.0    | R5s060191 |
| RP-33    | RP-060556 | 1767 | -   | Correction of GCF WI-10 RRC Test Case 8.3.1.10 and 8.3.2.4            | F   | 5.5.0    | 5.6.0    | R5s060186 |
| RP-33    | RP-060556 | 1768 | -   | Correction to the Security procedure                                  | F   | 5.5.0    | 5.6.0    | R5s060189 |
| RP-33    | RP-060556 | 1769 | -   | Correction to GCF WI-10 NAS Test Case 11.1.1.1                        | F   | 5.5.0    | 5.6.0    | R5s060178 |
| RP-33    | RP-060556 | 1770 | -   | Correction to GCF WI-12 RRC Test Case 8.1.1.10                        | F   | 5.5.0    | 5.6.0    | R5s060187 |
| RP-33    | RP-060556 | 1771 | -   | Correction to the test step ts_ToStateMOCCompressMode_CS_6_9_PS_6_10  | F   | 5.5.0    | 5.6.0    | R5s060188 |
| RP-33    | RP-060561 | 1772 | -   | Moving baseline to the June 06, Rel-6                                 | F   | 5.5.0    | 5.6.0    | R5s060183 |
| RP-33    | RP-060556 | 1773 | -   | Corrections to GCF WI-10 SMS Test Cases 16.1.1 and 16.1.2             | F   | 5.5.0    | 5.6.0    | R5s060185 |
| RP-33    | RP-060559 | 1774 | -   | Corrections to GCF WI-13 Test Case 8.3.11.13                          | F   | 5.5.0    | 5.6.0    | R5s060184 |
| RP-33    | RP-060556 | 1775 | -   | Correction GCF WI-12 Inter-RAT Test Case 8.4.1.48                     | F   | 5.5.0    | 5.6.0    | R5s060182 |
| RP-33    | RP-060569 | 1776 | -   | Corrections to GCF WI-14 test case 14.6.4                             | F   | 5.5.0    | 5.6.0    | R5s060181 |
| RP-33    | RP-060556 | 1777 | -   | Correction of GCF WI-10 Idle Mode Testcase 6.1.2.6                    | F   | 5.5.0    | 5.6.0    | R5s060180 |
| RP-33    | RP-060556 | 1778 | -   | Correction of value for t_IdlePageTimer timer                         | F   | 5.5.0    | 5.6.0    | R5s060175 |
| RP-33    | RP-060556 | 1779 | -   | Correction to GCF WI-12 NAS Test Case 12.9.9                          | F   | 5.5.0    | 5.6.0    | R5s060176 |
| RP-33    | RP-060556 | 1780 | -   | Correction to Approved GCF WI-10 NAS test case 12.9.6                 | F   | 5.5.0    | 5.6.0    | R5s060179 |
| RP-33    | RP-060556 | 1781 | -   | Summary of regression errors in wk23 GCF WI-10 and GCF WI-12 ATS      | F   | 5.5.0    | 5.6.0    | R5s060177 |
| RP-33    | RP-060556 | 1782 | -   | Correction to the test step ts_U2GCellChange_RAUpdate                 | F   | 5.5.0    | 5.6.0    | R5s060174 |
| RP-33    | RP-060556 | 1783 | -   | Corrections to GCF WI-12/1 IR_U test case 8.4.1.48                    | F   | 5.5.0    | 5.6.0    | R5s060173 |
| RP-33    | RP-060569 | 1784 | -   | Correction to test case 8.2.6.48                                      | F   | 5.5.0    | 5.6.0    | R5s060170 |
| RP-33    | RP-060559 | 1785 | -   | Correction to test case 8.1.6.5                                       | F   | 5.5.0    | 5.6.0    | R5s060171 |
| RP-33    | RP-060557 | 1786 | -   | Correction to test step ts_SS_Rel                                     | F   | 5.5.0    | 5.6.0    | R5s060172 |
| RP-33    | RP-060557 | 1787 | -   | Correction to the GCF WI-12 RRC testcase 8.1.6.3                      | F   | 5.5.0    | 5.6.0    | R5s060169 |
| RP-33    | RP-060557 | 1788 | -   | Correction to the GCF WI-10 NAS test case 12.4.2.4                    | F   | 5.5.0    | 5.6.0    | R5s060166 |
| RP-33    | RP-060557 | 1789 | -   | Correction to the GCF WI-10 RRC test case 8.4.1.2                     | F   | 5.5.0    | 5.6.0    | R5s060167 |
| RP-33    | RP-060557 | 1790 | -   | Summary of regression errors in the wk21 GCF WI-10 and WI-12 ATS      | F   | 5.5.0    | 5.6.0    | R5s060168 |
| RP-33    | RP-060569 | 1791 | -   | Summary of regression errors in the wk21 HSD_ENH ATS                  | F   | 5.5.0    | 5.6.0    | R5s060165 |
| RP-33    | RP-060569 | 1792 | -   | Correction to GCF WI14 test case 8.2.6.39a and 8.2.6.39b              | F   | 5.5.0    | 5.6.0    | R5s060164 |
| RP-33    | RP-060557 | 1793 | -   | Correction of GCF WI-12 and 10 NAS Test cases 9.4.5.4.6 and 9.4.5.4.1 | F   | 5.5.0    | 5.6.0    | R5s060163 |
| RP-33    | RP-060554 | 1794 | -   | Addition of GCF WI-012 MAC test case 7.1.3.2 to MAC ATS V5.4.0        | B   | 5.5.0    | 5.6.0    | R5s060161 |
| RP-33    | RP-060557 | 1795 | -   | Correction of GCF WI-10 IR_U Testcase 8.3.11.4                        | F   | 5.5.0    | 5.6.0    | R5s060158 |
| RP-33    | RP-060569 | 1796 | -   | Addition of GCF WI14/3 test case 14.6.6 to HSD_ENH ATS V5.4.0         | B   | 5.5.0    | 5.6.0    | R5s060159 |
| RP-33    | RP-060569 | 1797 | -   | Correction of GCF WI-14 HSDPA Testcase 8.3.11.10                      | F   | 5.5.0    | 5.6.0    | R5s060156 |
| RP-33    | RP-060557 | 1798 | -   | Correction of GCF WI-12 RRC Testcase 8.3.1.30                         | F   | 5.5.0    | 5.6.0    | R5s060157 |
| RP-33    | RP-060569 | 1799 | -   | Addition of GCF WI14/3 test case 14.6.1a to HSD_ENH ATS V5.4.0        | B   | 5.5.0    | 5.6.0    | R5s060154 |

| Meet-ing | TSG doc   | CR   | Rev | Subject   | Cat | Old vers | New vers | WG doc    |
|----------|-----------|------|-----|---|-----|----------|----------|-----------|
| RP-33    | RP-060557 | 1800 | -   | Summary of regression errors in the wk18 GCF WI-10 and GCF WI-12 ATS                      | F   | 5.5.0    | 5.6.0    | R5s060148 |
| RP-33    | RP-060557 | 1801 | -   | Correction to common teststeps ts_RRC_ReceiveUE_CapabilityInfo and ts_CheckUE_Capability  | F   | 5.5.0    | 5.6.0    | R5s060146 |
| RP-33    | RP-060557 | 1802 | -   | Correction to the constraint cbr_108_RRC_SecModeCmpl in approved teststep ts_RRC_Security | F   | 5.5.0    | 5.6.0    | R5s060147 |
| RP-33    | RP-060569 | 1803 | -   | Correction to test step ts_RRC_ConnRel_AfterSwitchOff_r5                                  | F   | 5.5.0    | 5.6.0    | R5s060153 |
| RP-33    | RP-060569 | 1804 | -   | Correction of GCF WI-14 HSDPA MAC test case 7.1.5.4                                       | F   | 5.5.0    | 5.6.0    | R5s060149 |
| RP-33    | RP-060557 | 1805 | -   | Proposed enhancement for calculation of DPCH Frame Offset                                 | F   | 5.5.0    | 5.6.0    | R5s060150 |
| RP-33    | RP-060557 | 1806 | -   | Correction of PLMN presentation in test step ts_MMI_PLMN_SelPerf                          | F   | 5.5.0    | 5.6.0    | R5s060152 |
| RP-33    | RP-060557 | 1807 | -   | Correction to InterRAT Idle Mode frequency lists  | F   | 5.5.0    | 5.6.0    | R5s060151 |
| RP-33    | RP-060557 | 1808 | -   | Correction to GCF WI-10 Idle Mode test case 6.1.2.3                                       | F   | 5.5.0    | 5.6.0    | R5s060144 |
| RP-33    | RP-060557 | 1809 | -   | Correction of integrity error in TC 8.1.7.1d  | F   | 5.5.0    | 5.6.0    | R5s060145 |
| RP-33    | RP-060569 | 1810 | -   | TTCN correction to mac-hs testcase 7.1.5.6  | F   | 5.5.0    | 5.6.0    | R5s060143 |
| RP-33    | RP-060558 | 1811 | -   | Summary of regression errors in wk29 IRAT ATSs.   | F   | 5.5.0    | 5.6.0    | R5s060236 |
| RP-33    | RP-060558 | 1812 | -   | Correction to Approved GCF WI-10 NAS test case 12.4.1.1a                                  | F   | 5.5.0    | 5.6.0    | R5s060243 |
| RP-33    | RP-060558 | 1813 | -   | Summary of Regression Errors in RRC wk34 ATS  | F   | 5.5.0    | 5.6.0    | R5s060248 |
| RP-33    | RP-060558 | 1814 | -   | Summary of Regression Errors in NAS wk34 ATS  | F   | 5.5.0    | 5.6.0    | R5s060249 |
| RP-33    | RP-060558 | 1815 | -   | Summary of Regression Errors in SMS wk34 ATS  | F   | 5.5.0    | 5.6.0    | R5s060250 |
| RP-33    | RP-060559 | 1816 | -   | Summary of Regression Errors in HSD_ENH wk34 ATS  | F   | 5.5.0    | 5.6.0    | R5s060256 |
| RP-33    | RP-060558 | 1817 | -   | Correction to GCF WI-12 IR_U Test Case 8.4.1.48   | F   | 5.5.0    | 5.6.0    | R5s060253 |
| RP-33    | RP-060558 | 1818 | -   | Summary of regression errors in wk34 GCF WI-10 and GCF WI-12 ATS                          | F   | 5.5.0    | 5.6.0    | R5s060255 |
| RP-33    | RP-060558 | 1819 | -   | Correction to UE capability constraints   | F   | 5.5.0    | 5.6.0    | R5s060254 |
| RP-33    | RP-060558 | 1820 | -   | Addition of GCF WI-017 test case 8.3.7.17 to IR_U_r3 ATS V5.5.0.                          | B   | 5.5.0    | 5.6.0    | R5s060234 |
| RP-33    | RP-060564 | 1821 | -   | CR to 34.123-3: ASP changes for EDCH test   | F   | 5.5.0    | 5.6.0    | R5-062325 |
| RP-33    | RP-060551 | 1822 | -   | New ASP and updated ASP to resolve SRB3 UL ciphering                                      | F   | 5.5.0    | 5.6.0    | R5-062534 |
| RP-33    | RP-060551 | 1825 | -   | CR to 34.123-3: Update TSO and PIXIT  | F   | 5.5.0    | 5.6.0    | R5-062395 |
| RP-33    | RP-060551 | 1826 | -   | CR to 34.123-3: SFN offset issue in the CFN timing-maintained test                        | F   | 5.5.0    | 5.6.0    | R5-062046 |
| RP-33    | RP-060560 | 1827 | -   | CR to 34.123-3: GERAN additional bands for interRAT test                                  | F   | 5.5.0    | 5.6.0    | R5-062537 |
| RP-33    | RP-060553 | 1823 | -   | Production of pointer version 5.6.0 of TS 34.123-3 with no technical contents             | F   | 5.5.0    | 5.6.0    | R5-062535 |

---

## History

| <b>Document history</b> |               |             |
|-------------------------|---------------|-------------|
| V5.0.0                  | March 2005    | Publication |
| V5.1.0                  | June 2005     | Publication |
| V5.2.0                  | October 2005  | Publication |
| V5.3.0                  | December 2005 | Publication |
| V5.4.0                  | March 2006    | Publication |
| V5.5.0                  | June 2006     | Publication |
| V5.6.0                  | October 2006  | Publication |